

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI21000735/BQF3Q2

Date: 25/02/2021

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00009342000

Claimant Vehicle No : SMT7556H Insured Vehicle No : SLW4634G

Date of Loss: 14/01/2021 Nature of Claim: TP Claim No: SNM21D200247/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMT7556H**

Make & Model: TOYOTA COROLLA ALTIS, 1.6 (A) Engine No: 1ZRX272859

Reg. Date: 14/06/2013 (Man. Year: 2013) Chassis No: MR053REE104159164

Colour: Grey Odometer: 103673 km

Engine Capacity: 1598 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65R15 Rear Tyre Size: 195/65R15

Front Left Side: Falken 5 mm Rear Left Side: Continental 5 mm

Front Right Side: Falken 5 mm Rear Right Side: Continental 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,165.25	1,269.06	896.19	41.39
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,140.00	840.00	300.00	26.32
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,305.25	2,109.06	1,196.19	36.19
Approved Total (Overridden) (S\$)		1,700.00		
Nett Amount (S\$)	3,305.25	1,700.00	1,605.25	48.57

INSPECTION

Date of Assignment: 15/01/2021

Date Inspected: 15/01/2021 Inspected At:

King's Auto Repair & Service Pte Ltd
(HQ)
BLK 176 SIN MING DRIVE, #02-10
Singapore 575721

Estimated Period of Repair: 5.0 days

Adjuster: Lim Teow Guan

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 22 Feb 2021)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMT7556H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT RH FENDER	Repair	662.64 FL	*- FL
2	1		*FRONT RH LAMP	Cut	530.09 FL	*530.09 FL
3	1		*FRONT RH FENDER INNER SHIELD	Not Damaged	171.80 FL	*- FL
4	1		*SET FRONT RH FENDER INNER SHIELD CLIPS	Not Necessary	30.00 FL	*- FL
5	1		*FRONT BUMPER	Cut	465.99 FL	*465.99 FL
6	2		*FRONT BUMPER SIDE RETAINER	Necessary	114.26 FL	*97.70 FL
7	2		*FRONT BUMPER BRACKET	Not Damaged	82.24 FL	*- FL
8	1		*FRONT BUMPER LOWER GRILLE	Broken	336.38 FL	*247.30 FL
9	1		*FRONT RH FOG LAMP	Broken	282.60 FL	*254.00 FL
10	1		*FRONT RH FOG LAMP COVER	Broken	67.00 FL	*67.00 FL
11	1		*FRONT BUMPER SPONGE	Not Damaged	102.00 FL	*- FL
12	1		*SET FRONT BUMPER CLIPS	Necessary	42.00 FL	*30.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	2,887.00	1,692.08
- List Item Discount on L Items 25.00/25.00% (\$\$)	721.75	423.02
Total Parts (\$\$)	2,165.25	1,269.06

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	500.00	400.00
2	SPRAY PAINTING	New	600.00	400.00
3	CHECK WIRINGS AND LIGHTINGS	New	40.00	40.00
Gross Labour Cost (S\$)			1,140.00	840.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >