

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/III21000837/T1QF3E2

Date: 04/02/2021

REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D21MFL0000447
Claimant Vehicle No : SLL6826P **Insured Vehicle No :** SLQ774T
Date of Loss: 17/01/2021 Nature of Claim: TP Claim No: MFL2021D0000338

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLL6826P**
Make & Model: VOLKSWAGEN NEW GOLF, 1.4 AT 5K13G5 (A) Engine No: CAX515447
Reg. Date: 25/05/2010 (Man. Year: 2010) Chassis No: WVVZZZ1KZAW346378
Colour: White Odometer: 224043 km
Engine Capacity: 1390 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/40 R18 Rear Tyre Size: 225/40 R18
Front Left Side: Habilead 6 mm Rear Left Side: Habilead 6 mm
Front Right Side: Habilead 6 mm Rear Right Side: Habilead 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 18/01/2021
Date Inspected: 19/01/2021 Inspected At: Garage 13 Pte Ltd (HQ)
8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46
Singapore 415875
Estimated Period of Repair: 0.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 04 Feb 2021)
Parts:	144	VOLKSWAGEN NEW GOLF 1.4 AT 5K13G5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLL6826P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >