

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG21000900/UBA3Q2
Date: 16/07/2021

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800064203
Claimant Vehicle No :	SLE4871H	Insured Vehicle No :	SLK3225Z
Date of Loss:	18/01/2021	Nature of Claim:	TP
		Claim No:	8025438032SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLE4871H		
Make & Model:	HONDA VEZEL, 1.5 X (A)	Engine No:	L15B4031661
Reg. Date:	23/07/2016 (Man. Year: 2015)	Chassis No:	RU11111654
Colour:	White	Odometer:	77415 km
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	215/60 R16	Rear Tyre Size:	215/60 R16
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	7,012.16	4,664.56	2,347.60	33.48
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,140.00	2,510.00	630.00	20.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,152.16	7,174.56	2,977.60	29.33
Approved Total (Overridden) (S\$)		5,700.00		

(S\$)	10,152.16	5,700.00	4,452.16	43.85
+ GST 7.00/7.00% (S\$)	710.65	399.00	311.65	43.85
Nett Amount (S\$)	10,862.81	6,099.00	4,763.81	43.85
+ Car Rental (8.0 x S\$100.00/day + 7.00% GST) (S\$)		856.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		6,957.00		

INSPECTION

Date of Assignment: 19/01/2021

Date Inspected: 19/01/2021

Estimated Period of Repair: 6.0 days

Inspected At: Tan Lim Motor Pte Ltd (Defu)
1 Defu Lane 6
Singapore 539365

Adjuster: MARCUS CHUA**Manager:** CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Badly Dented	1,050.00 FL	*953.00 FL
2	1		*TAILGATE LID VEZEL BADGE	Necessary	42.90 FL	*42.90 FL
3	1		*TAILGATE LID LOCK -TOP	Twisted	274.90 FL	*181.90 FL
4	1		*TAILGATE LID LOCK LATCH BOTTOM	Not Necessary	35.10 FL	*- FL
5	1		*TAILGATE LID INNER TRIMBOARD	Deformed / Cracked	233.40 FL	*233.40 FL
6	4		*TAILGATE LID INNER TRIMBOARD CLIP	Not Necessary	20.80 FL	*- FL
7	1		*TAILGATE LID OPENING SENSOR LOCK	Not Necessary	181.70 FL	*- FL
8	2		*TAILGATE LID RUBBER STOPPER	Not Necessary	52.20 FL	*- FL
9	1		*TAILGATE LID OUTER GARNISH EMBLEM	Not Necessary	215.70 FL	*- FL
10	1		*TAILGATE LID OUTER GARNISH	Repair	225.90 FL	*- FL
11	1		*N/S TAILGATE LID ABSORBER STAY	Not Necessary	196.10 FL	*- FL
12	1		*N/S TAILGATE LID REFLECTOR	Cracked	284.60 FL	*280.40 FL
13	1		*TAILGATE LID WEATHERSTRIP	Twisted	192.50 FL	*101.30 FL
14	1		*N/S TAILLAMP	Cracked	449.10 FL	*449.10 FL
15	4		*N/S TAILLAMP CLIP HOLDER	Not Necessary	60.00 FL	*- FL
16	1		*REAR BUMPER	Distorted	762.70 FL	*549.20 FL
17	2		*REAR BUMPER SPACER SCREW	Not Necessary	10.00 FL	*- FL
18	1		*N/S REAR BUMPER REFLECTOR	Cracked	248.40 FL	*151.00 FL
19	1		*N/S REAR BUMPER SIDE RETAINER	Not Necessary	41.50 FL	*- FL
20	1		*N/S REAR BUMPER SIDE HOLDER	Not Necessary	25.00 FL	*- FL
21	1		*SET N/S REAR BUMPER CLIPS	Necessary	41.60 FL	*41.60 FL
22	1		*N/S REAR BUMPER SIDE	Distorted	279.30 FL	*279.30 FL
23	2		*N/S REAR BUMPER SIDE WEATHERSTRIP	Necessary (1 PCS ONLY)	314.40 FL	*86.20 FL
24	1		*REAR END PANEL	Badly Dented	415.60 FL	*415.60 FL
25	1		*REAR END PANEL INNER TRIM	Twisted	286.80 FL	*188.00 FL
26	6		*REAR END PANEL INNER TRIM CLIP	Not Necessary	31.20 FL	*- FL
27	1		*REARLUGGAGE FLOOR PANEL	Crumpled / Buckled	917.90 FL	*917.90 FL
28	1		*N/S REAR FENDER	Repair	682.50 FL	*- FL
29	1		*N/S REAR FENDER INNER TRIM	Deformed / Twisted	344.20 FL	*344.20 FL
30	10		*N/S REAR FENDER INNER TRIM CLIPS	Not Necessary	55.00 FL	*- FL
31	1		*N/S REAR FENDER WHEEL ARCH FLARE	Distorted	271.10 FL	*180.10 FL
32	1		*REAR BUMPER LOWER DIFFUSER	Deformed	348.10 FL	*348.10 FL
33	1		*SET REAR WINDSCREEN GLASS SEALANT	Necessary	60.00 FS	*40.00 FS
34	1		*REAR WINDSCREEN GLASS INNER SPONGE SEAL	Necessary	40.00 FS	*30.00 FS
35	1		*REAR LICENCE PLATE	Not Necessary	40.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
F=Franchise part. S=SpcNett. L=ListItemDisc.						
					Sub Total (S\$)	8,730.20
					- List Item Discount on L Items 20.00/20.00% (S\$)	1,718.04
					Total Parts (S\$)	7,012.16

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REINSTALL OF REAR BUMPER PARKING SENSOR	New	80.00	50.00
2	TO DISMANTLE AND REFIT TRIMMING ,GARNISH ETC , TO ENABLE NECESSARY BODY WORK REPAIR	New	80.00	80.00
3	TO REMOVE AND REFIT REAR WINDSCREEN GLASS	New	120.00	120.00
4	TO TRANSFER OF TAILGATE FITTINGS AND PERFORM WATER SEEPAGE TEST	New	80.00	60.00
5	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	100.00	20.00
6	TO RUST-PROOFING OF THE AFFECTED AREAS	New	200.00	80.00
7	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	80.00	0.00
8	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	1,200.00	1,000.00
9	PANEL BEATING ,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION ,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME	New	1,200.00	1,100.00
Gross Labour Cost (\$\$)			3,140.00	2,510.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >