



24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

INVOICE

Seow Wei Ling
C/o: Jementah Motor Works
Blk 14 Defu Lane 10
#01-406 Singapore 539195

Invoice No: CL/200559

Ref No: JMW/11/2002/TP

Date: 18 November 2020

DESCRIPTION	AMOUNT
OUR SERVICE FEE CHARGES: - SURVEY INSPECTION FOR VEHICLE NO. <u>SKB 8079 E</u> - RESURVEY INSPECTION - DIGITAL PHOTOGRAPHS SERVICES (INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS) - TRANSPORTATION	
GRAND TOTAL	S\$ 839.00

E & O. E

All cheque payment should be "Crossed" and made payable to " **C L APPRAISER PTE LTD** "

We shall be grateful if you could forward our payment at your early convenience.



CL Appraiser Pte Ltd

CL APPRAISER PTE LTD

24 Penshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Seow Wei Ling
C/o: Jementah Motor Works
Blk 14 Defu Lane 10
#01-406 Singapore 539195

Date : 18 November 2020
Our ref : JMW/11/2002/TP

Accident Date : 07 November 2020
Inspection Date : 09 November 2020
Repairer Name : Jementah Motor Works
Blk 14 Defu Lane 10
#01-406 Singapore 539195

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No	: SKB 8079 E	Year / Capacity	: 2011 / 1997 cc
Make / Model	: Nissan qashqai	Colour	: Black
Chassis No	: SJNFBAJ10U2109539	Mileage	: 148204
Engine No	: MR20015233B		

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front Nearside	: Yokohama	225/50 R18	5 mm	Sport
Front Offside	: Yokohama	225/50 R18	5 mm	Sport
Rear Nearside	: Yokohama	225/50 R18	5 mm	Sport
Rear Offside	: Yokohama	225/50 R18	5 mm	Sport

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the rear portion.
(Details refer to the photographs attached)

Enclosed number of photographs: 94 copies

REMARKS

This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis
and we have not given authorization and instruction to the repairer to proceed with the repair

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle
and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$ 12,200.00** on a contractual basis.

Under normal circumstances, the repair period would be about 9 (Nine) working days.

Vehicle Registration No: SKB 8079 E

Our Ref No: JMW/11/2002/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Rear tailgate	Damage	\$ 3,542.60	\$ 3,542.60 2936 ✓
2	Rear tailgate dampers	Intact	\$ 368.00	
1	Rear tailgate inner trim	Damage	\$ 331.10	\$ 331.10 ✓
2	Rear tailgate lamps	Damage	\$ 390.00	\$ 390.00 X SVC
1	Rear tailgate lock	Damage	\$ 165.00	\$ 165.00 ✓
1	Rear tailgate logo	Necessary	\$ 55.60	\$ 55.60 ✓
1	Rear tailgate rubber	Necessary	\$ 300.80	\$ 300.80 135 ✓
1	Rear tailgate "QASHQAI" emblem	Necessary	\$ 120.20	\$ 120.20 60 ✓
1	Rear tailgate "XTRONIC" emblem	Necessary	\$ 85.00	\$ 85.00 60 ✓
1	Rear tailgate number plate garnish	Damage	\$ 272.20	\$ 272.20 ✓
2	Rear taillamps	Damage	\$ 971.20	\$ 971.20 ✓
1	Rear end panel	Damage	\$ 740.90	\$ 740.90 540 ✓
1	Rear end panel inner garnish	Damage	\$ 260.80	\$ 260.80 ✓
1	Rear bumper	Damage	\$ 900.80	\$ 900.80 796 ✓
2	Rear bumper brackets	Damage	\$ 183.40	\$ 183.40 144 ✓
2	Rear bumper lower brackets	Damage	\$ 80.00	\$ 80.00 ✓
1	Rear bumper inner sponge	Damage	\$ 200.80	\$ 200.80 ✓
2	Rear bumper reflectors	Intact	\$ 260.40	
1	Rear bumper reinforcement	Damage	\$ 450.30	\$ 450.30 X SVC
2	Rear bumper side retainers	Necessary	\$ 140.40	\$ 140.40 ✓
1	Rear bumper tow hook cover	Damage	\$ 90.30	\$ 90.30 35 ✓
1	Rear n/s fender	Repair	\$ 1,547.90	
1	Rear floor panel	Damage	\$ 1,883.20	\$ 1,883.20 ✓
1/2	Rear spare tyre side boards	Damage	\$ 570.00	\$ 570.00 285 ✓
			\$ 13,910.90	\$ 11,734.60
Less 10%			\$ 1,391.09	\$ 1,173.46
Total Cost - List Items			\$ 12,519.81	\$ 10,561.14

Vehicle Registration No: SKB 8079 E

Our Ref No: JMW/11/2002/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
List Items Total c/f			\$ 12,519.81	\$ 10,561.14

SPECIAL NETT ITEMS

1	Rear windscreen inner seal	Necessary	\$ 85.00	\$ 85.00 ✓
1	Rear windscreen sealant	Necessary	\$ 80.00	\$ 50.00 40✓
1	Rear bumper clip (1 set)	Necessary	\$ 60.00	\$ 60.00 30✓
1	Rear number plate with holder	Damage	\$ 50.00	\$ 50.00 45✓
1	Rear reverse sensor (1 set)	Damage	\$ 350.00	\$ 350.00 200✓
1	Rear reverse camera	Damage	\$ 480.00	\$ 480.00 X SUC
1	Rear spare tyre panel insulator	Necessary	\$ 180.00	\$ 180.00 60✓
Total Cost - Special Nett items			\$ 1,285.00	\$ 1,255.00

Total cost of parts

\$ 13,804.81 \$ 11,816.14

Vehicle Registration No: SKB 8079 E

Our Ref No: JMW/11/2002/TP

S/No	Description	Repairer's Estimate	Revised Amount
Total cost of parts c/f		\$ 13,804.81	\$ 11,816.14

LABOUR

1	To remove, refit, replaced damaged lamps and check up rear electrical wiring	\$ 80.00	\$ 50.00 30/
2	To remove and refit inner garnishes, inner trim to assist repair.	\$ 150.00	\$ 120.00 50/
3	To remove and refit rear reverse sensor and camera.	\$ 150.00	\$ 120.00 30/
4	To transfer rear tailgate mechanism and wiring assembly to assist repair.	\$ 80.00	\$ 80.00 50/
5	To remove and refit rear windscreen glass.	\$ 180.00	\$ 120.00 /
6	To apply undercoating on repaired and replaced panel.	\$ 200.00	\$ 150.00 30/
7	To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident.	\$ 1,800.00	\$ 1,500.00 1400/
8	To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident.	\$ 1,600.00	\$ 1,320.00 1000/

GRAND TOTAL

\$ 18,044.81 \$ 15,276.14

8 repair days

Vehicle Registration No: SKB 8079 E

Our Ref No: JMW/11/2002/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 12,200.00**

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

C L APPRAISER PTE LTD



Cheong K. H.
Automotive Appraiser

24















































