

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG21001081/EQD3E2
Date: 23/02/2021

REFERENCE

Insured/Claimant: AMRISH NAIR Policy No: 1900104570
Date of Loss: 21/01/2021 Nature of Claim: OD Claim No: 8827694408SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SGC7167H**
Make & Model: KIA CERATO, 1.6 (A) Engine No: G4FGKH728116
Reg. Date: 11/06/2019 (Man. Year: 2018) Chassis No: KNAF1416MK5041505
Colour: Blue Odometer: 26955 km
Engine Capacity: 1591 cc
Market Value/New Car Price: S\$72,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
Front Left Side: Yokohama 4 mm Rear Left Side: Yokohama 4 mm
Front Right Side: Yokohama 4 mm Rear Right Side: Yokohama 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	636.40	495.60	140.80	22.12
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,040.00	1,250.00	790.00	38.73
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,676.40	1,745.60	930.80	34.78
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	2,076.40	1,145.60	930.80	44.83
+ GST 7.00/7.00% (S\$)	145.35	80.19	65.16	44.83
Nett Amount (S\$)	2,221.75	1,225.79	995.96	44.83

INSPECTION

Date of Assignment: 22/01/2021
Date Inspected: 22/01/2021 Inspected At: Cycle & Carriage KIA Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339
Estimated Period of Repair: 3.0 days

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	50.00 FS	*10.00 FS
2	1		*MIRROR ASSY-OUTSIDE RR VIEW, LH	Broken	400.00 FL	*400.00 FL
3	1		*GLASS ASSY-FRONT DOOR, LH	Cut	207.00 FL	*207.00 FL
4	1		*RUN ASSY-FR DR WDO GLASS LH	Not Necessary	126.00 FL	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

	Sub Total (\$)	783.00	617.00
	- List Item Discount on L Items 20.00/20.00% (\$)	146.60	121.40
	Total Parts (\$)	636.40	495.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REPLACE LH WING MIRROR ASSEMBLY, FRT LH DOOR GLASS & AFFECTED AREA. REPAIR ON FRT LH DOOR	New	800.00	400.00
2	PAINT WORK ON FRT LH DOOR & LH WING MIRROR COVER	New	700.00	430.00
3	PERFORM RUST PREVENTION	New	40.00	0.00
4	CHECK WIRING & CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
5	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
6	TO SUPPLY FRT LH DOOR GLASS	New	80.00	0.00
7	REPLACE LH FRONT DOOR GLASS (Supplementary)	New	120.00	120.00
8	SUPPLY & REPLACE LH FRONT DOOR GLASS SOLAR FILM - RIKECOOL (Supplementary)	New	150.00	150.00
			Gross Labour Cost (S\$)	2,040.00
				1,250.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >