



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2102900
INV Date 27/04/2021
Reference CC4/LPC21001201/Uba3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMC 2308E
Insured Veh. GBG 8458A
Claim No. 20/21/21/VC05/024167
Policy No. Z20VC05006453
Accident Date 22/01/2021
Inspection Date 29/01/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555		Ref: CC4/LPC21001201/Uba3q2 Date: 27/04/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBG 8458A	Veh. Inspected	SMC 2308E
Policy No.	Z20VC05006453	Coverage (\$)	0.00
Claim No.	20/21/21/VC05/024167	Excess (\$)	0.00
Assign From	GERALD POH	Assign Date	26/01/2021
2. Vehicle Particulars & Condition			
Make & Model	HONDA HRV (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JHMRU1830GX204006	Colour	BLACK
Odometer	34936 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	GOODYEAR	6 mm
L/H Front Tyre	215/60 R16	GOODYEAR	6 mm
R/H Rear Tyre	215/60 R16	GOODYEAR	6 mm
L/H Rear Tyre	215/60 R16	GOODYEAR	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	22/01/2021	Inspection Date	29/01/2021
Survey held at	KAH MOTOR CO SDN BERHAD 15 UBI ROAD 4 SINGAPORE 408610		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMC 2308E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	HEAD LIGHT ASSY ,L (SN)	CRACKED	1,401.75	1,401.75
1	LIGHT ASSYL.FR.FOGLIGHT (SN)	CRACKED	184.42	184.42
1	GARNISHL.FR.FOG LIGHT (SN)	NOT NECESSARY	16.57	-
14	CLIP,BUMPER (SN)	NECESSARY	24.15	24.15
1	LABELCOOLANT INFORMATION (SN)	NECESSARY	3.90	3.90
1	FACE ,FR.BUMPER (SN)	DISTORTED	365.92	365.92
1	BEAM COMP ,FR BUMPER (SN)	DENTED	171.60	171.60
1	SPOILERFR.BUMPER AIR (SN)	NOT NECESSARY	42.22	-
1	FACEFR.BUMPER LOWER (SN)	TO REPAIR SEE LABOUR	178.20	-
1	BEAML.FR.BUMPER UPPER (SN)	CRACKED	20.17	20.17
1	SPACER,L.FR.BUMPER SIDE (SN)	BENT	8.47	8.47
1	GUARD SETL.FR.SPLASH (SN)	DISTORTED	33.75	33.75
1	FENDER ASSYL.FR.INNER (SN)	TORN	69.22	69.22
1	PROTECTOR ,L.FR. WHEEL ARCH (SN)	DISTORTED / MISSING	118.20	118.20
1	PANEL COMPL.FR.FENDER (SN)	BUCKLED	303.90	268.72
1	ENCLOSUREL.FR.FENDER (SN)	NOT NECESSARY	8.17	-
1	INSULATORHOOD (SN)	TORN	84.45	84.45
1	HINGE COMPR.HOOD (SN)	BENT	30.67	30.67
1	HINGE COMPL.HOOD (SN)	BENT	30.67	30.67
1	BULKHEAD COMP,FR (SN)	TO REPAIR SEE LABOUR	334.27	-
1	MEMBER COMPL.FR.WHEELHOUSE UP (SN)	NOT NECESSARY	72.07	-
1	EXTENSION SETL.FR.SHOCK ABS (SN)	BADLY DENTED	72.60	72.60
1	BASE COMPBATTERY SETTING (SN)	NOT NECESSARY	52.87	-
1	HOOD COMP ENGINE (SN)	BUCKLED	616.27	616.27
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
1	BODY UNDERSIDE COATING (SN)	NOT NECESSARY	100.00	-
1	BODY JOINT SEALANT (SN)	NECESSARY	100.00	100.00
1	BRACKETL.FOG LIGHT (SN) (ADDITIONAL)	CRACKED	38.47	38.47
1	MOLDINGFR,GRILLE UPPER (SN) (ADDITIONAL)	CRACKED	146.02	146.02

Report Ref No. CC4/LPC21001201/Uba3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BRACKETL.FR.FENDER (SN) (ADDITIONAL)	BENT	10.12	10.12
1	LIGHT ASSYL.FR.FOGLIGHT (SN) (ADDITIONAL)	REPEATED	184.42	-
			4,873.51	3,819.54
	LABOUR			
	INSPECT FR LIGHTING MECHANISMS & FOCUS.		180.00	120.00
	APPLY BODY UNDERSIDE COATING.	NOT NECESSARY	250.00	-
	REMOVE & INSTALL RADIATOR WITH FITTINGS .	NOT NECESSARY	350.00	-
	REMOVE & INSTALL A/C CONDENSER WITH FITTINGS.	NOT NECESSARY	450.00	-
	RENEW BULKHEAD WHEELHOUSE EXTENSION & ALIGN CHASS.INCLUSIVE OF THE REPAIR OF FACEFR.BUMPER LOWER AND BULKHEAD COMP,FR .		2,800.00	1,950.00
	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS.		3,200.00	2,600.00
			7,230.00	4,670.00
	GRAND TOTAL		12,103.51	8,489.54
	RECOMMENDED COST OF REPAIRS			8,489.54

Report Ref No. CC4/LPC21001201/Uba3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 2308E

INSPECTION

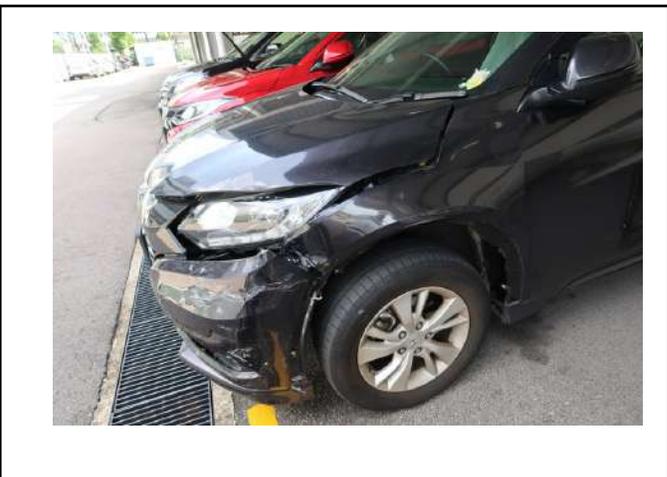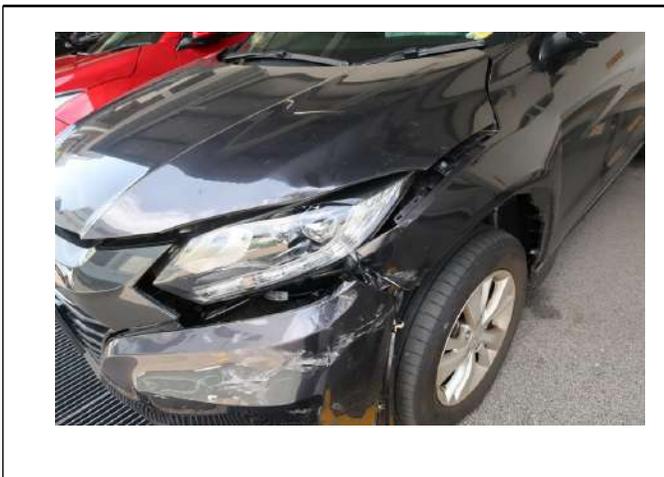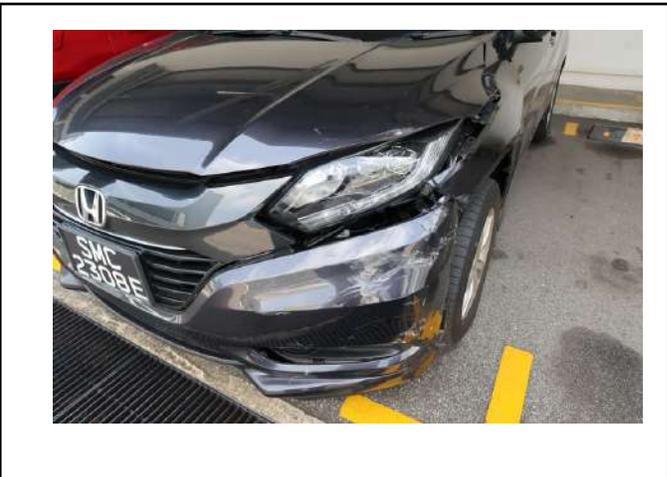





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

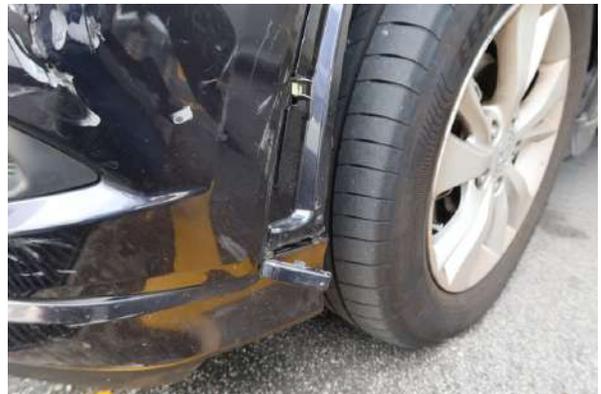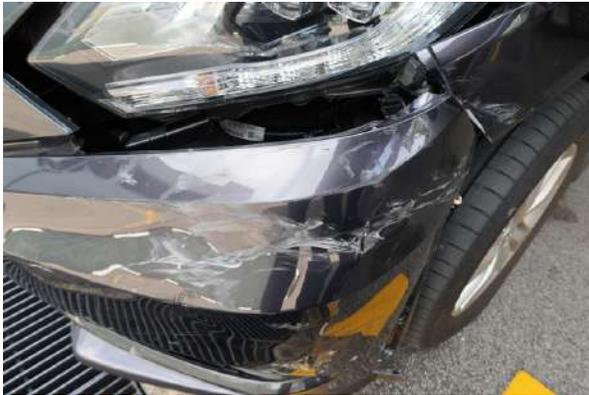



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

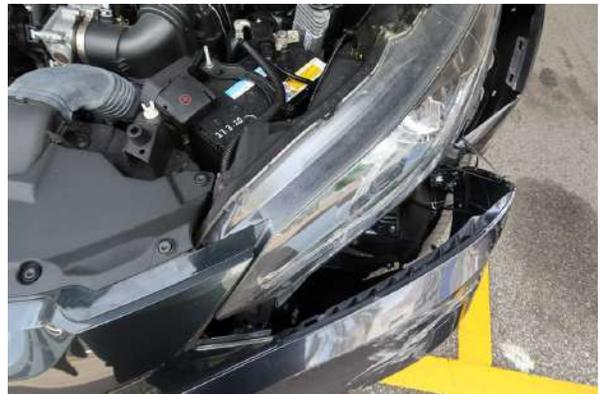








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

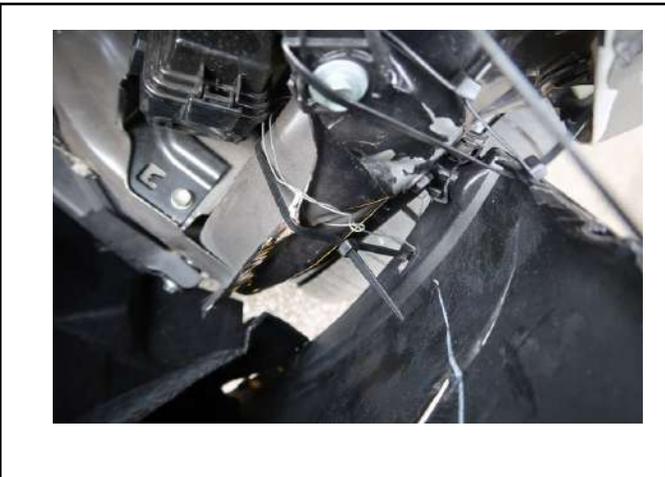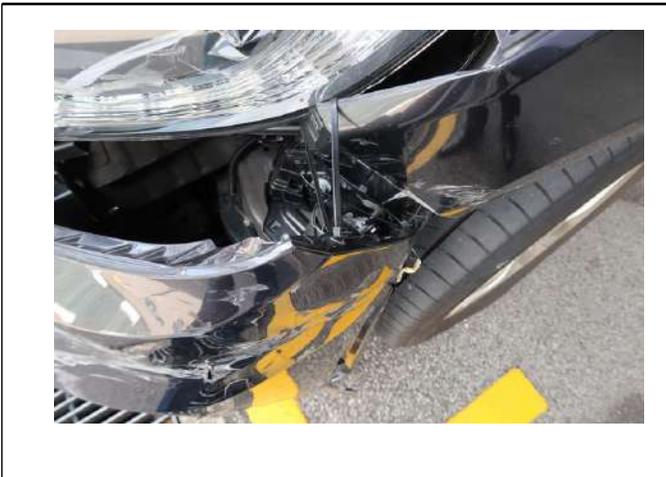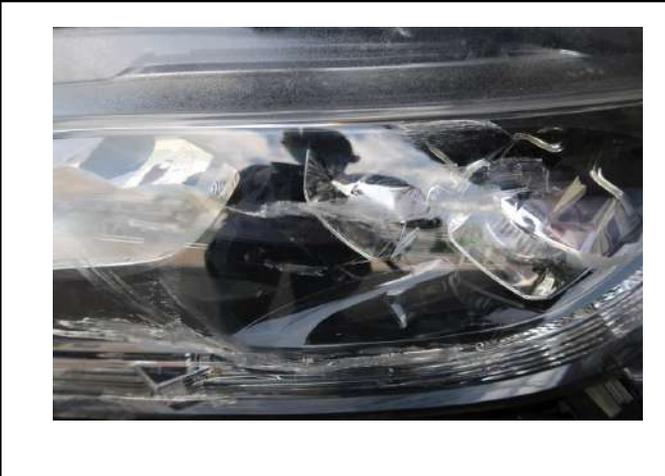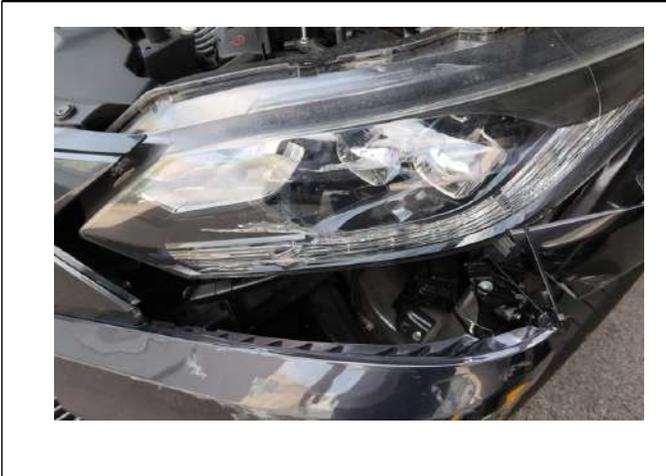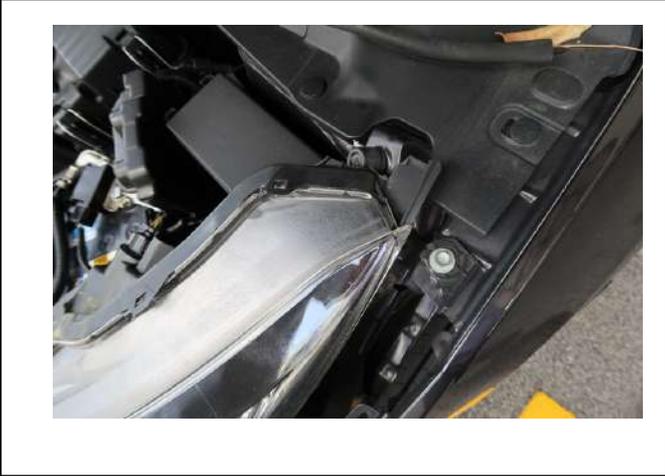



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R











LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

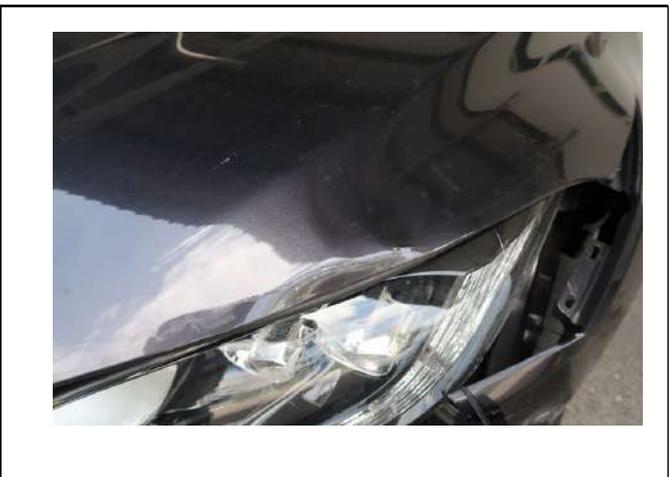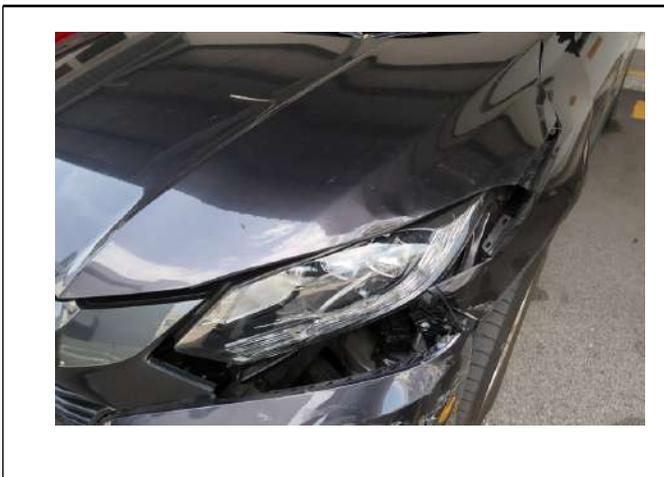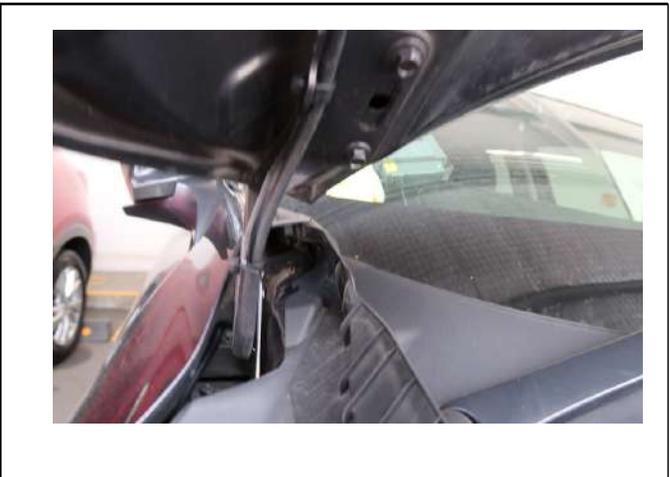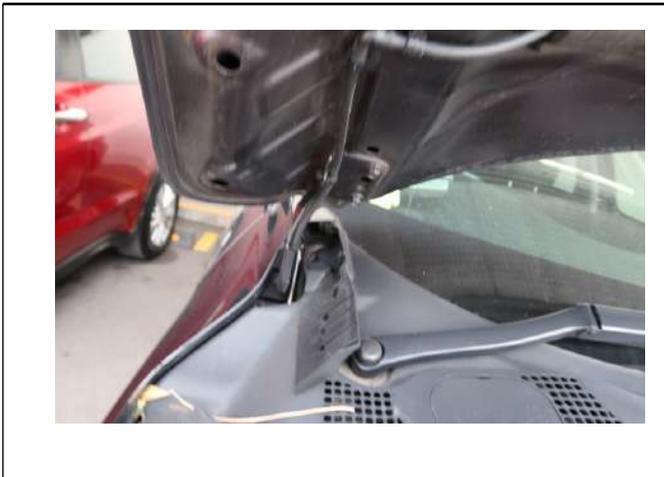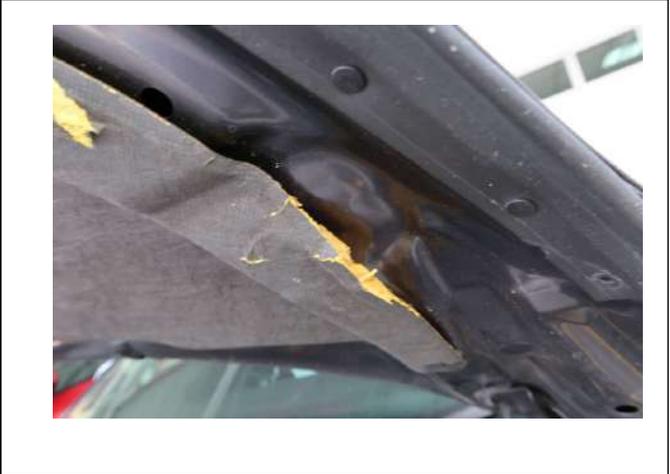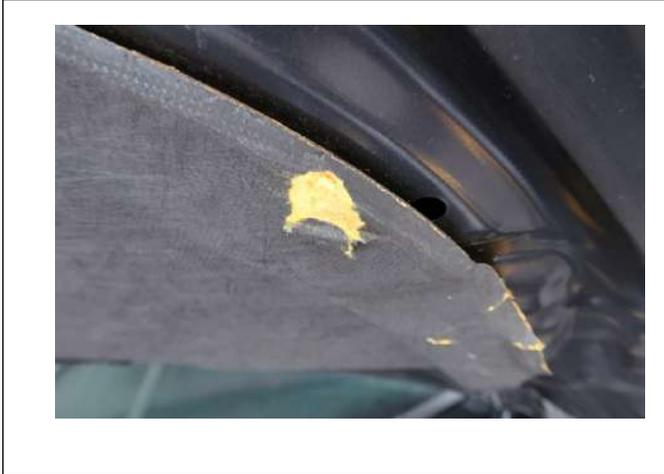



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 2308E

RE-INSPECTION

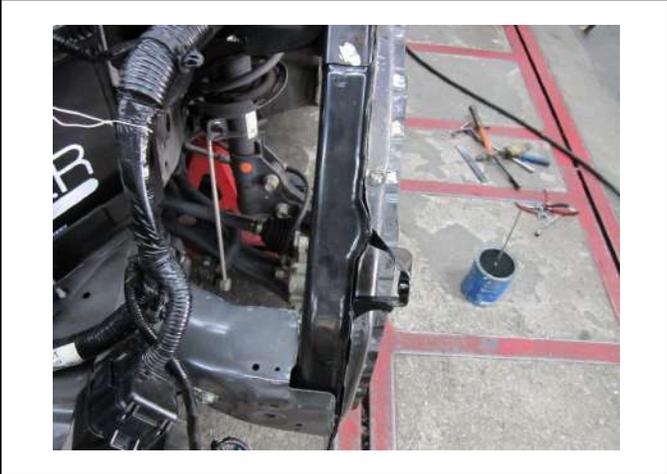



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

