

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/MSG21001472/UTF3Q2
Date: 19/03/2021

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	1001615228
Claimant Vehicle No :	SKX5924U	Insured Vehicle No :	SMX6366A
Date of Loss:	01/02/2021	Nature of Claim:	TP
		Claim No:	252946

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKX5924U	Engine No:	HRA2211188A
Make & Model:	NISSAN QASHQAI, 1.2 DIG-T CVT ABS 2WD 5DR (A)	Chassis No:	SJNFEAJ11U1533400
Reg. Date:	21/12/2015 (Man. Year: 2015)	Odometer:	82387 km
Colour:	Blue		
Engine Capacity:	1197 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55R17	Rear Tyre Size:	225/55R17
Front Left Side:	RADAR 6 mm	Rear Left Side:	Dayton 6 mm
Front Right Side:	RADAR 6 mm	Rear Right Side:	Dayton 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	62,773.90	23,163.85	39,610.05	63.10
Miscellaneous Items	0.00	0.00	0.00	
Labour	9,940.00	5,370.00	4,570.00	45.98
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	72,713.90	28,533.85	44,180.05	60.76
Approved Total (Overridden) (\$\$)		18,700.00		
	(\$\$)	72,713.90	18,700.00	54,013.90
+ GST 7.00/7.00% (\$\$)	5,089.97	1,309.00	3,780.97	74.28
Nett Amount (\$\$)	77,803.87	20,009.00	57,794.87	74.28

INSPECTION

Date of Assignment:	10/03/2021		
Date Inspected:	01/02/2021	Inspected At:	Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	20.0 days		

Adjuster: MARCUS CHUA

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but

3/19/2021

Adjuster Report

any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 18 Mar 2021)

Parts: M1-SUV NISSAN QASHQAI 1.2 DIG-T CVT ABS 2WD 5DR (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SKX5924U)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR WINDSCREEN }	Shattered	1,855.20 F	*930.00 FL
2	1		*REAR WINDSCREEN MOULDING }		195.30 F	*- FL
3	2		*REAR WINDSCREEN INNER SIDE GARNISHS	Not Necessary	170.00 F	*- FL
4	1		*TAILGATE	Badly Dented	3,066.20 F	*2,936.80 FL
5	1		*TAILGATE OUTER GARNISH	Cracked	450.00 F	*286.20 FL
6	1		*TAILGATE REAR LOGO	Necessary	38.50 F	*38.50 FL
7	1		*TAILGATE QASHQAI EMBLEM	Necessary	78.00 F	*78.00 FL
8	2		*TAILGATE REFLECTORS	Cracked	1,300.00 F	*431.80 FL
9	1		*TAILGATE REAR WIPER ARM	Serviceable	315.00 F	*- FL
10	1		*TAILGATE REAR WIPER BLADE	Not Necessary	105.20 F	*- FL
11	1		*TAILGATE REAR WIPER MOTOR	Jammed	966.00 F	*455.20 FL
12	1		*TAILGATE INNER LOCK	Dented/Jammed	355.90 F	*116.70 FL
13	1		*TAILGATE INNER TRIM BOARD	Deformed/Cracked	595.20 F	*365.20 FL
14	1		*SET TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 F	*30.00 FL
15	1		*TAILGATE WEATHERSTRIP	Twisted	188.20 F	*166.20 FL
16	2		*TAILGATE DAMPERS	Not Necessary	500.00 F	*- FL
17	1		*TAILGATE INNER TOP BOARD	Serviceable	492.90 F	*- FL
18	1		*TAILGATE LICENCE PLATE LAMP	Cracked	65.00 F	*62.00 FL
19	1		*REAR BUMPER	Distorted	891.00 F	*717.00 FL
20	1		*REAR BUMPER TOW COVER	Deformed	45.00 F	*22.00 FL
21	2		*REAR BUMPER REFLECTORS	Not Necessary	136.00 F	*- FL
22	2		*REAR BUMPER SIDE RETAINERS	Bent	90.00 F	*70.00 FL
23	1		*REAR BUMPER REINFORCEMENT	Distorted	721.00 F	*619.20 FL
24	1		*REAR END PANEL	Badly Dented	755.20 F	*482.60 FL
25	1		*REAR END PANEL TOP GARNISH	Distorted	211.90 F	*166.20 FL
26	2		*REAR FENDERS	Badly Dented/Buckled	2,760.00 F	*1,798.40 FL
27	2		*REAR FENDER INNER TRIM BOARDS	Distorted	1,300.00 F	*676.40 FL
28	2		*REAR FENDER OUTER PROTECTORS	Distorted	1,282.00 F	*1,081.00 FL
29	2		*REAR FENDER GLASS	Not Necessary	1,640.00 F	*- FL
30	2		*REAR FENDER UNDER SHIELDS	Distorted/Torn	530.40 F	*330.00 FL
31	1		*REAR FENDER AIR VENTS	N/s Distorted	196.00 F	*65.00 FL
32	2		*TAILLAMPS	Cracked	1,176.60 F	*647.40 FL
33	2		*TAILLAMP HOUSING PANELS	Badly Dented	576.20 F	*410.00 FL
34	1		*REAR FLOOR PANEL	Crumpled/Buckled	1,288.20 F	*945.11 FL
35	1		*REAR FLOOR PANEL TOP BOARD	Distorted	622.00 F	*485.00 FL
36	1		*REAR FLOOR PANEL TOOLS SPONGE CENTRE	Distorted	650.20 F	*383.20 FL
37	2		*REAR FLOOR PANEL TOOLS SIDE SPONGES	Not Necessary	610.00 F	*- FL
38	1		*REAR FLOOR PANEL SPARE TYRE NUT	Not Necessary	50.00 F	*- FL
39	1		*REAR EXHAUST	Repair	1,122.20 F	*- FL
40	1		*REAR EXHAUST MOUNTING	Not Necessary	60.00 F	*- FL
41	1		*REAR EXHAUST HEATSHIELD	Repair	211.20 F	*- FL
42	1		*REAR CHASSIS MEMBER	Not Necessary	850.50 F	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
43	2		*REAR DOORS	Repair	2,910.40 F	*- FL
44	1		*REAR DOOR GLASS OUTER MOULDINGS	N/s Twisted	244.40 F	*102.30 FL
45	2		*REAR DOOR INNER LOCKS	Serviceable	596.60 F	*- FL
46	1		*ROOF LINING	Serviceable	1,482.60 F	*- FL
47	1		*ROOF PANEL	Repair	2,211.20 F	*- FL
48	2		*ROOF PANEL OUTER MOULDINGS	Serviceable	663.00 F	*- FL
49	1		*REAR TAILGATE TOP SPOILER	Not Necessary	850.50 F	*- FL
50	1		*FRONT BUMPER	Distorted	801.00 F	*614.60 FL
51	1		*FRONT BUMPER REINFORCEMENT	Bent	781.10 F	*588.20 FL
52	2		*FRONT BUMPER BRACKETS	Bent	430.00 F	*370.00 FL
53	2		*FRONT BUMPER SIDE RETAINERS	Bent	130.00 F	*70.00 FL
54	1		*FRONT BUMPER SPONGE	Torn	288.20 F	*195.20 FL
55	1		*FRONT BUMPER TOW COVER	Torn	45.00 F	*35.00 FL
56	1		*FRONT GRILLE	Cracked	803.00 F	*461.20 FL
57	1		*FRONT GRILLE LOGO	Cracked	65.00 F	*65.00 FL
58	2		*HEADLAMPS	Cracked	5,700.00 F	*1,224.40 FL
59	1		*BONNET	Buckled	923.20 F	*685.20 FL
60	2		*BONNET HINGES	Bent	210.00 F	*170.00 FL
61	1		*BONNET INSULATOR	Not Necessary	285.60 F	*- FL
62	1		*BONNET INNER RUBBER	Not Necessary	45.00 F	*- FL
63	1		*BONNET LOCK	Bent	145.00 F	*102.30 FL
64	1		*BONNET LOCK CABLE	Not Necessary	110.00 F	*- FL
65	1		*FRONT SUPPORT PANEL	Bent	792.90 F	*617.50 FL
66	1		*FRONT SUPPORT PANEL TOP GARNISH	Deformed/Torn	311.80 F	*188.20 FL
67	1		*AIR CON CONDENSER	Bent/Punctured	1,020.00 F	*825.90 FL
68	1		*AIR CON CONDENSER SIDE GARNISHS	N/s Torn	296.60 F	*105.30 FL
69	1		*AIR CON LIQUID PIPE	Not Necessary	288.90 F	*- FL
70	1		*AIR CON SUCTION HOSE	Not Necessary	292.10 F	*- FL
71	1		*AIR CON DISCHARGE HOSE	Not Necessary	298.60 F	*- FL
72	1		*OIL COOLER	Punctured	882.20 F	*545.20 FL
73	1		*OIL COOLER HOSE	Not Necessary	60.00 F	*- FL
74	1		*RADIATOR	Bent/Punctured	1,200.90 F	*885.00 FL
75	1		*RADIATOR FAN ASSY	Serviceable	1,080.50 F	*- FL
76	1		*RADIATOR TOP HOSE	Not Necessary	68.00 F	*- FL
77	2		*FRONT FENDERS	Dented/Cracked	1,770.00 F	*1,230.00 FL
78	2		*FRONT FENDER INNER SHIELDS	Not Necessary	376.40 F	*- FL
79	2		*FRONT FENDER OUTER PROTECTORS	Deformed/Torn	1,082.00 F	*962.00 FL
80	2		*FRONT FOG LAMPS	Not Necessary	900.00 F	*- FL
81	1		*AIR CLEANER BOX ASSY	Not Necessary	650.00 F	*- FL
82	1		*INLET MANIFOLD	Not Necessary	1,800.00 F	*- FL
83	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
84	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*30.00 FS
85	1		*REAR WINDSCREEN SOLAR FILM	Necessary	280.00 FS	*150.00 FS
86	1		*REAR LICENCE PLATE	Bent	50.00 FS	*40.00 FS
87	1		*SET REAR TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 FS	*40.00 FS
88	1		*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
89	1		*SET REAR BUMPER REVERSE SENSOR	Shorted	280.00 FS	*200.00 FS
90	2		*REAR FENDER GLASS SEALANTS	Necessary	80.00 FS	*60.00 FS
91	1		*REAR END PANEL SEALANT	Necessary	50.00 FS	*50.00 FS
92	1		*SET REAR FLOOR PANEL INSULATOR	Necessary	280.00 FS	*100.00 FS
93	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
94	1		*FRONT BUMPER LICENCE PLATE	Bent	50.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	62,773.90	25,647.61
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	2,483.76

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
					Total Parts (S\$)	62,773.90
						23,163.85

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	80.00	30.00
2	TO DISMANTLE & REPLACED REVERSE SENSOR	New	80.00	50.00
3	TO DISMANTLE & REPLACED REAR WINDSCREEN	New	150.00	120.00
4	TO DISMANTLE & REFIX CUSHION UPHOLSTERY	New	150.00	80.00
5	TO DISMANTLE & REPLACED REAR BOTH FENDER GLASS	New	220.00	120.00
6	TO DISMANTLE & REPLACED ROOF LINING	New	250.00	0.00
7	TO DISMANTLE & REFIX FUEL TANK	New	100.00	60.00
8	TO DISMANTLE & REPLACED REAR EXHAUST	New	100.00	60.00
9	TO MOUNT VEHICLE ON CAR O-LINER	New	380.00	0.00
10	TO CONDUCT WHEEL ALIGNMENT	New	150.00	0.00
11	TO DISMANTLE & REFIX REAR UNDER CARRIAGE	New	280.00	0.00
12	TO DISMANTLE & REFIX REAR DOOR MECHANISM	New	180.00	0.00
13	TO REFILL AIR CON GAS	New	120.00	100.00
14	TO SPRAY RUST PROOFING	New	200.00	150.00
15	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	4,500.00	2,600.00
16	TO PUTTY & SPRAY PAINTING	New	3,000.00	2,000.00
Gross Labour Cost (\$\$)			9,940.00	5,370.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >