


PHOTOCOPY

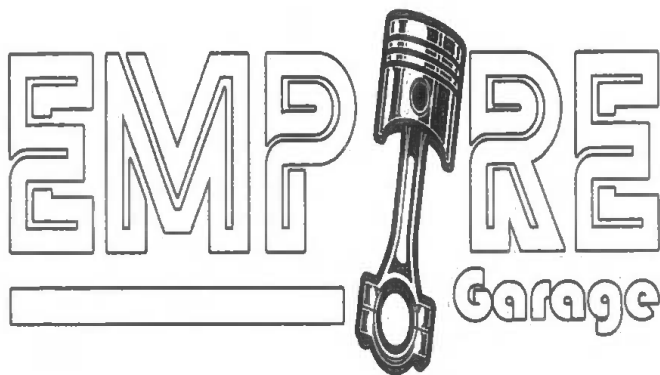

Empire Garage Pte Ltd

10 Kaki Bukit Road 2

#01-35 Singapore 417868

Email : empire.garage@outlook.sg

Tel : 9788 0123

Invoice Date : 18 Nov 2020

Owner : Lee Jian Xing

Accident Date : 31 October 2020

Address : C/o: Empire Garage Pte Ltd
10 Kaki Bukit Road 2
#01-35 Singapore 417868

Veh Reg No. : SKV 6436 R
Make / Model : Honda Vezel

<u>ITEM NO.</u>	<u>DESCRIPTION</u>	<u>AMT (SGD)</u>
1	LUMP SUM REPAIR COST AS PER SURVEYOR REPORT RECOMMENDATION	SGD 9,200.00

Grand Total : SGD 9,200.00

CL APPRAISER PTE LTD

24 Peshurst Place, Singapore 556440
 Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
 Reg No: 201000228E

INVOICE

Lee Jian Xing
 C/o: Empire Garage Pte Ltd
 10 Kaki Bukit Road 2
 #01-35 Singapore 417868

Invoice No: CL/200553

Ref No: EG/11/2001/TP

Date: 18 November 2020

DESCRIPTION	AMOUNT
OUR SERVICE FEE CHARGES:	
• SURVEY INSPECTION FOR VEHICLE NO. <u>SKV 6436 R</u>	
• RESURVEY INSPECTION	
• DIGITAL PHOTOGRAPHS SERVICES (INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS)	
• TRANSPORTATION	
GRAND TOTAL	S\$ 739.00

E & O. E

All cheque payment should be "Crossed" and made payable to "CL APPRAISER PTE LTD"

We shall be grateful if you could forward our payment at your early convenience.



CL Appraiser Pte Ltd

CL APPRAISER PTE LTD

24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Lee Jian Xing
C/o: Empire Garage Pte Ltd
10 Kaki Bukit Road 2
#01-35 Singapore 417868

Date : 18 November 2020
Our ref : EG/11/2001/TP

Accident Date : 31 October 2020
Inspection Date : 03 November 2020
Repairer Name : Empire Garage Pte Ltd
10 Kaki Bukit Road 2
#01-35 Singapore 417868

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No : SKV 6436 R
Make / Model : Honda Vezel
Chassis No : RU11101185
Engine No : L15B4021186

Year / Capacity : 2015 / 1496 cc
Colour : Blue
Mileage : 31954

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front Nearside	: Yokohama	215/60 R16	5 mm	Sport
Front Offside	: Yokohama	215/60 R16	5 mm	Sport
Rear Nearside	: Yokohama	215/60 R16	5 mm	Sport
Rear Offside	: Yokohama	215/60 R16	5 mm	Sport

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the rear portion.
(Details refer to the photographs attached)

Enclosed number of photographs: 119 copies

REMARKS

This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis
and we have not given authorization and instruction to the repairer to proceed with the repair

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$ 9,200.00** on a contractual basis.

Under normal circumstances, the repair period would be about 7 (Seven) working days.

Vehicle Registration No: SKV 6436 R

Our Ref No: EG/11/2001/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Rear windscreen moulding	Necessary	\$ 121.80	\$ 121.80
1	Rear tailgate	Damage	\$ 1,287.60	\$ 1,287.60
2	Rear tailgate dampers	Intact	\$ 331.60	
2	Rear tailgate hinges	Necessary	\$ 130.00	\$ 130.00
1	Rear tailgate inner trim board	Damage	\$ 225.00	\$ 225.00
1	Rear tailgate inner pull pocket	Damage	\$ 32.00	\$ 32.00
2	Rear tailgate lamps	Damage	\$ 570.00	\$ 570.00
1	Rear tailgate lock	Damage	\$ 269.50	\$ 269.50
1	Rear tailgate logo	Necessary	\$ 40.30	\$ 40.30
1	Rear tailgate "VEZEL" emblem	Necessary	\$ 56.20	\$ 56.20
1	Rear tailgate outer garnish	Damage	\$ 185.50	\$ 185.50
1	Rear wiper arm	Damage	\$ 145.80	\$ 145.80
1	Rear wiper arm cover	Damage	\$ 52.00	\$ 52.00
1	Rear wiper motor	Damage	\$ 300.70	\$ 300.70
2	Rear taillamps	Damage	\$ 1,390.00	\$ 1,390.00
1	Rear end panel	Damage	\$ 585.80	\$ 585.80
1	Rear end panel inner garnish	Damage	\$ 160.50	\$ 160.50
1	Rear keyless sensor (1 set)	Damage	\$ 189.50	\$ 189.50
1	Rear bumper	Damage	\$ 950.60	\$ 950.60
2	Rear bumpers - side	Damage	\$ 450.60	\$ 450.60
2	Rear bumper brackets	Damage	\$ 97.00	\$ 97.00
1	Rear bumper lower garnish	Damage	\$ 325.00	\$ 325.00
2	Rear bumper reflectors	Damage	\$ 303.80	\$ 303.80
2	Rear bumper side retainers	Necessary	\$ 101.80	\$ 101.80
1	Rear floor board	Damage	\$ 187.60	\$ 187.60
1	Rear floor panel	Repair	\$ 1,145.70	
1	Rear floor sponge tray board	Damage	\$ 197.80	\$ 197.80
1	Rear exhaust silencer	Damage	\$ 840.30	\$ 840.30
2	Rear exhaust mountings	Necessary	\$ 49.00	\$ 49.00
			\$ 10,723.00	\$ 9,245.70
			<i>Less 20%</i>	<i>\$ 2,144.60</i>
Total Cost - List Items			\$ 8,578.40	\$ 7,396.56

Vehicle Registration No: SKV 6436 R

Our Ref No: EG/11/2001/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
List Items Total c/f			\$ 8,578.40	\$ 7,396.56

SPECIAL NETT ITEMS

1	Rear windscreen sealant	Necessary	\$ 80.00	\$ 50.00
1	Rear wiper blade	Necessary	\$ 45.00	\$ 45.00
1	Rear bumper clip (1 set)	Necessary	\$ 50.00	\$ 50.00
1	Rear reverse sensor (1 set)	Damage	\$ 350.00	\$ 350.00
1	Rear reverse sensor buzzer	Damage	\$ 150.00	\$ 150.00
1	Rear reverse camera	Damage	\$ 480.00	\$ 480.00
1	Rear exhaust chrome tail pipe	Damage	\$ 120.00	\$ 120.00
Total Cost - Special Nett items			\$ 1,275.00	\$ 1,245.00

Total cost of parts

\$ 9,853.40 \$ 8,641.56

Vehicle Registration No: SKV 6436 R

Our Ref No: EG/11/2001/TP

S/No	Description	Repairer's Estimate	Revised Amount
Total cost of parts c/f		\$ 9,853.40	\$ 8,641.56

LABOUR

1	To remove, refit, replaced damaged lamps and check up rear electrical wiring	\$ 80.00	\$ 50.00
2	To remove and refit inner garnishes, inner trim to assist repair.	\$ 150.00	\$ 120.00
3	To remove and refit rear reverse sensor and camera.	\$ 150.00	\$ 120.00
4	To transfer rear tailgate mechanism and wiring assembly to assist repair.	\$ 80.00	\$ 80.00
5	To remove and refit rear windscreen glass.	\$ 180.00	\$ 120.00
6	To remove, refit and replace exhaust silencer and mountings.	\$ 150.00	\$ 120.00
7	To apply undercoating on repaired and replaced panel.	\$ 180.00	\$ 120.00
8	To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident.	\$ 1,200.00	\$ 1,000.00
9	To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident.	\$ 1,400.00	\$ 1,100.00

GRAND TOTAL

\$ 13,423.40	\$ 11,471.56
---------------------	---------------------

C L APPRAISER PTE LTD

Vehicle Registration No: SKV 6436 R

Our Ref No: EG/11/2001/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 9,200.00**

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deem to be vaild.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

C L APPRAISER PTE LTD



Cheong K. H
Automotive Appraiser