

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

**Our File No:** CC4/AIG21001746/AGS3Q2  
**Date:** 03/06/2021

**REFERENCE**

|                              |                                      |                             |              |
|------------------------------|--------------------------------------|-----------------------------|--------------|
| Handling Insurer:            | AIG Asia Pacific Insurance Pte. Ltd. | Policy No:                  | 2070159008   |
| <b>Claimant Vehicle No :</b> | SBP1400P                             | <b>Insured Vehicle No :</b> | SMW2528G     |
| Date of Loss:                | 04/02/2021                           | Nature of Claim:            | TP           |
|                              |                                      | Claim No:                   | 4227761396SG |

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

|                             |                                   |             |              |
|-----------------------------|-----------------------------------|-------------|--------------|
| Reg No:                     | <b>SBP1400P</b>                   | Engine No:  | 1ZZ2704447   |
| Make & Model:               | TOYOTA WISH, 1.8 (A)              | Chassis No: | ZNE100327981 |
| Reg. Date:                  | 07/11/2006 (Man. Year: 2006)      | Odometer:   | 257942 km    |
| Colour:                     | Grey                              |             |              |
| Engine Capacity:            | 1794 cc                           |             |              |
| Market Value/New Car Price: | N/A                               |             |              |
| Sum Insured (S\$):          | <b>Market Value/New Car Price</b> |             |              |

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

|                          |     |                         |     |                          |     |
|--------------------------|-----|-------------------------|-----|--------------------------|-----|
| General Condition:       |     | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification:    | No  | Pre-accident Condition:  |     |

**CONDITION OF TYRES**

|                   |              |                  |              |
|-------------------|--------------|------------------|--------------|
| Front Tyre Size:  | 225/45 R17   | Rear Tyre Size:  | 225/45 R17   |
| Front Left Side:  | Firenza 6 mm | Rear Left Side:  | Firenza 6 mm |
| Front Right Side: | Firenza 6 mm | Rear Right Side: | Firenza 6 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                    | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                    | 12,768.90         | 6,385.40          | 6,383.50          | 49.99         |
| Miscellaneous Items                      | 0.00              | 0.00              | 0.00              |               |
| Labour                                   | 5,950.00          | 2,300.00          | 3,650.00          | 61.34         |
| Paintwork Labour                         | 0.00              | 0.00              | 0.00              |               |
| Towing                                   | 0.00              | 0.00              | 0.00              |               |
| <b>Calculated Gross Total (S\$)</b>      | <b>18,718.90</b>  | <b>8,685.40</b>   | <b>10,033.50</b>  | <b>53.60</b>  |
| <b>Approved Total (Overridden) (S\$)</b> |                   | <b>6,900.00</b>   |                   |               |

|                                                 |                  |                 |                  |              |
|-------------------------------------------------|------------------|-----------------|------------------|--------------|
| <b>Nett Amount (S\$)</b>                        | <b>18,718.90</b> | <b>6,900.00</b> | <b>11,818.90</b> | <b>63.14</b> |
| <b>+ Car Rental (4.0 x S\$120.00/day) (S\$)</b> |                  | 480.00          |                  |              |
| <b>+ Doc/Search Fee (S\$)</b>                   |                  | 7.45            |                  |              |
| <b>Nett Liability (S\$)</b>                     |                  | <b>7,387.45</b> |                  |              |
| <b>Global Sum Settlement (S\$)</b>              |                  | <b>7,290.00</b> |                  |              |

INSPECTION

Date of Assignment: 05/02/2021

Date Inspected: 05/02/2021

Inspected At:

Ishare Auto Pte. Ltd. (HQ)  
 8 KAKI BUKIT AVENUE 4 #08-09 PREMIER @ KAKI BUKIT  
 Singapore 415875

Estimated Period of Repair: 7.0 days

**Adjuster:** ADRIAN LING**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

| No. | Qty | Part No. | Particulars                                  | Condition     | Repairer's  | Amount       |
|-----|-----|----------|----------------------------------------------|---------------|-------------|--------------|
| 1   | 1   |          | *REAR BUMPER                                 | Deformed      | 1,042.40 FL | *565.00 FL   |
| 2   | 1   |          | *REAR BUMPER REFLECTOR                       | O/S Cracked   | 97.80 FL    | *48.90 FL    |
| 3   | 2   |          | *REAR BUMPER BRACKET                         | Dented        | 171.20 FL   | *171.20 FL   |
| 4   | 2   |          | *REAR BUMPER SIDE RETAINER                   | Necessary     | 144.20 FL   | *144.20 FL   |
| 5   | 2   |          | *TAILLAMP C/W BRACKET                        | Cracked       | 792.40 FL   | *792.40 FL   |
| 6   | 1   |          | *REAR FENDER INNER TRIM                      | O/S Cracked   | 1,151.20 FL | *575.60 FL   |
| 7   | 2   |          | *REAR FENDER INNER COWLING                   | Not Necessary | 566.20 FL   | *- FL        |
| 8   | 1   |          | *TAILGATE                                    | Distorted     | 1,272.40 FL | *1,272.40 FL |
| 9   | 1   |          | *TAILGATE OUTER MOULDING                     | Cracked       | 277.10 FL   | *277.10 FL   |
| 10  | 1   |          | *TAILGATE OUTER SWITCH BUTTOM                | Not Necessary | 460.00 FL   | *- FL        |
| 11  | 1   |          | *TAILGATE LOGO                               | Necessary     | 75.20 FL    | *75.20 FL    |
| 12  | 1   |          | *TAILGATE INNER LOCK                         | Damaged       | 539.80 FL   | *539.80 FL   |
| 13  | 1   |          | *TAILGATE LOWER LOCK                         | Not Necessary | 38.60 FL    | *- FL        |
| 14  | 2   |          | *TAILGATE DAMPER                             | Not Necessary | 556.20 FL   | *- FL        |
| 15  | 2   |          | *TAILGATE STOPPER                            | Not Necessary | 49.40 FL    | *- FL        |
| 16  | 1   |          | *TAILGATE INNER HOLDER                       | Deformed      | 39.60 FL    | *39.60 FL    |
| 17  | 1   |          | *TAILGATE WEATHERSTRIP                       | Cut           | 369.80 FL   | *369.80 FL   |
| 18  | 2   |          | *TAILGATE INNER TRIM (TOP SIDE)              | Not Necessary | 390.00 FL   | *- FL        |
| 19  | 1   |          | *TAILGATE INNER TRIM (LOWER)                 | Cracked       | 363.20 FL   | *363.20 FL   |
| 20  | 1   |          | *REAR NUMBER PLATE LAMP                      | Not Necessary | 52.00 FL    | *- FL        |
| 21  | 4   |          | *TAILGATE WINDSCREEN MOULDING                | Necessary     | 155.60 FL   | *155.60 FL   |
| 22  | 1   |          | *REAR END PANEL                              | Distorted     | 590.60 FL   | *590.60 FL   |
| 23  | 1   |          | *REAR END PANEL TOP GARNISH                  | Cracked       | 298.70 FL   | *298.70 FL   |
| 24  | 1   |          | *REAR END PANEL (EXTEND) RH                  | Repair        | 295.00 FL   | *- FL        |
| 25  | 1   |          | *REAR END PANEL BOTTOM (CENTRE)              | Damaged       | 145.60 FL   | *145.60 FL   |
| 26  | 1   |          | *REAR FLOOR PANEL                            | Repair        | 580.97 FL   | *- FL        |
| 27  | 1   |          | *REAR FLOOR PANEL TOP BOARD                  | Deformed      | 502.30 FL   | *502.30 FL   |
| 28  | 2   |          | *REAR FLOOR PANEL SIDE BOARD                 | Not Necessary | 251.86 FL   | *- FL        |
| 29  | 1   |          | *REAR FLOOR PANEL TOP BOARD (INNER SUPPORT ) | Not Necessary | 410.10 FL   | *- FL        |
| 30  | 1   |          | *SPARE TYRE CHAIN                            | Not Necessary | 328.50 FL   | *- FL        |
| 31  | 1   |          | *REAR CHASSIS MEMBER RH                      | Repair        | 389.60 FL   | *- FL        |
| 32  | 1   |          | *REAR EXHAUST PIPE                           | Not Necessary | 830.70 FL   | *- FL        |
| 33  | 5   |          | *REAR EXHAUST MOUNTING                       | Not Necessary | 194.50 FL   | *- FL        |
| 34  | 1   |          | *REAR EXHAUST INSULATOR                      | Not Necessary | 135.80 FL   | *- FL        |
| 35  | 1   |          | *REAR NUMBER PLATE                           | Dented        | 80.00 FS    | *50.00 FS    |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                             | Condition     | Repairer's | Amount     |
|-----|-----|----------|-----------------------------------------|---------------|------------|------------|
| 36  | 1   |          | *SET REAR BUMPER CLIPS                  | Necessary     | 80.00 FS   | *30.00 FS  |
| 37  | 1   |          | *SET TAILGATE OUTER MOULDING CLIP       | Necessary     | 60.00 FS   | *20.00 FS  |
| 38  | 1   |          | *SET TAILGATE INNER TRIM CLIP           | Necessary     | 80.00 FS   | *30.00 FS  |
| 39  | 1   |          | *SET TAILGATE INNER TRIM (TOP) CLIP     | Not Necessary | 80.00 FS   | *- FS      |
| 40  | 1   |          | *SET TAILGATE INNER TRIM (LOWER) CLIP   | Necessary     | 80.00 FS   | *30.00 FS  |
| 41  | 1   |          | *TAILGATE WINDSCREEN SEALANT            | Necessary     | 80.00 FS   | *40.00 FS  |
| 42  | 1   |          | *TAILGATE WINDSCREEN INNER SHIELD       | Necessary     | 60.00 FS   | *40.00 FS  |
| 43  | 1   |          | *SET TAILLAMP CLIP                      | Necessary     | 50.00 FS   | *20.00 FS  |
| 44  | 1   |          | *SET REAR FENDER INNER TRIM CLIP        | Necessary     | 80.00 FS   | *30.00 FS  |
| 45  | 1   |          | *SET REAR FENDER INNER COWLING CLIP     | Not Necessary | 80.00 FS   | *- FS      |
| 46  | 1   |          | *REAR END PANEL INSULATION SEAL         | Necessary     | 150.00 FS  | *60.00 FS  |
| 47  | 1   |          | *REAR END PANEL TOP GARNISH (CLIPS)     | Necessary     | 60.00 FS   | *20.00 FS  |
| 48  | 1   |          | *REAR END PANEL (EXTEND) SEALANT RH     | Not Necessary | 150.00 FS  | *- FS      |
| 49  | 1   |          | *REAR END PANEL BOTTOM (CENTRE) SEALANT | Necessary     | 120.00 FS  | *60.00 FS  |
| 50  | 1   |          | *REAR FLOOR PANEL SEALANT               | Not Necessary | 350.00 FS  | *- FS      |
| 51  | 4   |          | *REVERSE SENSOR                         | Damaged       | 380.00 FS  | *380.00 FS |
| 52  | 1   |          | *REVERSE CAMERA                         | Damaged       | 580.00 FS  | *380.00 FS |

F=Franchise part. S=SpcNett. L=ListItemDisc.

|                                                          |                  |                 |
|----------------------------------------------------------|------------------|-----------------|
| <b>Sub Total (\$)</b>                                    | <b>16,158.53</b> | <b>8,117.20</b> |
| <b>- List Item Discount on L Items 25.00/25.00% (\$)</b> | 3,389.63         | 1,731.80        |
| <b>Total Parts (\$)</b>                                  | <b>12,768.90</b> | <b>6,385.40</b> |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                             | Particulars                                                                                    | Lab.Type | Repairer's      | Amount          |
|--------------------------------|------------------------------------------------------------------------------------------------|----------|-----------------|-----------------|
| <b><u>Labour Items</u></b>     |                                                                                                |          |                 |                 |
| 1                              | TO PANEL BEAT ,REMOVE AND REPLACE PARTS                                                        | New      | 2,200.00        | 1,000.00        |
| 2                              | TO SPRAY PAINT AFFECTED AREA                                                                   | New      | 1,800.00        | 800.00          |
| 3                              | TUFF COAT                                                                                      | New      | 250.00          | 60.00           |
| 4                              | WIRING AND BULB CHECK                                                                          | New      | 180.00          | 30.00           |
| 5                              | REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR                   | New      | 350.00          | 60.00           |
| 6                              | CONDUCT WATER LEAKAGE TEST                                                                     | New      | 120.00          | 0.00            |
| 7                              | REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING                                           | New      | 150.00          | 50.00           |
| 8                              | REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING                                           | New      | 150.00          | 50.00           |
| 9                              | REMOVE AND REFIX VIDEO RECORDER AND DISTANCE SETTING                                           | New      | 150.00          | 50.00           |
| 10                             | TRANSFER TAILGATE MECHANISM                                                                    | New      | 120.00          | 80.00           |
| 11                             | REMOVE AND REFIX TAILGATE WINDSCREEN                                                           | New      | 120.00          | 120.00          |
| 12                             | REAR CHASSIS ALIGNMENT                                                                         | New      | 180.00          | 0.00            |
| 13                             | TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC | New      | 180.00          | 0.00            |
| <b>Gross Labour Cost (S\$)</b> |                                                                                                |          | <b>5,950.00</b> | <b>2,300.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >