Adjuster Report Page 1 of 4

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.

AIG Building, 78 Shenton Way #07-16

Singapore 079120 Date: 15/03/2021

REFERENCE

Insured/Claimant: TAN KWONG LUCK ROBERT Policy No: 1800083518

Date of Loss: 05/02/2021 Nature of Claim: OD Claim No: 0544205316SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SMC7198Y

 Make & Model:
 KIA CERATO, 1.6 (A)
 Engine No:
 G4FGHH692768

 Reg. Date:
 19/07/2018 (Man. Year: 2017)
 Chassis No:
 KNAFJ411MJ5762532

Colour: Black Odometer: 31234 km

Engine Capacity: 1591 cc
Market Value/New Car

Price: S\$65,000.00

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65R15 Rear Tyre Size: 195/65R15
Front Left Side: Kumho 4 mm Rear Left Side: Kumho 4 mm
Front Right Side: Kumho 4 mm
Rear Right Side: Kumho 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,298.40	758.40	540.00	41.59
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,380.00	2,540.00	840.00	24.85
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	4,678.40	3,298.40	1,380.00	29.50
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	4,378.40	2,998.40	1,380.00	31.52
+ GST 7.00/7.00% (S\$)	306.49	209.89	96.60	31.52
Nett Amount (S\$)	4,684.89	3,208.29	1,476.60	31.52

INSPECTION

Date of Assignment: 05/02/2021

Date Inspected: 05/02/2021 Inspected At: Cycle & Carriage KIA Pte Ltd (Pandan

Gardens)

209 Pandan Gardens Singapore 609339

CS/AIG21001768/EVF3Q2

Estimated Period of Repair: 5.0 days

Adjuster: CHEN TSUE YEE Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Adjuster Report Page 2 of 4

Adjuster Report Page 3 of 4

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*COVER-FR BUMPER	Repair	633.00 FL	*- FL	
2	1		*BRACKET-FR BUMPER SIDE MTG,LH	Not Necessary	13.00 FL	*- FL	
3	1		*STRIP ASSY-FR BUMPER UPR	Not Necesasry	29.00 FL	*- FL	
4	1		*ORNAMENT-KIA NO.115	Necessary	32.00 FL	*32.00 FL	
5	1		*MIRROR ASSY-OUTSIDE RR VIEW,LH	Cut	419.00 FL	*419.00 FL	
6	1		*W/STRIP ASSY-FR DR BELT O/S LH	Cut	58.00 FL	*58.00 FL	
7	1		*W/STRIP ASSY-RR DR BELT O/S LH	Cut	89.00 FL	*89.00 FL	
8	1		*SUNDRIES	Necessary	20.00 FS	*20.00 FS	
9	1		*LHF TYRE-KUMHO	Torn	260.00 FS	*260.00 FS	
F=Franchise part. S=SpcNett. L=ListItemDisc.							
				Sub Total (S\$)	1,553.00	878.00	
- List Item Discount on L Items 20.00/20.00% (S\$)					254.60	119.60	
				Total Parts (S\$)	1,298.40	758.40	
Report was unsubmitted during this print-out.							

Adjuster Report Page 4 of 4

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	RENEW FRT BUMPER & LH WINGMIRROR.REPAIR LHF DOOR & LHR DOOR	New	1,600.00	800.00
2	RESPRAY FRT BUMPER,LHF FENDER,LHF DOOR & LHR DOOR	New	1,400.00	1,400.00
3	RENEW LHF TYRE & WHEEL BALANCE	New	30.00	30.00
4	CHECK WIRING ELECTRICAL SYSTEM	New	30.00	30.00
5	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
6	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT	New	120.00	120.00
7	APPLY ANTI CORROSION ON AFFECTED AREAS	New	80.00	40.00
	Gross Labour Cost (S\$)		3,380.00	2,540.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >