

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG21001855/EQD3E2

Date: 10/03/2021

REFERENCE

Insured/Claimant:	TAY HEAN CHEOW	Policy No:	1900017500		
Date of Loss:	06/02/2021	Nature of Claim:	OD	Claim No:	3440858182SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMJ5395X		
Make & Model:	KIA CERATO, 1.6 (A)	Engine No:	G4FGJH716076
Reg. Date:	11/03/2019 (Man. Year: 2018)	Chassis No:	KNAF3416MK5027526
Colour:	Black	Odometer:	49120 km
Engine Capacity:	1591 cc		
Market Value/New Car Price:	S\$73,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55R16	Rear Tyre Size:	205/55R16
Front Left Side:	Tourador 5 mm	Rear Left Side:	Tourador 5 mm
Front Right Side:	Tourador 5 mm	Rear Right Side:	Tourador 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,092.00	2,645.60	3,446.40	56.57
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,250.00	3,880.00	3,370.00	46.48
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	13,342.00	6,525.60	6,816.40	51.09
+ GST 7.00/7.00% (S\$)	933.94	456.79	477.15	51.09
Nett Amount (S\$)	14,275.94	6,982.39	7,293.55	51.09

INSPECTION

Date of Assignment:	08/02/2021		
Date Inspected:	08/02/2021	Inspected At:	Cycle & Carriage KIA Pte Ltd (Pandan Gardens) 209 Pandan Gardens Singapore 609339
Estimated Period of Repair:	7.0 days		

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	20.00 FS	*20.00 FS
2	1		*COVER-RR BUMPER	Dented	651.00 FL	*651.00 FL
3	1		*COVER-RR BUMPER LWR	Broken	241.00 FL	*241.00 FL
4	1		*COVER-RR BUMPER FOG LAMP, LH	Cut	19.00 FL	*19.00 FL
5	1		*COVER-RR BUMPER FOG LAMP, RH	Not Necessary	19.00 FL	*- FL
6	1		*LAMP ASSY-SIDE T/SIGNAL, LH	Not Necessary	181.00 FL	*- FL
7	1		*LAMP ASSY-SIDE T/SIGNAL, RH	Not Necessary	181.00 FL	*- FL
8	1		*EXTN WIRING ASSY-BWS	Not Necessary	207.00 FL	*- FL
9	1		*BEAM-RR BUMPER	Broken	318.00 FL	*318.00 FL
10	1		*STAY-RR BUMPER LH	Bent	65.00 FL	*65.00 FL
11	1		*STAY-RR BUMPER RH	Bent	65.00 FL	*65.00 FL
12	1		*ANTENNA ASSY-SMARTKEY	Not Necessary	46.00 FL	*- FL
13	1		*BRACKET-RR BEAM UPR MTG, LH	Broken	9.00 FL	*9.00 FL
14	1		*BRACKET-RR BEAM UPR MTG, RH	Not Necessary	9.00 FL	*- FL
15	1		*BRACKET-RR BEAM LWR, CTR	Broken	6.00 FL	*6.00 FL
16	2		*BRACKET-RR BEAM LWR MTG	Not Necessary	12.00 FL	*- FL
17	1		*COVER-RR BUMPER UNDER, RH	Not Necessary	33.00 FL	*- FL
18	1		*BRACKET ASSY-RR BPR SIDE UPR, L	Not Necessary	25.00 FL	*- FL
19	1		*BRACKET-ASSY RR BPR SIDE UPR, R	Not Necessary	31.00 FL	*- FL
20	1		*COVER-RR BUMPER UNDER, LH	Not Necessary	33.00 FL	*- FL
21	1		*TRIM ASSY-RR TRANSVERSE	Not Necessary	41.00 FL	*- FL
22	1		*PANEL ASSY-BACK	Dented	324.00 FL	*324.00 FL
23	1		*PANEL ASSY-TRUNK LID	Dented	1,297.00 FL	*1,297.00 FL
24	1		*HINGE ASSY-TRUNK LID, LH	Not Necessary	97.00 FL	*- FL
25	1		*HINGE ASSY-TRUNK LID, LH	Not Necessary	97.00 FL	*- FL
26	1		*W/STRIP-TRUNK LID OPNG	Crushed	100.00 FL	*100.00 FL
27	1		*LATCH ASSY-TRUNK LID	Cut	112.00 FL	*112.00 FL
28	1		*STRIKER ASSY-TRUNK LID	Not Necessary	40.00 FL	*- FL
29	1		*LOGO ASSY-KIA SUB	Necessary	32.00 FL	*32.00 FL
30	1		*EMBLEM - CERATO	Necessary	28.00 FL	*28.00 FL
31	1		*LAMP ASSY-CENTER GARNISH	Not Necessary	690.00 FL	*- FL
32	1		*LAMP ASSY-REAR COMB INSIDE, LH	Not Necessary	608.00 FL	*- FL
33	1		*LAMP ASSY-REAR COMB INSIDE, RH	Not Necessary	608.00 FL	*- FL
34	1		*LAMP ASSY-REAR COMB OUTSIDE, LH	Not Necessary	675.00 FL	*- FL
35	1		*LAMP ASSY-REAR COMB OUTSIDE, RH	Not Necessary	675.00 FL	*- FL
36	5		*FASTENER (Supplementary)	Necessary	5.00 FL	*5.00 FL
37	5		*CLIP (Supplementary)	Necessary	10.00 FL	*10.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	7,610.00	3,302.00
- List Item Discount on L Items 20.00/20.00% (\$)	1,518.00	656.40
Total Parts (\$)	6,092.00	2,645.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RENEW RR BUMPER, BOOTLID & RR END PNL. REPAIR / ALIGN RR FLR PNL, LHR FENDER & RHR FENDER	New	2,400.00	800.00
2	RESPRAY RR BUMPER, RR END PNL, BOOTLID, RR FLR PNL, LHR FENDER & RHR FENDER	New	2,100.00	700.00
3	REMOVE & REFIT BOOTLID COMPONENT	New	120.00	120.00
4	REMOVE & REFIT RR FLR BOARD, TRIM, CARPET TO FACILITATE REPAIR	New	120.00	120.00
5	CHECK WIRING ELECTRICAL SYSTEM	New	30.00	30.00
6	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
7	SUPPLY RR NUMBER PLATE WITH CASING	New	50.00	0.00
8	REMOVE & REFIT REVERSE SENSOR	New	60.00	60.00
9	SUPPLY REVERSE SENSOR	New	220.00	0.00
10	APPLY ANTO CORROSION ON AFFECTED AREAS	New	80.00	0.00
11	SUPPLY BODY PNL SEALANT	New	60.00	40.00
12	SUPPLY C&C BADGE	New	40.00	40.00
13	REPLACE REAR END PANEL & REPAIR REAR QTR PANEL (LH&RH) (Supplementary)	New	800.00	800.00
14	SPRAY PAINT REAR END PANEL & BOTH REAR QTR PANEL (LH&RH) (Supplementary)	New	1,050.00	1,050.00
Gross Labour Cost (\$\$)			7,250.00	3,880.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >