



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103747

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 28/05/2021
Reference CC3/CTI21001881/T1ea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 1662S
Insured Veh. GBJ 467K
Claim No. SNM21D200869
Policy No. DMCVSNW00112892001
Accident Date 05/02/2021
Inspection Date 09/02/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21001881/T1ea3q2 Date: 28/05/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBJ 467K	Veh. Inspected	SHD 1662S	
Policy No.	DMCVSNW00112892001	Coverage (\$)	0.00	
Claim No.	SNM21D200869	Excess (\$)	0.00	
Assign From		Assign Date	09/02/2021	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI I30	c.c	1582	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	TMAD281UVHJ134107	Colour	SILVER	
Odometer	359202 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	MAXXIS	6 mm	
L/H Front Tyre	195/65 R15	MAXXIS	6 mm	
R/H Rear Tyre	195/65 R15	MAXXIS	6 mm	
L/H Rear Tyre	195/65 R15	MAXXIS	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/02/2021	Inspection Date	09/02/2021	
Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 1662S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT N/S DOOR	TO REPAIR SEE LABOUR	1,723.60	-
2	FRONT N/S DOOR HINGES @\$36.10	TO REPAIR SEE LABOUR	72.20	-
1	REAR N/S DOOR	BENT	2,017.48	2,017.48
2	REAR N/S DOOR HINGES @\$36.10	TO REPAIR SEE LABOUR	72.20	-
2	REAR BUMPER N/S & O/S SIDE BRACKET @\$32.50	NOT NECESSARY	65.00	-
1	REAR BUMPER	TO REPAIR SEE LABOUR	811.11	-
1	BONNET GRILLE	TO REPAIR SEE LABOUR	566.46	-
1	BONNET GRILLE -PIECE MOULDING	NOT NECESSARY	324.79	-
1	FRONT BUMPER SPONGE	NOT NECESSARY	218.03	-
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	636.40	-
1	FRONT BUMPER TOW CAP	NOT NECESSARY	60.10	-
1	SUPPORT PANEL	NOT NECESSARY	1,243.60	-
1	MUD GUARD FRONT N/S	NOT NECESSARY	47.48	-
1	FRONT N/S FENDER SIGNAL LIGHT	NOT NECESSARY	32.10	-
1	FRONT BUMPER N/S UPPER BRACKET	CRACKED	92.60	92.60
1	FRONT BUMPER N/S SUPPORT BRACKET	NOT NECESSARY	37.01	-
1	FRONT N/S FOG LAMP COVER	CUT	25.00	25.00
1	FRONT N/S HEAD LAMP	CRACKED	1,531.57	1,531.57
1	FRONT BUMPER	DISTORTED	811.11	811.11
1	FRONT BUMPER EMBLEM	NOT NECESSARY	27.80	-
1	FRONT BUMPER N/S SIDE BRACKET	NOT NECESSARY	32.51	-
1	FRONT N/S FENDER	BENT	514.02	514.02
1	FRONT N/S RIM	CUT	246.00	246.00
1	FRONT N/S LOWER ARM	NOT NECESSARY	811.34	-
1	FRONT N/S SHOCK ABSORBER	NOT NECESSARY	611.56	-
1	FRONT N/S TIE ROD END	NOT NECESSARY	72.50	-
1	FRONT N/S BALL JOINT	NOT NECESSARY	91.90	-
1	FRONT N/S KNUCKLE BEARING	NOT NECESSARY	349.60	-

Report Ref No. CC3/CTI21001881/T1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT N/S STABILIZER LINK	NOT NECESSARY	88.50	-
1	FRONT N/S FENDER INNER SHIELD	TORN	176.72	176.72
	LESS 20% DISCOUNT		-2,682.06	-1,082.90
			10,728.23	4,331.60
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	48.00	30.00
1	FRONT N/S FENDER STICKER (SN)	NECESSARY	30.00	30.00
1	TYRE FRONT N/S (SN)	NOT NECESSARY	200.00	-
1	SET FRONT N/S FENDER INNER SHIELD CLIPS (SN)	NECESSARY	28.00	10.00
1	SET N/S DOOR STICKER (SN)	NECESSARY	100.00	80.00
1	REAR N/S FENDER STICKER (SN)	NECESSARY	60.00	40.00
1	SET REAR N/S FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	28.00	-
1	SET REAR BUMPER CLIPS (SN)	NOT NECESSARY	48.00	-
1	SUNDRY (SN)	NECESSARY	50.00	20.00
			592.00	210.00
	<u>LABOUR</u>			
	TOWING FEE.		50.00	50.00
	TO CHECK WHEEL ALIGNMENT .		80.00	80.00
	TO FOCUS /CHECK FRONT N/S & O/S HEAD LAMPS .		60.00	30.00
	TO DISMANTLE AND REPLACE THE FRONT N/S UNDERCARRIAGE.	NOT NECESSARY	250.00	-
	TO DISMANTLE AND REFIT THE INNER COMPONENTS OF THE FRONT & REAR N/S DOORS INTO NEW SHELL DOOR .		300.00	60.00
	TO DISMANTLE /REFIT THE INNER GARNISHES ,INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ,ETC TO FACILITATE REPAIRS.		180.00	40.00
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS.INCLUDING KNOCK-OUT ,STRAIGHTEN ,REPAIR,RESHAPE AND ADJUST OF THE FRONT N/S FENDER ETC .INCLUSIVE OF THE REPAIR OF FRONT N/S DOOR,FRONT N/S DOOR HINGES,REAR N/S DOOR HINGES,REAR BUMPER AND BONNET GRILLE.		1,800.00	900.00
	TO PUTTY AND SPRAY PAINTING ON FRONT BUMPER ,FRONT N/S FENDER ,FRONT N/S WHEEL HOUSE ,BONNET ,FRONT N/S DOOR ,REAR N/S DOOR,N/S ROCKER PANEL ,REAR N/S FENDER ,REAR BUMPER .		1,800.00	1,200.00

Report Ref No. CC3/CTI21001881/T1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		150.00	40.00
			4,670.00	2,400.00
GRAND TOTAL			15,990.23	6,941.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,550.00

Report Ref No. CC3/CTI21001881/T1ea3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1662S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1662S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

