

Our reference:

21-7157

Date:

8/1/2021

c/oYap Motor Service Pte Ltd Blk7 Sin Ming Industrial East Sector C #01-82 Singapore 575642

Dear Sirs

RE:

Road Traffic Accident on 4/12/2020

**Harris Services** 

In accordance with your instructions received in this office or

21/12/2020

, we made arrangements to

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

examine the vehicle on

21/12/2020

at above-mentioned address. The following data was

recorded:

### Vehicle details

 
Make	Honda	<b>L</b> .			
Model	OF THE	Registration	SMS1044M		
	Freed	Chassis	GB71114737		
Colour	Grey	Gearbox			
Odometer	14969km	MATE AND DESCRIPT THE THE THE THE THE THE THE THE THE TH	Auto		
Steering	In order	Paintwork	Good		
	mi order	Brakes	In order		
Condition	Good	The same see see see see see see see see see s	es data made a gare made made made made made made made mad		

#### Tyre Depths

Front left	185/65R15	85% Yokohama
Front right	185/65R15	85% Yokohama
Rear left	185/65R15	85% Yokohama
Rear right	185/65R15	85% Yokohama

Status	REPAIRABLE		
Magnitude	Medium		
Legal status	Unroadworthy		

Impact Direction & Area of Damage:



Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$6,288.04 for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and and 7 working days physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd Infoknights International Services (Philippines) IABN Pte Ltd www.iaconsultingsg.com



Ourreference

21-7157

Date

8/1/2021

Page

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

# Section A: Damaged Parts Assessment

	-		CITE	
Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our
List Items:			Latimate	Adjustment
Tailgate	1	crushed	1498.00	10/1/1
Tail gate outer handle garnish	1	intact	287.60	1498.00 1044.20
Tail gate logo	1	necessary	45.90	0.00 NH
Tail gate emblem 'FREED'	1	necessary	64.50	45.90
Tail gate plate "HYBRID"	1	necessary		64.50
Tail gate inner trim board	1	deformed	102.00	102.00
Tail gate inner weatherstrip	1	ripped/nec	357.20	357.20
Tail gate top lock	1		214.00	214.00
Rear bumper	1	damaged	386.20	386.20
Rear bumper inner bracket Ih		crushed	948.30	948.30 _ 828.90
Rear bumper side retainer @\$56.40	1	damaged	75.40	75.40
Tail lamp @\$412.60	2	cracked	112.80	112.80 MH
Rear end panel	2	refix	825.20	0.00 HH
Rear end panel top garnish	1	bent	384.60	384.60
Rear fender inner trim @\$593.20	1	deformed	189.90	189.90
10.1del. 11.11 (2.53-35.20	2	refix	1186.40	0.00 HH
D	Sub- Total o	osts	6678.00	4378.80
	ge discount :	20%	1335.60	875.76 3503.04 3692.90 2954.24
St	ib-Total costs j	for parts ==	5342.40	3503.04
Special Nett Items:				2754.24
Tail gate windscreen sealant	1	D00000	60.00	1, 1
Rear bumper clip @\$6.5	8	necessary	60.00	60.00 40
Rear end panel sealant	1	necessary	52.00	52.00 20 -
Rear reverse camera	1	necessary	30.00	30.00
Rear reverse sensor		serviceable	350.00	0.00 HM
	1	malfunction	280.00	280.00 220 -

Subsidiaries of Impact Analysis Consultant:

Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd

<sup>■</sup> IA Accounting & Consultancy Pte Ltd ■ Infoknights International Services (Philippines) ■ IABN Pte Ltd www.iaconsultingsg.com



Ourreference

21-7157

Date

8/1/2021

Rear end panel top garnish clips	3 necessary Sub-Total costs for parts	19.50 <b>791.50</b>	19.50 441.50	15/-
Parts Repair				
*	* *	0.00	0.00	325.00
	Sub- Total costs	0.00	0.00	
	Total costs for parts	6133.90	3944.54	

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171



Our reference

21-7157

Date

8/1/2021

Page

3

## Section B: Labour Cost Calculation

	Hou	urly rate	Manhr. Req.	Total
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$	45.00	24 3 days	\$ 1,080.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.		Sub-con	tract work.	\$ 750.00
Apply rust proofing on the adjacent panels.		Sub-con	tract work.	\$ 50.00
Remove and refix upholstery to facilitate the repair works	\$	45.00	1.5	\$ 67.50
Remove and refix tailgate rear windscreen glass. (2-man job)	\$	45.00	3.5	\$ 157.50
Remove and replace rear bumper reverse sensor & conduct distance safety setting.	\$	45.00	1.7	\$ Z6.50
Conduct water leak test for rear portion associated repair works	\$	45.00	1	\$ 45.00
Transfer of existing tailgate mechanism to new tailgate	\$	45.00	1.8	\$ 81.00
Wiring and bulb checking	\$	45.00	0.8	\$ 36.00
		Total la	bour cost	\$ 2,343.50

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

1590-W

4869.24

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

• IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: **638**5 **1171** 



Ourreference

21-7157

Date

8/1/2021

## Section C: Summary Table of Total Repair Cost

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Description		Cost	
Damaged Parts Assessment (See section A)		\$3,944.54	
Par	t-By-Part		
Further discount	0%	\$0.00	
Recommended cost of parts		\$3,944.54	(1)
Labour Cost Calculation (See section B)		\$2,343.50	(2)
Total Repair Cost (Round off to hundred)		\$6,288.04	(1) + (2)

We would recommend a sum of	\$6,288.04	and	7	working days for repair.
No further items will be approved	without our expr	essed written agreen	nent. Any sic	gnificant additional
items will be subject to a supplem	entary report.			A CONTRACTOR OF THE CONTRACTOR

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hans, NUS)

Diploma. Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

Enterprise Singapore - Recognised Certification for Management Consultants

IMI Professional Certificate In Vehicle Accident Damage Assessment (UK)

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd
   Infoknights International Services (Philippines)
   IABN Pte Ltd
   www.iaconsultingsg.com