

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC4/AIG21002139/QBS3Q2**Date:** 05/08/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900234423
<b>Claimant Vehicle No :</b>	SMW2487R	<b>Insured Vehicle No :</b>	SMQ2592B
Date of Loss:	11/02/2021	Nature of Claim:	TP
		Claim No:	7305046624SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SMW2487R</b>	Engine No:	1ZR0F69823
Make & Model:	TOYOTA COROLLA ALTIS, 1.8 E HYBRID ELEGANCE (2WD) (A)	Chassis No:	MR2BE3BEX00011102
Reg. Date:	11/11/2020 (Man. Year: 2020)	Odometer:	18345 km
Colour:	White		
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

**CONDITION OF TYRES**

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	26,046.25	15,120.52	10,925.73	41.95
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,580.00	3,440.00	3,140.00	47.72
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>32,626.25</b>	<b>18,560.52</b>	<b>14,065.73</b>	<b>43.11</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>14,850.00</b>		

	(S\$)	32,626.25	14,850.00	17,776.25	54.48
<b>+ GST 7.00/7.00% (S\$)</b>		2,283.84	1,039.50	1,244.34	54.48
<b>Nett Amount (S\$)</b>		<b>34,910.09</b>	<b>15,889.50</b>	<b>19,020.59</b>	<b>54.48</b>
	<b>Global Sum Settlement (S\$)</b>		<b>0.00</b>		

INSPECTION

Date of Assignment: 17/02/2021

Date Inspected: 17/02/2021

Estimated Period of Repair: 10.0 days

Inspected At:

My Car Consultant Pte Ltd - Ubi (HQ)  
53 Ubi Ave 1, #01-33 Paya Ubi Industrial Park  
Singapore 408934

**Adjuster:** OI SUN PIN**Manager:** CHUA ZHEN LI

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Dented	1,354.00 FL	*1,167.40 FL
2	1		*BONNET LOCK	Jammed	312.00 FL	*155.00 FL
3	1		*BONNET RUBBER	Serviceable	18.00 FL	*- FL
4	2		*BONNET HINGES	Serviceable	136.00 FL	*- FL
5	1		*FRONT BUMPER	Deformed	798.00 FL	*581.00 FL
6	1		*FRONT BUMPER REINFORCEMENT	Bent	398.00 FL	*398.00 FL
7	1		*FRONT BUMPER SPONGE	Crumpled	198.00 FL	*198.00 FL
8	2		*FRONT BUMPER SIDE RETAINER	Broken	196.00 FL	*196.00 FL
9	1		*FRONT BUMPER CENTRE GRILLE	Crumpled	612.00 FL	*286.00 FL
10	1		*FRONT BUMPER LOWER GRILLE	Serviceable	289.00 FL	*- FL
11	1		*FRONT BUMPER UNDERCOVER	Deformed	298.00 FL	*298.00 FL
12	1		*FRONT BUMPER LOWER COVER GARNISH RH	Serviceable	212.00 FL	*- FL
13	1		*FRONT BUMPER LOWER COVER GARNISH LH	Serviceable	354.00 FL	*- FL
14	2		*FRONT BUMPER FOGLAMP	Serviceable	774.00 FL	*- FL
15	1		*FRONT BUMPER FOGLAMP COVER	N/S Crumpled	260.00 FL	*130.00 FL
16	1		*FRONT GRILLE	Cracked	590.00 FL	*446.00 FL
17	1		*FRONT GRILLE TOP RUBBER	Serviceable	75.00 FL	*- FL
18	1		*FRONT GRILLE TOP GARNISH	Serviceable	198.00 FL	*- FL
19	1		*FRONT GRILLE LOGO	Necessary	187.00 FL	*98.00 FL
20	1		*AIR CLEANER AIR DUCT	Crumpled	212.00 FL	*212.00 FL
21	1		*AIR CLEANER HOUSING	Serviceable	512.00 FL	*- FL
22	2		*HEADLAMP LED	Cracked	5,596.00 FL	*4,700.00 FL
23	2		*HEADLAMP LOWER BRACKET LED	Serviceable	224.00 FL	*- FL
24	2		*HEADLAMP CHROME MOULDING	Serviceable	270.00 FL	*- FL
25	2		*FRONT FENDER	Serviceable	1,196.00 FL	*- FL
26	2		*FRONT FENDER COWLING	Serviceable	318.00 FL	*- FL
27	1		*BOOTLID	Crumpled	1,024.00 FL	*1,024.00 FL
28	1		*BOOTLID INNER TRIM	Deformed	359.00 FL	*265.00 FL
29	2		*BOOTLID REFLECTOR C/W CHROME	Cracked	912.00 FL	*912.00 FL
30	4		*BOOTLID STOPPER	Serviceable	300.00 FL	*- FL
31	1		*BOOTLID TOP LOCK	Jammed	398.00 FL	*398.00 FL
32	1		*BOOTLID TOP LOCK COVER	Serviceable	68.00 FL	*- FL
33	1		*BOOTLID OUTER CHROME MOULDING	Cracked	312.00 FL	*312.00 FL
34	1		*BOOTLID LOWER LOCK	Serviceable	39.00 FL	*- FL
35	1		*BOOTLID WEATHERSTRIP	Crumpled	220.00 FL	*220.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	1		*BOOTLID LOGO	Necessary	74.00 FL	*74.00 FL
37	1		*BOOTLID EMBLEM ALTIS	Necessary	65.00 FL	*65.00 FL
38	1		*BOOTLID SENSOR	Crumpled	312.00 FL	*160.00 FL
39	1		*BOOTLID EMBLEM COROLLA	Necessary	65.00 FL	*65.00 FL
40	2		*BOOTLID NUMBER PLATE LAMP	Serviceable	124.00 FL	*- FL
41	2		*TAILAMP C/W CHROME	Cracked	1,224.00 FL	*1,224.00 FL
42	1		*TAILAMP LOWER PANEL	O/S Dented	644.00 FL	*322.00 FL
43	1		*REAR BUMPER	Crumpled	698.00 FL	*582.00 FL
44	2		*REAR BUMPER SIDE RETAINER	Broken	224.00 FL	*224.00 FL
45	2		*REAR BUMPER BRACKET	Bent	326.00 FL	*326.00 FL
46	2		*REAR BUMPER SENSOR	Shorted	762.00 FL	*762.00 FL
47	1		*REAR BUMPER SENSOR WIRE HARNESS	Serviceable	587.00 FL	*- FL
48	1		*REAR BUMPER REINFORCEMENT	Dented	395.00 FL	*280.00 FL
49	1		*REAR BUMPER REFLECTOR	O/S Crumpled	224.00 FL	*112.00 FL
50	1		*REAR BUMPER UNDERCOVER	Deformed	315.00 FL	*315.00 FL
51	1		*AIR VANT	Serviceable	65.00 FL	*- FL
52	1		*REAR FENDER	O/S Dented	2,048.00 FL	*988.10 FL
53	2		*REAR FENDER COWLING	Serviceable	716.00 FL	*- FL
54	2		*REAR FENDER INNER TRIM	Deformed	796.00 FL	*665.00 FL
55	1		*REAR WINDSCREEN MOULDING	Necessary	112.00 FL	*112.00 FL
56	1		*REAR END PANEL	Dented	695.00 FL	*616.00 FL
57	1		*END PANEL TOP GARNISH	Crumpled	278.00 FL	*220.00 FL
58	1		*REAR FLOOR PANEL	Repair	1,025.00 FL	*- FL
59	1		*REAR SPARE TYRE TOP BOARD	Crumpled	357.00 FL	*212.20 FL
60	1		*REAR EXHAUST PIPE	Repair	951.00 FL	*- FL
61	1		*REAR EXHAUST PIPE HEAT SHIELD	Serviceable	398.00 FL	*- FL
62	2		*REAR EXHAUST MOUNTING	Serviceable	56.00 FL	*- FL
63	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
64	1		*FRONT NUMBER PLATE	Dented	50.00 FS	*50.00 FS
65	1		*SET FRONT BUMPER LOWER GRILLE CLIPS	Necessary	50.00 FS	*30.00 FS
66	1		*SET FRONT BUMPER LOWER COVER GARNISH CLIPS	Necessary	50.00 FS	*30.00 FS
67	1		*FRONT GRILLE CLIPS	Necessary	50.00 FS	*20.00 FS
68	1		*REAR NUMBER PLATE	Serviceable	50.00 FS	*- FS
69	1		*BOOTLID INSULATOR CLIPS	Necessary	30.00 FS	*30.00 FS
70	1		*SET TAILAMP CLIPS	Necessary	40.00 FS	*20.00 FS
71	1		*REAR FENDER SEALANT	Necessary	150.00 FS	*30.00 FS
72	1		*SET REAR FENDER COWLING CLIPS	Serviceable	50.00 FS	*- FS
73	1		*SET REAR FENDER INNER TRIM CLIPS	Necessary	50.00 FS	*30.00 FS
74	1		*REAR WINDSCREEN SEALANT	Necessary	80.00 FS	*30.00 FS
75	1		*REAR WINDSCREEN INNER SEAL	Serviceable	80.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
76	1		*REAR END PANEL TOP GARNISH CLIPS	Necessary	30.00 FS	*20.00 FS	
77	1		*REAR END PANEL SEALANT	Necessary	120.00 FS	*30.00 FS	
78	1		*REAR SPARE TYRE PANEL SEALANT	Serviceable	150.00 FS	*- FS	
79	1		*REVERSE CAMERA	Scratched	400.00 FS	*280.00 FS	
					<b>Sub Total (\$)</b>	<b>34,235.00</b>	<b>19,950.70</b>
					<b>- List Item Discount on L Items 25.00/25.00% (\$)</b>	<b>8,188.75</b>	<b>4,830.18</b>
					<b>Total Parts (\$)</b>	<b>26,046.25</b>	<b>15,120.52</b>

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	SPRAY PAINTING ON AFFECTED AREAS	New	2,800.00	1,400.00
2	PANEL BEATING ON AFFECTED AREAS	New	2,800.00	1,800.00
3	REFOCUS FRONT HEADLAMP	New	80.00	0.00
4	REMOVE AND REFIR REAR WINDSCREEN GLASS	New	150.00	120.00
5	REMOVE AND REFIR REAR BOOTLID MECHANISM	New	100.00	60.00
6	REMOVE AND REFIR REAR EXHAUST SYSTEM	New	150.00	0.00
7	REMOVE AND REFIR FUEL TANK ASSY	New	150.00	0.00
8	REAR CHASSIS ALIGNMENT	New	200.00	0.00
9	TO CHECK ELECTRICAL WIRING	New	100.00	30.00
10	APPLY ANTI RUST ON AFFECTED AREAS	New	50.00	30.00
			<b>Gross Labour Cost (S\$)</b>	<b>3,440.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >