

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/GRB21002215/NVF3E2

**Date:** 26/02/2021

### REFERENCE

Handling Insurer: India International Insurance Pte Ltd

Policy No:

**Claimant Vehicle No :** SCW8880S

**Insured Vehicle No :** SLS9851J

Date of Loss: 04/02/2021

Nature of Claim: TP Claim No: N/A

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SCW8880S**

Make & Model: HONDA STREAM, 1.8 L (A)

Engine No: R18A12803620

Reg. Date: 02/06/2008 (Man. Year: 2008)

Chassis No: JHMRN68408S203633

Colour: Blue

Odometer: 161606 km

Engine Capacity: 1799 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 205/65 R15

Rear Tyre Size: 205/65 R15

Front Left Side: Yokohama 5 mm

Rear Left Side: Yokohama 4 mm

Front Right Side: Yokohama 5 mm

Rear Right Side: Yokohama 4 mm

*The above values represent the remaining tyre treads depth*

| COST OF CLAIMS            | Repairer's  | Adjuster's  | Difference  | Diff % |
|---------------------------|-------------|-------------|-------------|--------|
| Parts                     | 0.00        | 0.00        | 0.00        |        |
| Miscellaneous Items       | 0.00        | 0.00        | 0.00        |        |
| Labour                    | 0.00        | 0.00        | 0.00        |        |
| Paintwork Labour          | 0.00        | 0.00        | 0.00        |        |
| Towing                    | 0.00        | 0.00        | 0.00        |        |
| <b>Nett Amount (\$\$)</b> | <b>0.00</b> | <b>0.00</b> | <b>0.00</b> |        |

### INSPECTION

Date of Assignment: 16/02/2021

Date Inspected: 17/02/2021 Inspected At:

3 Motorwerkz Concepts Pte Ltd (HQ)  
25 Kaki Bukit Road 4, Synergy @ KB #01-40  
Singapore 417800

Estimated Period of Repair: 0.0 days

**Adjuster:** Muhammad Nazril Bin Abdullah

**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

# REPAIR DETAILS

|               |  |  |
|---------------|--|--|
| Reference     |  |  |
| Part Source:  | MRM-SG   | Version: 1.0 (Last Synchronised: 26 Feb 2021)            |
| Parts:        | M1-MPV   | HONDA STREAM 1.8 L (A) (Catalogue:Merimen Singapore 1.0) |
| Labour:       | Repairer's   | (Price-denominated Standard List)                        |
| Print Code:   | (Unsubmitted, no print-code for SCW8880S)  |  |
| Validity:     | These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page |  |
| Further Info: | Items/values not in reference catalogue are prefixed with an asterisk *.   |  |

## Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

|   |
|---|
| Report was unsubmitted during this print-out. |
|---|

< END OF ESTIMATES >