

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21002465/GGA3Q2
Date: 29/10/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100358252-07
Claimant Vehicle No :	SH7012C	Insured Vehicle No :	SKM1900Y
Date of Loss:	19/02/2021	Nature of Claim:	TP
		Claim No:	6176207693SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SH7012C		
Make & Model:	TOYOTA PRIUS, 1.8 HYBRID CVT (A)	Engine No:	2ZRS042641
Reg. Date:	25/05/2017 (Man. Year: 2017)	Chassis No:	JTDKB3FU103556797
Colour:	Blue	Odometer:	443874 km
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	West Lake 6 mm	Rear Left Side:	West Lake 6 mm
Front Right Side:	West Lake 6 mm	Rear Right Side:	West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,326.69	64.87	2,261.82	97.21
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,450.00	850.00	600.00	41.38
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,776.69	914.87	2,861.82	75.78
Approved Total (Overridden) (S\$)		750.00		

(S\$)	3,776.69	750.00	3,026.69	80.14
+ GST 7.00/7.00% (S\$)	264.37	52.50	211.87	80.14
Nett Amount (S\$)	4,041.06	802.50	3,238.56	80.14
+ Loss of Use (2.0 x S\$50.00/day) (S\$)		100.00		
+ Car Rental (2.0 x S\$125.40/day) (S\$)		250.80		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		1,155.30		

INSPECTION

Date of Assignment: 22/02/2021

Date Inspected: 22/02/2021

Estimated Period of Repair: 2.0 days

Inspected At:

ComfortDelGro Engineering Pte Ltd (Loyang)
59 Loyang Drive
Singapore 508969

Adjuster: XING GUO QIANG**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*COVER FRONT BUMPER	Repair	499.90 FL	*- FL	
2	1		*FENDER SUB-ASSY FRONT LH	Repair	945.30 FL	*- FL	
3	1		*WHEEL DISC	Repair	1,570.55 FL	*- FL	
4	1		*EMBLEM SIDE PANEL (HYBRID)	Necessary	86.50 FL	*86.50 FL	
F=Franchise part. L=ListItemDisc.							
Sub Total (S\$)						3,102.25	86.50
- List Item Discount on L Items 25.00/25.00% (S\$)						775.56	21.63
Total Parts (S\$)						2,326.69	64.87

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	800.00	350.00
2	SPRAYPAINT CHARGE	New	600.00	500.00
3	TUFF COAT ON AFFECTED PARTS	New	50.00	0.00
Gross Labour Cost (\$\$)			1,450.00	850.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >