

TAN CHONG MOTOR SALES PTE. LTD.
911, BUKIT TIMAH ROAD
SINGAPORE 589623

ESTIMATE : ACCIDENT/BODY REPAIRS
WORKSHOP : BUKIT TIMAH
CONTACT NO : 4694091
REFERENCE : INS/IC/LAW/0055/2021
DATE : 24-FEB-2021

LONPAC INSURANCE BHD
300 BEACH RD
#17-04/07 THE CONCOURSE
S(199555)
TEL : 62507388
FAX : 62962706
MOTOR CLAIMS DEPT

OWNER'S NAME : MR LIM CHENG HAN
ADDRESS : BLK 291C BUKIT BATOK STREET 24
#18-27
S(652291)
TELEPHONE NO : 65657215/97858741

TYPE OF CLAIM : DIRECT SETTLEMENT / THIRD PARTY CLAIM
POLICY NO : TP-GBF3903U
VEHICLE NO : SLU7215Z
MODEL CODE : FRLARDWJ11USA--A--
MODEL/YEAR : NISSAN QASHQAI 1.2 MY2017
ENGINE NO : HRA2531456A
CHASSIS NO : SJNFEAJ11U2119610
MILEAGE : 1 KM
DATE IN : 24/02/2021
LIABILITY : 0.00
EXCESS CLAUSE : 0.00
ESTIMATE BY : LAWRENCE
ACCIDENT DATE : 23/02/2021

1155
24/02/2021

DIRECT SETTLEMENT
OWNER CLAIMING LOSS OF USE / RENTAL
CAR AT ~~WORKSHOP~~ / CAR NOT AT WORKSHOP
KINDLY REVERT TO ME ASAP
EMAIL : lawrenceteo@tanchong.com
H/P : 94568832 FAX : 64697472

Ar
Law
10/21

TAN CHONG MOTOR SALES PTE. LTD.
 BUKIT TIMAH W/SHOP
 SERVICE DEPARTMENT

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE REGN NO SLU7215Z

S/NO JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1 RITCAM	REMOVE/INSTALL & TEST REAR REVERSE CAMERA	120.00	✓
2 RPI	PERFORM RUST PROOFING & TREATMENT FOR AFFECTED PANEL \$120/PANEL X 03	360.00	120 ✓
3 RS	SUPPLY & INSTALL REVERSE SENSOR	110.00	✓
4 SEALI	APPLY SEALANT TO ALL AFFECTED PANEL JOINTS & RESEAL NECESSARY AREA \$100/PANEL X 03	300.00	100 ✓
5 SRW	INSTALL ULTRAMAX SOLAR FILM - REAR W/SCREEN	150.00	✓
6 UG14	RENEW REAR WINDSCREEN GLASS ASSY.	240.00	plh ✓
7 ZZ/001	REPAIR LH/RH REAR FENDER AND RENEW TAILGATE, REAR BUMPER AND END PANEL	1500.00	780 1170 ✓
8 ZZ/002	S/PAINT REAR PORTION	1500.00	600 850 ✓
9 ZZ/003	CHECK LIGHTING	48.00	✓
10 ZZ/004	TRANSFER TAILGATE MECHANICAL PARTS	80.00	✓
11 ZZ/005	R/I REAR DVR TO ASSIST REPAIR	120.00	✓
TOTAL LABOUR CHARGES		4528.00	3108 ✓

TAN CHONG MOTOR SALES PTE. LTD.
 BUKIT TIMAH W/SHOP
 SERVICE DEPARTMENT

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SLU7215Z

S/NO PARTS DESCRIPTION	PARTS NUMBER	DAMAGED PARTS & PRICES		
		NETT	LIST	S/NETT REMARKS
1 EMBLEM <i>ne</i> ✓	90892-4EA0A	94.40 ✓		
2 EMBLEM-REAR <i>ne</i> ✓	90890-4EA0A	64.90 ✓		
3 STRIKER-TAIL GA <i>? xsvc</i>	90570-4EA0A	34.80		
4 A LOCK LIFT <i>? xsvc</i>	90502-4EA1B	173.20		
5 WEATHER STRIP <i>? xsvc</i>	90830-4EA0B	167.00		
6 A FIN BACK DOOR TOP NO PLATE <i>de</i> ✓	90810-4ES0H	352.00 ✓		
7 RUBBER-DUM <i>ne</i> ✓	G2716-89900	63.80 ✓		
8 GLASS-TAIL GATE <i>ne / photo</i>	90300-HV00A	990.00 ✓		
9 DOOR BACK <i>bt</i> ✓	K0100-HV0MB	3062.60 ✓		
10 GROMMET BUMPER \$2.40 EA X 02 <i>ne</i> ✓	01281-00111			4.80 ✓
11 GROMMET BUMPER \$2.70 EA X 04 <i>ne</i> ✓	63846-5V000	10.80 ✓		
12 CLIP BUMPER \$8.00 EA X 03 <i>ne</i> ✓	85284-JD00A	24.00 ✓		
13 CANOE RIVET BUMPER \$7.10 EA X 02 <i>ne</i> ✓	76882-0M000	14.20 ✓		
14 RETAINER-BUMPER RH <i>? xsvc</i>	79184-4EA0A	25.70		
15 RETAINER-BUMPER LH <i>? xsvc</i>	79185-4EA0A	25.70		
16 BRACKET-BUMPER RH <i>? xsvc</i>	85220-4EA0A	38.90		
17 BRACKET-BUMPER LH <i>? xsvc</i>	85221-4EA0A	38.90		
18 STAY ASSY-REAR RH <i>? xsvc</i>	H5210-4EAMA	141.00		
19 STAY ASSY-REAR LH <i>? xsvc</i>	H5211-4EAMA	141.00		
20 REINF-BUMPER RR <i>? xsvc</i>	H5030-4EAMA	691.50		
21 ENERGY ABSORBER <i>? xsvc</i>	85090-HV00A	141.40		
22 FASCIA-RR BUMP <i>de</i> ✓	85022-HV00H	796.70 ✓		
23 CLIP FINISHER END PANEL \$1.30 EA X 04 <i>? xan</i>	01554-00181	5.20		
24 CLIP END PANEL \$1.30 EA X 02 <i>? xan</i>	01553-05323	2.60		
25 PLATE-LUGGAGE <i>? xsvc</i>	84992-4EA0A	68.80		

TAN CHONG MOTOR SALES PTE. LTD.
 BUKIT TIMAH W/SHOP
 SERVICE DEPARTMENT

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SLU7215Z

S/NO PARTS DESCRIPTION	PARTS NUMBER	DAMAGED PARTS & PRICES		
		NETT	LIST	S/NETT REMARKS
26 PANEL-REAR UPPE ? <i>xsuc</i>	G9110-HV0MA	482.60		
27 CLIP FENDER ARC/BUMPER \$1.30 EA X 04 <i>ne</i> ✓	01553-05933	5.20 ✓		
28 FENDER RH REAR ARC ? <i>xsuc</i>	93828-4EA0A	540.50		
29 FENDER ARC LH REAR ? <i>xsuc</i>	93829-4EA0A	540.50		
30 MOTOR-WIPER ? <i>xsuc</i>	28710-4EL0A			427.30
31 GROMMET C/LAMP \$27.90 EA X 02 <i>ne</i> ✓	76848-83P00	55.80 ✓		
32 GROMMET C/LAMP \$2.00 EA X 02 <i>ne</i> ✓	76848-35F00	4.00 ✓		
33 CLIP C/LAMP \$5.40 EA X 02 <i>ne</i> ✓	26398-ED000	10.80 ✓		
34 LAMP COMB RR,LH BOOT ? <i>xsuc</i>	26555-HV55A	231.30		
35 LAMP COMB RR,LH ? <i>xsuc</i>	26555-HV00A	346.90		
36 CLIP GRILLE RAD \$1.80 EA X 04 <i>X inconsistent X</i>	01515-00QAB	7.20		
37 GRILLE-RADIATOR <i>X inconsistent X</i>	62310-HV00A	486.00		
38 CAMERA BRACKET <i>ne</i> ✓	BRACKET-CAM			20.00 ✓
39 SUNDRIES <i>ne</i> ✓	NPN			<i>20</i> / 100.00
40 REAR W/SCREEN SEALANT <i>ne</i> ✓	SEALANT - 4			80.00
41 SENSOR-REVERSE <i>se</i> ✓	SENSOR			250.00 ✓
SUB TOTAL		9879.90	0.00	882.10
LESS DISCOUNT (NETT-20.00%, LIST-30.00%, S/NETT-.00%)		1975.98	0.00	0.00
GRAND TOTAL		7903.92	0.00	882.10
OVERALL TOTAL		8786.02		

LEGEND: REMARKS(OK) = APPROVED, REMARKS(X) = NOT APPROVED

TAN CHONG MOTOR SALES PTE. LTD.
BUKIT TIMAH W/SHOP
SERVICE DEPARTMENT

SUMMARY OF ESTIMATE FOR VEHICLE REGN NO SLU7215Z

TOTAL LABOUR CHARGES 4528.00
TOTAL SPARE PARTS CHARGES 8786.02

GRAND TOTAL 13314.02 *

* All charges do2 not include GST.

SURVEYOR'S PARTICULARS

NAME :
SURVEYED DATE :
AUTHORIZED DATE :
EXCESS CLAUSE :
LIABILITY :
REMARKS :

Rasul - Hp 9000068
02/03/21 @ 1000 hrs
4 days

Resy before part

PLS NOTE : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges & spare parts in the process of repairs, we shall inform you accordingly.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: