

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG21002700/QVF3E2

Date: 17/03/2021

REFERENCE

| | | | |
|------------------------------|--------------------------------------|-----------------------------|--------------|
| Handling Insurer: | AIG Asia Pacific Insurance Pte. Ltd. | Policy No: | 2100504067 |
| Claimant Vehicle No : | SLL5550R | Insured Vehicle No : | SKW25C |
| Date of Loss: | 19/02/2021 | Nature of Claim: | TP |
| | | Claim No: | 5871451378SG |

DESCRIPTION & IDENTIFICATION OF VEHICLE

| | | | |
|-----------------------------|-------------------------------------|-------------|-------------------|
| Reg No: | SLL5550R | Engine No: | K24W72013982 |
| Make & Model: | HONDA ODYSSEY, 2.4 EXV-S CVT SR (A) | Chassis No: | JHMRC1890GC209959 |
| Reg. Date: | 30/03/2017 (Man. Year: 2016) | Odometer: | 119618 km |
| Colour: | Grey | | |
| Engine Capacity: | 2356 cc | | |
| Market Value/New Car Price: | N/A | | |
| Sum Insured (S\$): | Market Value/New Car Price | | |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

| | | | | |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition: | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification: | No | Pre-accident Condition: |

CONDITION OF TYRES

| | | | |
|-------------------|------------|------------------|------------|
| Front Tyre Size: | 215/55 R17 | Rear Tyre Size: | 215/55 R17 |
| Front Left Side: | Toyo 6 mm | Rear Left Side: | Toyo 6 mm |
| Front Right Side: | Toyo 6 mm | Rear Right Side: | Toyo 6 mm |

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|--------------------------|-------------|-------------|-------------|--------|
| Parts | 0.00 | 0.00 | 0.00 | |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 0.00 | 0.00 | 0.00 | |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Nett Amount (S\$) | 0.00 | 0.00 | 0.00 | |

INSPECTION

| | | | |
|-----------------------------|------------|---------------|--|
| Date of Assignment: | 01/03/2021 | | |
| Date Inspected: | 01/03/2021 | Inspected At: | Eng Soon Painting Services (HQ) 393J WOODLANDS ROAD Singapore 677978 |
| Estimated Period of Repair: | 2.0 days | | |

Adjuster: OI SUN PIN

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|--------------------|-----|----------|----------------------------|-----------|------------|--------|
| 1 | 1 | | *REAR BUMPER | Cut | 0.00 F | *- F |
| 2 | 1 | | *REAR BUMPER SIDE RETAINER | Broken | 0.00 F | *- F |
| 3 | 1 | | *REAR RH TAILLAMP | Scratched | 0.00 F | *- F |
| 4 | 1 | | *REAR RH WHEEL RIM | Scratched | 0.00 F | *- F |
| 5 | 1 | | *REAR RH WHEEL BEARING | Jammed | 0.00 F | *- F |
| F=Franchise part. | | | | | | |
| Total Parts (\$\$) | | | | | 0.00 | 0.00 |

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

| |
|---|
| Report was unsubmitted during this print-out. |
|---|

< END OF ESTIMATES >