

PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0431-16-TCA

15 August 2016

ACCIDENT VEHICLE SURVEY REPORT

Yeo Pei Ching
Blk 157 Ang Mo Kio Ave 4 #04-548
Singapore 560157

VEHICLE INFORMATION:

Vehicle Reg No.:	SJA5535S	Odometer:	077237km
Make & Model:	Subaru 2.5WRX STI	Colour:	White
Chassis number:	JF1GDFKH37G065335	Date of accident:	17/05/2016
Year of Regn.:	13/12/2007	Date inspected:	19/05/2016
Repairer at:	Twincar Automotive Pte Ltd Blk 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921		

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	6mm/Yokohama	6mm/Yokohama	235/45R17
Rear:	6mm/Yokohama	6mm/Yokohama	235/45R17

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the front portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
FRONT AIR DUCT	1	reuse	125.50	0.00 X NN
FRONT AIR DUCT CLIPS <i>Ne new</i>	2	necessary	13.00	13.00 X
FRONT BONNET <i>Repis</i>	1	buckled	972.00	972.00 X
FRONT BONNET HINGES L/R	2	repair	40.00	0.00 X
FRONT BONNET MECHANISM LOCK <i>Ne new</i>	1	bent	64.00	64.00 X
FRONT BONNET RUBBER GUIDE STOPPER L/R <i>Ne new</i>	4	deformed	50.00	50.00 X
FRONT BONNET WEATHERSTRIP <i>Ne new</i>	1	deformed	52.00	52.00 X
FRONT BRACE PANEL	1	repair	51.40	0.00 X
FRONT BUMPER	1	squashed	540.00	540.00 ✓
FRONT BUMPER FOGLAMP COVER 'STI' STICKER L/R	2	necessary	130.40	130.40 ✓
FRONT BUMPER FOGLAMP COVER L/R	2	warped	230.40	230.40 ✓
FRONT BUMPER INNER SPONGE	1	deformed	118.80	118.80 ✓
FRONT BUMPER NOZZLE HOSE L/R	2	reuse	194.40	0.00 X NN
FRONT BUMPER REINFORCEMENT	1	bent	338.40	338.40 ✓
FRONT BUMPER SIDE RETAINER L/R	2	necessary	48.00	48.00 ✓
FRONT BUMPER TOW HOOK COVER	1	warped	12.00	12.00 ✓
FRONT GRILLE 'CENTER'	1	fractured	306.00	306.00 ✓
FRONT GRILLE 'LOGO' EMBLEM	1	necessary	85.10	85.10 ✓
FRONT GRILLE 'STI' EMBLEM	1	necessary	37.50	37.50 ✓
FRONT GRILLE CLIPS	6	necessary	39.00	39.00 ✓
FRONT GRILLE L/R	2	fractured	478.80	478.80 ✓
FRONT HEADLAMP LOWER BRACKET L/R <i>RH Bent</i>	2	bent	116.00	116.00 58
FRONT HEADLAMP NOZZLE COVER L/R <i>RH could</i>	2	warped	129.60	129.60 64.80
FRONT HEADLAMP NOZZLE L/R <i>RH could</i>	2	fractured	259.20	259.20 129.60
FRONT LH HEADLAMP <i>3 new</i>	1	fractured	2,160.00	2,160.00 X
FRONT LH HEADLAMP CLIPS	2	necessary	13.00	13.00 X
FRONT RH HEADLAMP <i>could</i>	1	fractured	2,160.00	2,160.00 ✓
FRONT RH HEADLAMP CLIPS	2	necessary	13.00	13.00 ✓
FRONT SUPPORT PANEL ASSY	1	repair	525.10	0.00 X
HORN <i>Ne New</i>	2	distortion	118.80	118.80 X
Subtotal before discount			S\$ 9,421.40	S\$ 8,485.00
Percentage discount 20% and 20%			S\$ 1,884.28	S\$ 1,697.00
Sub-total 1			S\$ 7,537.12	S\$ 6,788.00
FRONT BONNET INSULATOR MAT CLIPS - SET <i>Ne new</i>	1	necessary	30.00	30.00 X
FRONT BUMPER CLIPS - SET	1	necessary	30.00	30.00 ✓
FRONT BUMPER LOWER LIP	1	deformed	1,200.00	1,200.00 500
FRONT BUMPER NUMBER PLATE	1	bent	25.00	25.00 ✓
FRONT BUMPER NUMBER PLATE HOLDER <i>585</i>	1	bent	50.00	50.00 30
RADIATOR COOLANT - BOT	1	reuse	80.00	0.00 X NN
Subtotal before discount			S\$ 1,415.00	S\$ 1,335.00
Sub-total 2			S\$ 1,415.00	S\$ 1,335.00
Parts-total			S\$ 8,952.12	S\$ 8,123.00

LABOUR

To remove, reinstall air con parts, vacuums, refill air con gas. (to FR)	180.00	150.00	X
To remove, reinstall electrical wiring harness, check lighting, resetting headlamp focussing and rewire for parking sensor.	150.00	60.00	30.
To re-spray painting on the front bonnet, front support panel, front fender (L/R) and front bumper.	1,250.00	1,000.00	500.
To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	860 1,000.00	880.00	400.
To apply anti-rust chemical on repaired and replaced panel.	120.00	60.00	30
Labour Total	SS 2,700.00	SS 2,150.00	
Parts & Labour Total	SS 11,652.12	SS 10,273.00	

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : SS 8,700.00
and the recommended number of working days for the repairs is within 7 day(s).
Results of inspection of the accident vehicle are as shown above.

h

B J Loi (I Eng., MIMI, AIRTE)
Automotive Appraiser

Total: 5276.84

h/s: 42K.

04 Days.