

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG20002783/GQF3E2-1

Date: 29/04/2021

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: 29141713

Claimant Vehicle No : JRE4592

Insured Vehicle No : SLH4457E

Date of Loss: 15/02/2020

Nature of Claim: TP

Claim No: 619953

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: JRE4592

Make & Model: YAMAHA 135LC, 135cc ES

Engine No: G399E323885

Reg. Date: 25/11/2015 (Man. Year: 2015)

Chassis No: PMYUG0410F0323885

Colour: White

Odometer: 8407 km

Engine Capacity: 135 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 70/90-17

Rear Tyre Size: 80/90-17

Front Left Side: Maxxis 4 mm

Rear Left Side: Maxxis 4 mm

Front Right Side: 0 mm

Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,880.70	2,226.75	2,653.95	54.38
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,190.00	250.00	940.00	78.99
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,070.70	2,476.75	3,593.95	59.20
Approved Total (Overridden) (S\$)		2,000.00		
(S\$)	6,070.70	2,000.00	4,070.70	67.05
+ GST 7.00/7.00% (S\$)	424.95	140.00	284.95	67.05
Nett Amount (S\$)	6,495.65	2,140.00	4,355.65	67.05

INSPECTION

Date of Assignment: 18/02/2020

Date Inspected: 18/02/2020 Inspected At:

A-Tec Automotive Pte Ltd (Kaki Bukit)

8 Kaki Bukit Ave 4, #04-20 Premier

Singapore 415875

Estimated Period of Repair: 3.0 days

Adjuster: XING GUO QIANG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 29 Apr 2021)	
Parts:	N/A	YAMAHA 135LC 135cc ES (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for JRE4592)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT HANDLE BAR	Bent	158.00 FL	*135.00 FL
2	1		*FRONT HANDLE GRIP WITH BALANCER	N/S Serviceable / O/S Cut	125.00 FL	*30.00 FL
3	1		*FRONT RIGHT BRAKE LEVER	Bent	65.00 FL	*65.00 FL
4	1		*FRONT SIDELAMP	N/S Cut / O/S Serviceable	195.00 FL	*65.00 FL
5	1		*FRONT HEADLAMP	Cracked	265.00 FL	*265.00 FL
6	1		*FRONT HEADLAMP TOP COWLING	Cracked	255.00 FL	*180.00 FL
7	1		*FRONT CENTRE COWLING	Warped / Bent	385.00 FL	*145.00 FL
8	1		*FRONT FENDER	Warped / Bent	105.00 FL	*105.00 FL
9	1		*FRONT LEFT FAIRING COMPLETE ASSY	Cut / Grazed	450.00 FL	*155.00 FL
10	1		*FRONT RIGHT FAIRING COMPLETE ASSY	Cracked / Grazed	450.00 FL	*155.00 FL
11	1		*FRONT LEFT WING MIRROR	Bent / Necessary	65.00 FL	*65.00 FL
12	1		*FRONT RIGHT WING MIRROR	Missing	65.00 FL	*65.00 FL
13	2		*FRONT FORK STEM	Necessary	65.00 FL	*65.00 FL
14	2		*FRONT FORK BEARING	Necessary	125.00 FL	*125.00 FL
15	1		*SET FRONT FORK ASSY	Repair	695.00 FL	*- FL
16	1		*FRONT STORAGE BOX	Serviceable	80.00 FL	*- FL
17	1		*FRONT CENTRE GARNISH	Serviceable	125.00 FL	*- FL
18	1		*FRONT FOOT REST	N/S Cut / O/S Serviceable	115.00 FL	*57.50 FL
19	1		*FRONT BRAKE PEDAL	Serviceable	65.00 FL	*- FL
20	1		*FRONT WHEEL RIM	Serviceable	350.00 FL	*- FL
21	1		*REAR LEFT SIDE COWLING	Grazed	195.00 FL	*195.00 FL
22	1		*REAR RIGHT SIDE COWLING	Grazed	195.00 FL	*195.00 FL
23	1		*FRONT GEAR SELECTOR	Bent	65.00 FL	*65.00 FL
24	1		*REAR EXHAUST PIPE COVER	Bent	125.00 FL	*125.00 FL
25	1		*FRONT NO PLATE	Necessary	25.00 FS	*15.00 FS
26	1		*FRONT FORK OIL	Necessary	40.00 FS	*30.00 FS
27	1		*FRONT ERP UNIT	Serviceable	156.00 FS	*- FS
28	1		*FRONT ERP BRACKET	Serviceable	25.00 FS	*- FS
29	1		*REAR BOX ASSY	Bent	180.00 FS	*150.00 FS
30	1		*REAR BOX BRACKET	Serviceable	150.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	5,359.00	2,452.50
- List Item Discount on L Items 10.00/10.00% (S\$)	478.30	225.75
Total Parts (S\$)	4,880.70	2,226.75

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO REPLACE ACCIDENT AFFECTED AREA	New	400.00	200.00
2	TO TRANSPORT BIKE TO WORKSHOP	New	80.00	50.00
3	TO PUTTY AND SPRAY PAINT AFFECTED AREA	New	400.00	0.00
4	TO CONDUCT CHASSIS ALIGNMENT	New	140.00	0.00
5	TO CHECK WHEEL ALIGNMENT	New	60.00	0.00
6	TO BALANCE FRONT WHEEL	New	30.00	0.00
7	TO FOCUS FRONT LIGHTING	New	30.00	0.00
8	TO REMOVE AND INSTALL REAR BOX ASSY	New	50.00	0.00
Gross Labour Cost (\$)			1,190.00	250.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >