

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Tel: 6315 1239, Fax: 6315 3298, Mobile: 9061 0543

Nur Syafiqah Binte Dewanani  
Blk 61 Geylang Bahru  
#06-3253  
Singapore 330061

Invoice no:	POS095/20
Date:	4 July 2020
Report no:	95M0320.AHM
Vehicle :	FBN9418Y

## INVOICE

No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			690.00
SGD(\$): Six Hundred and Ninety only			Payable Amount:	690.00

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



.....  
Authorised Signature

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Fax: 6315 3298, Mobile: 9061 0543

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 95M0320.AHM  
Vehicle no : FBN9418Y

### **1 REFERENCE**

Date of inspection : 6 March 2020  
Requested by : Nur Syafiqah Binte Dewan  
Blk 61 Geylang Bahru  
#06-3253  
Singapore 330061  
Type of survey : Independent  
Repairer : Ah Hwa Motor Servicing  
Blk 1016 Yishun Industrial Park A, #01-360, Singapore 762429  
Date of accident : 14 February 2020

### **2 VEHICLE DATA**

Make/model : **YAMAHA YZF-R155**  
Chassis no : MH3RG4710KK093765  
Engine no : G3J6E0176091  
Date of registration : 04 January 2019  
Engine capacity : 155 cc  
Colour : Luminous pink

### **3 STATIC CONDITION CHECK**

Steering : Affected  
Foot brakes : Serviceable  
Hand brakes : Affected  
Paintwork : Good  
General Condition : Fair

### **4 TIRE CONDITION CHECK**

	<u>mm/MAKE</u>	<u>SIZE</u>
Front tread	: 5 mm/IRC	100/80-17
Rear tread	: 5 mm/IRC	140/70-17

### **5 BRIEF DESCRIPTION OF DAMAGE**

Front headlamp broken, RH handlebar bent, side mirror abraded, pillion seat torn, front forks bent, steering stem bent, cowl head cut, chassis frame bent, etc. Please see para. 8 of this report for more details.

### **6 REMARKS**

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### **7 RECOMMENDATION**

Cost of repairs : **\$5,000.00** (lump sum)  
Estimated no of days : **Seven (7)**

**8 ASSESSMENT OF DAMAGE AND COSTS**Report no: 95M0320.AHMVehicle no: FBN9418Y**A SPARE PARTS**

<u>Description</u>	<u>Qty</u>	<u>Assessed Condition</u>	<u>Repairer's Amount</u>	<u>Revised Amount</u>
Front headlamp	1	casing broken	580.00	580.00
Lamp stay	1	bent/distorted	80.00	80.00
Cowl head	1	cut	168.00	168.00
Left handlebar	1	serviceable	55.00	0.00
Right handlebar	1	bent	55.00	55.00
Fork clamp	1	bent/thred rounded	185.00	185.00
Fork set, left/right	2	bent	1,300.00	1,300.00
Front rim	1	dented/bent/scraped	360.00	360.00
Rim shaft	1	bent	20.00	20.00
Front brake master pump	1	serviceable	250.00	0.00
Brake lever	1	tip scraped/bent	28.00	28.00
Clutch lever	1	serviceable	25.00	0.00
Front disc rotor	1	bent	85.00	85.00
Radiator	1	bent/squashed	380.00	380.00
Side mirror set	1	abraded	96.00	96.00
Side exhaust side guard	1	scraped	136.00	136.00
Rear exhaust end cap	1	scraped	35.00	35.00
Right side footrest	1	bent	28.00	28.00
Right side footrest bracket	1	bent	68.00	68.00
Brake pedal	1	abraded/bent	38.00	38.00
Pillion seat	1	torn	78.00	78.00
Fuel tank top cover	1	scratched	48.00	48.00
Right side fairing	1	dented/scraped	68.00	68.00
Left side fairing	1	dented	68.00	68.00
Right side lower fairing	1	scraped/bent	48.00	48.00
Left side lower fairing	1	to reuse	48.00	0.00
Left side rear fairing	1	abraded	55.00	55.00
Right side rear fairing	1	cut	55.00	55.00
Left side tail top cover	1	abraded	28.00	28.00
Front fender	1	broken	65.00	65.00
Steering stem	1	bent	195.00	195.00
Steering cone bearing set	1	necessary	150.00	150.00
Handlebar balancer	1	abraded	16.00	16.00
		Subtotal of the above	4,894.00	4,516.00
		Discount	10% / 10%	489.40
		Subtotal 1:	4,404.60	4,064.40
(Special nett)				
Rim bearing	1		60.00	60.00
Full body decal set	1	necessary	950.00	950.00
Battery	1		58.00	58.00
Radiator coolant	1	necessary	20.00	20.00
		Subtotal 2:	1,088.00	1,088.00
		Total cost of parts:	5,492.60	5,152.40

Report no: 95M0320.AHM  
Vehicle no: FBN9418Y

**B LABOUR**

Towing (2 ways).	70.00	70.00
Body frame pressing and alignment – chassis frame behind head post bent.	480.00	480.00
Workmanship.	580.00	500.00
Total cost of labour:	1,130.00	1,050.00
Total cost of repair:	6,622.60	6,202.40

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is \$6,202.40

(a) However, the recommended cost of repair based on lump sum basis would be \$5,000.00


(b) The number of days taken to complete the repairs are Seven (7)  
(1<sup>st</sup> re-inspection conducted on 13 March 2020)  
(Post Repair Inspection conducted on 18 May 2020)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

Note: Lump Sum Repair Basis

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Yours faithfully

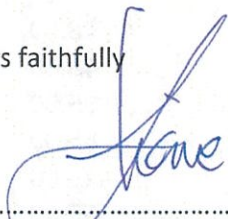

Liaw Leong San  
Licensed Automotive Appraiser

Dated: 4 July 2020






Report no: 95M0320.AHM  
Vehicle no: FBN9418Y









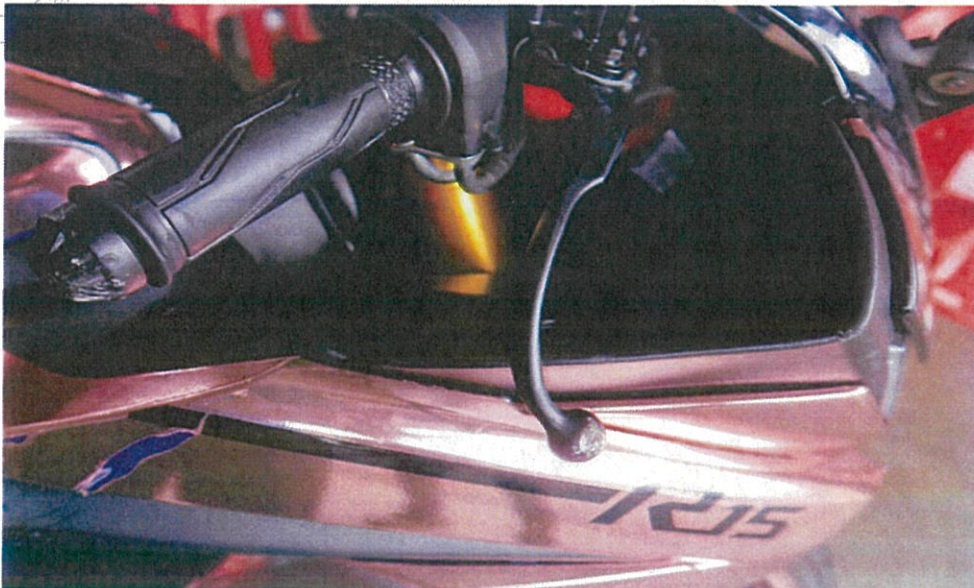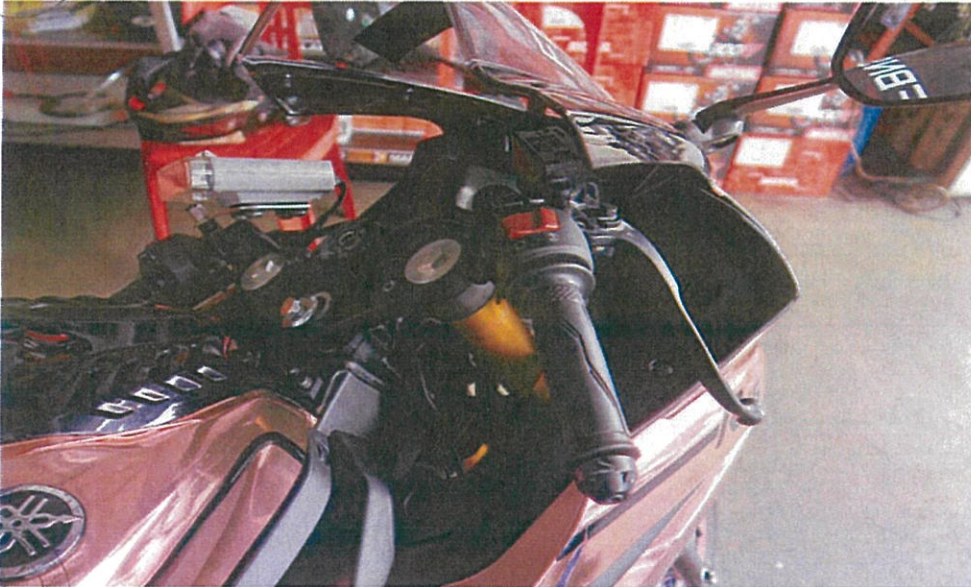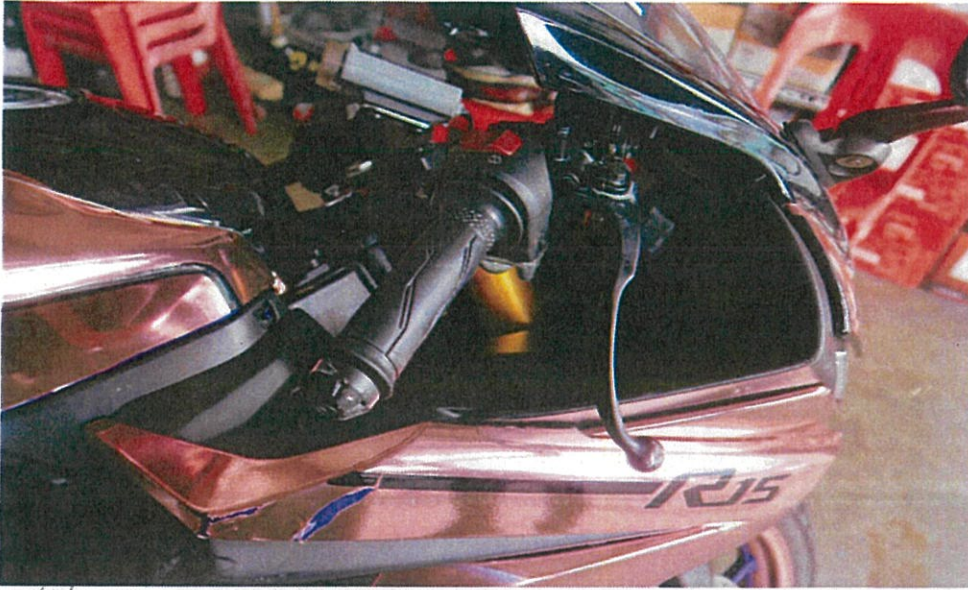



Report no: 95M0320.AHM  
Vehicle no: FBN9418Y








Report no: 95M0320.AHM  
Vehicle no: FBN9418Y






Report no: 95M0320.AHM  
Vehicle no: FBN9418Y

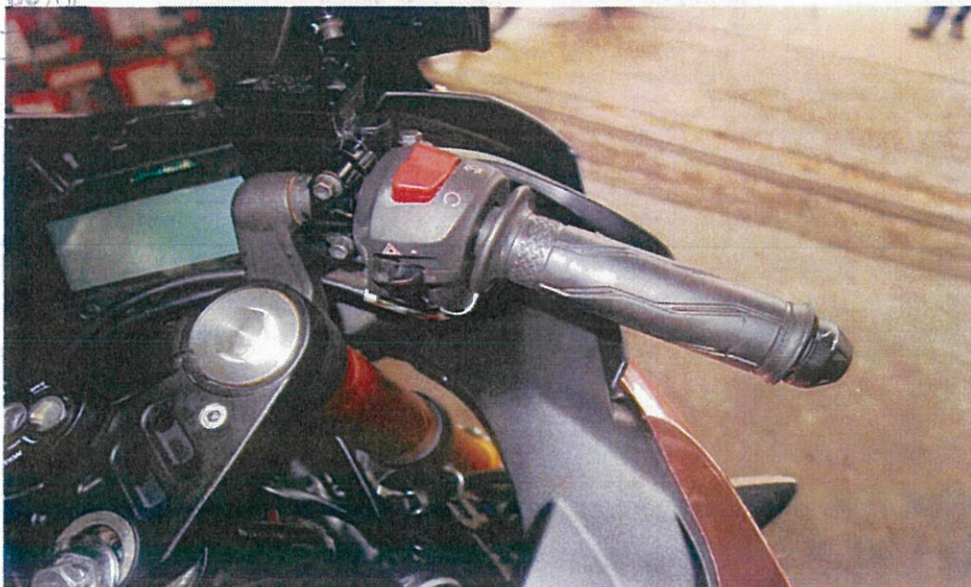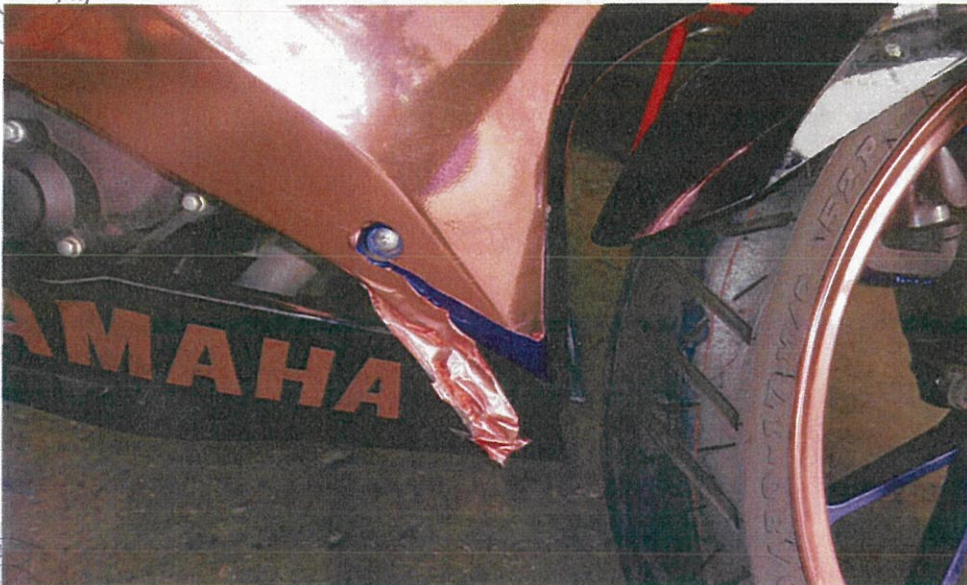
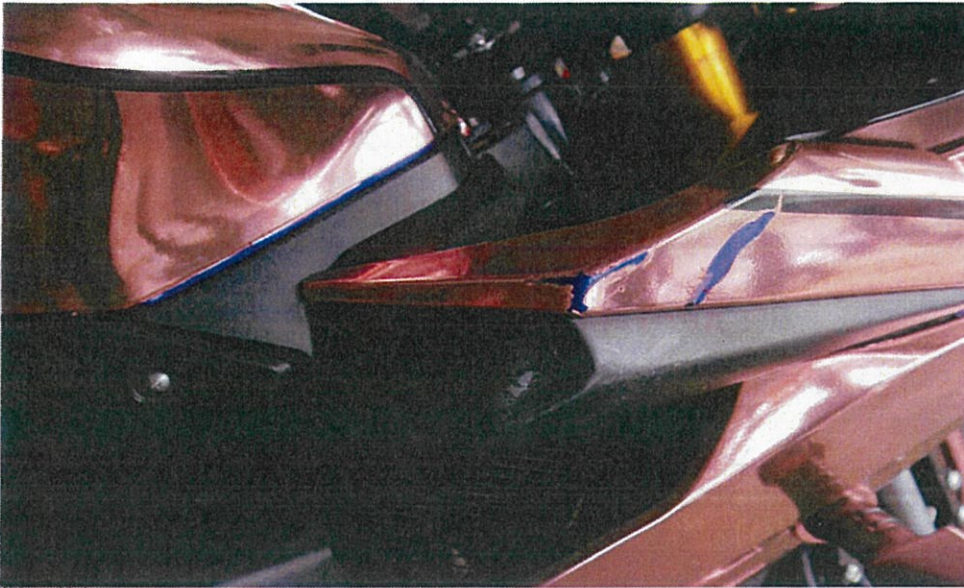







Report no: 95M0320.AHM  
Vehicle no: FBN9418Y

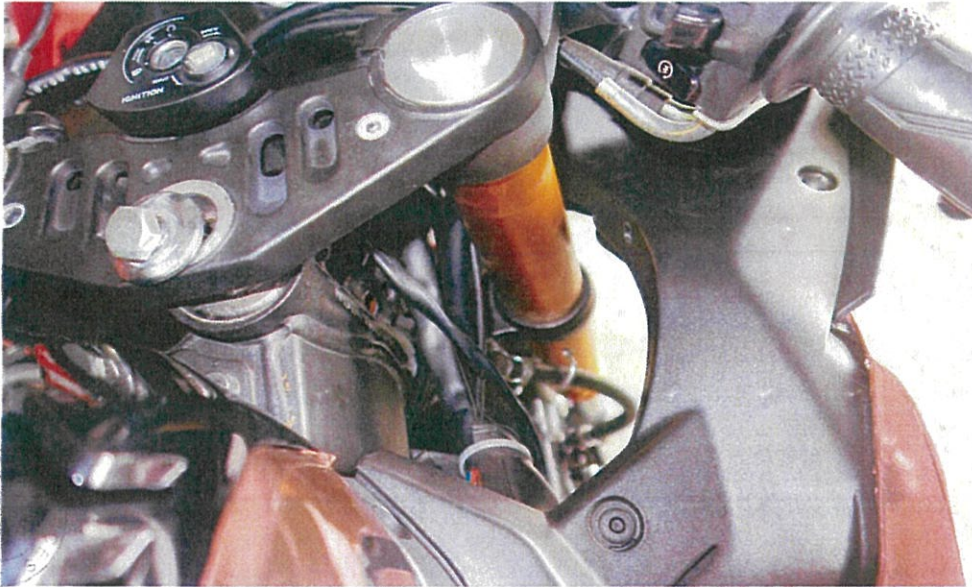



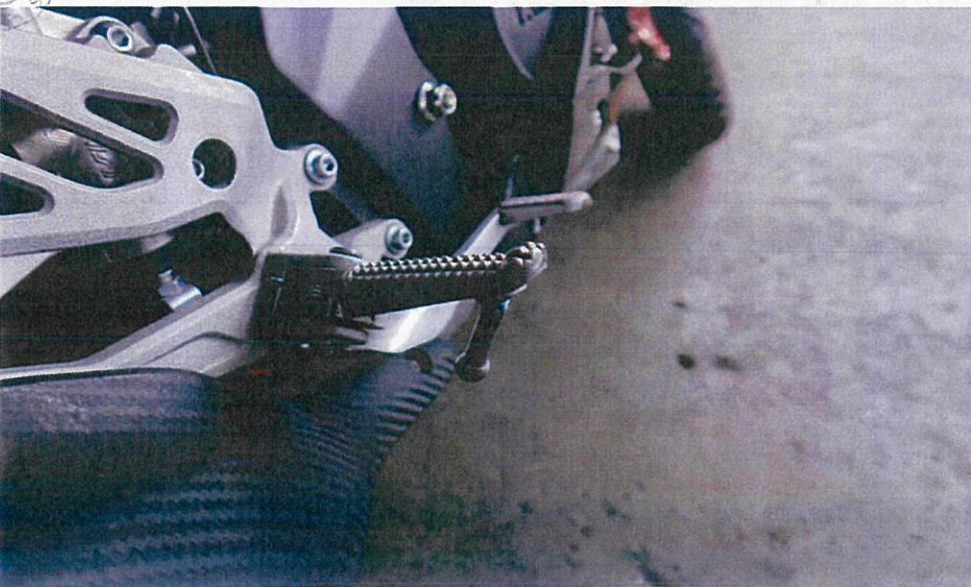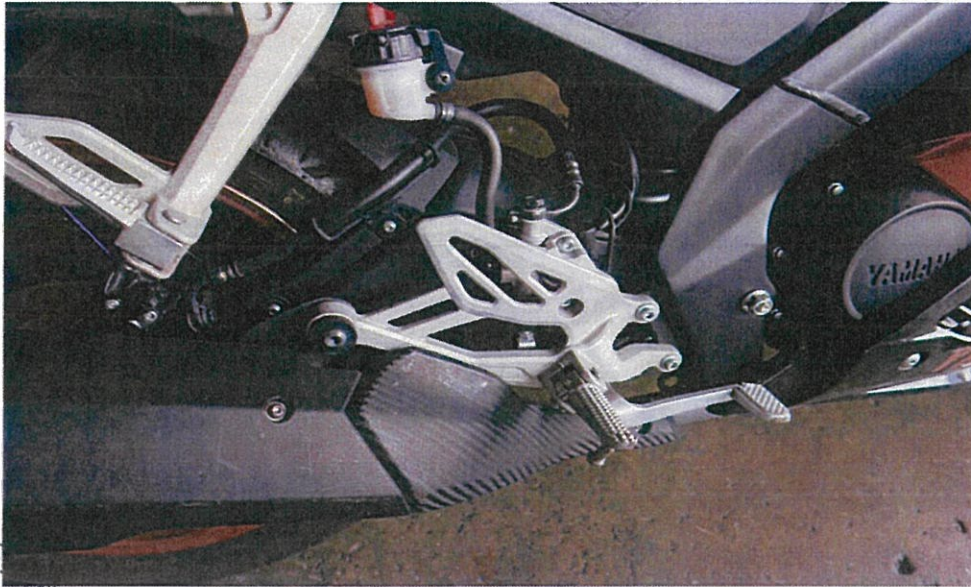




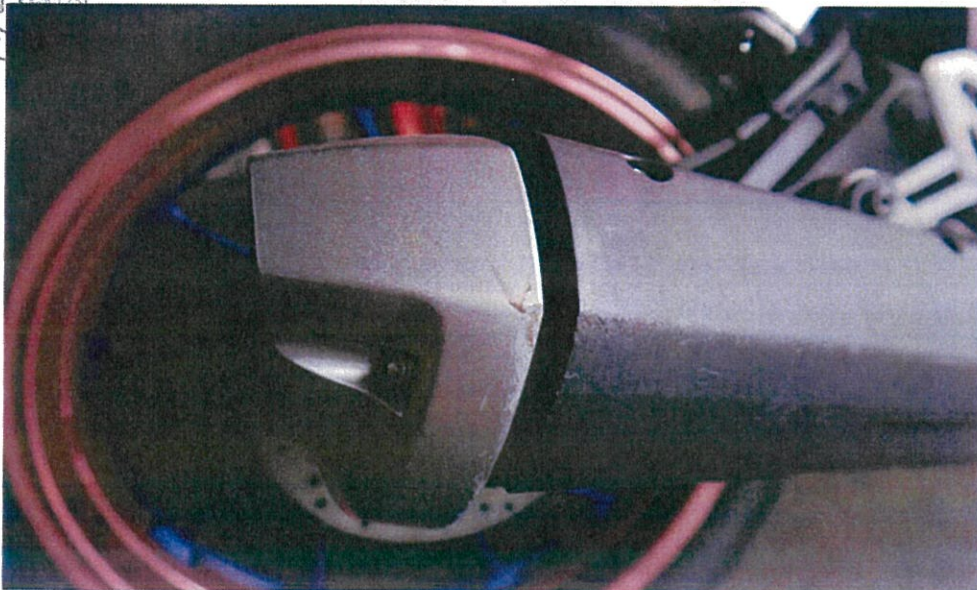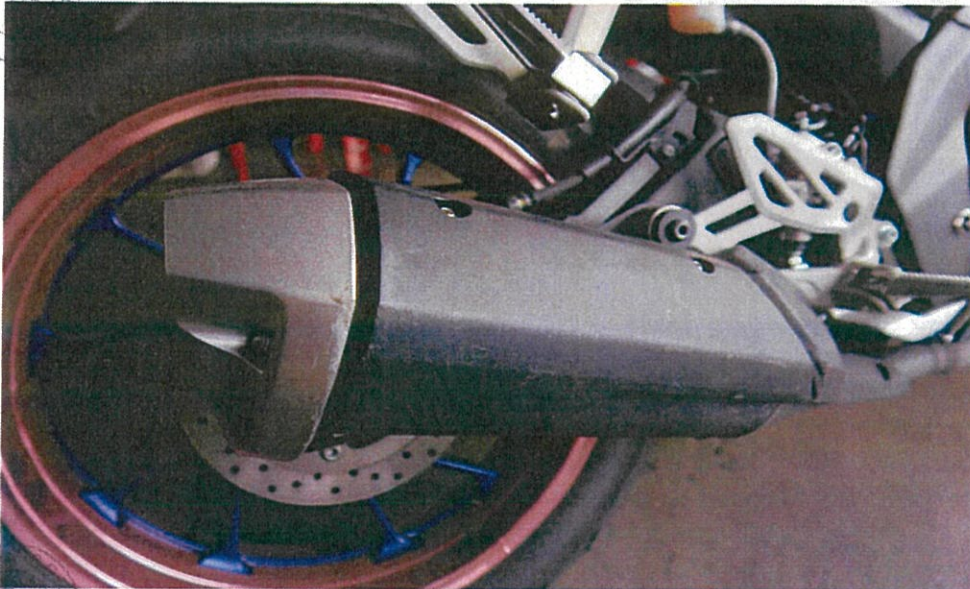
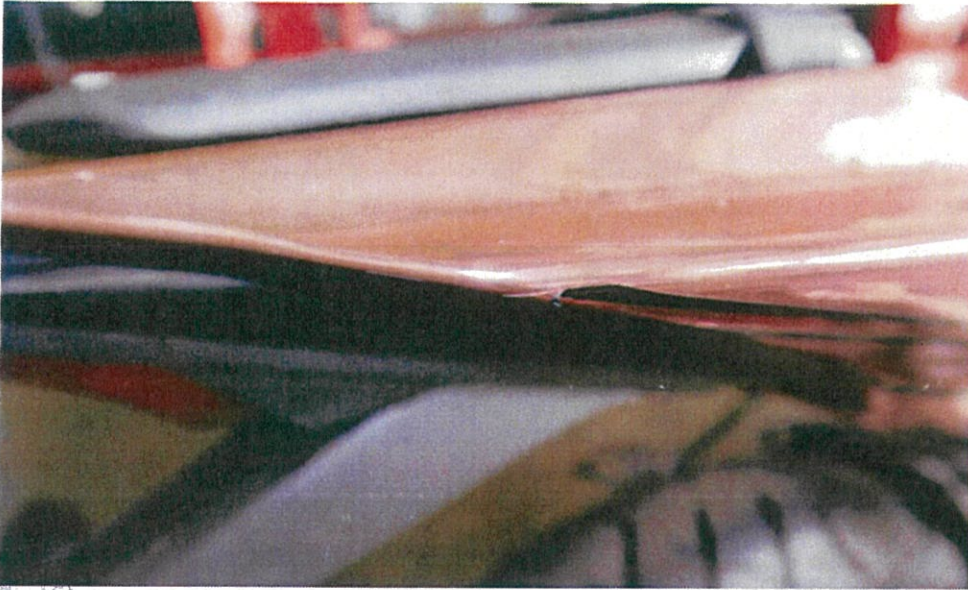





Report no: 95M0320.AHM  
Vehicle no: FBN9418Y

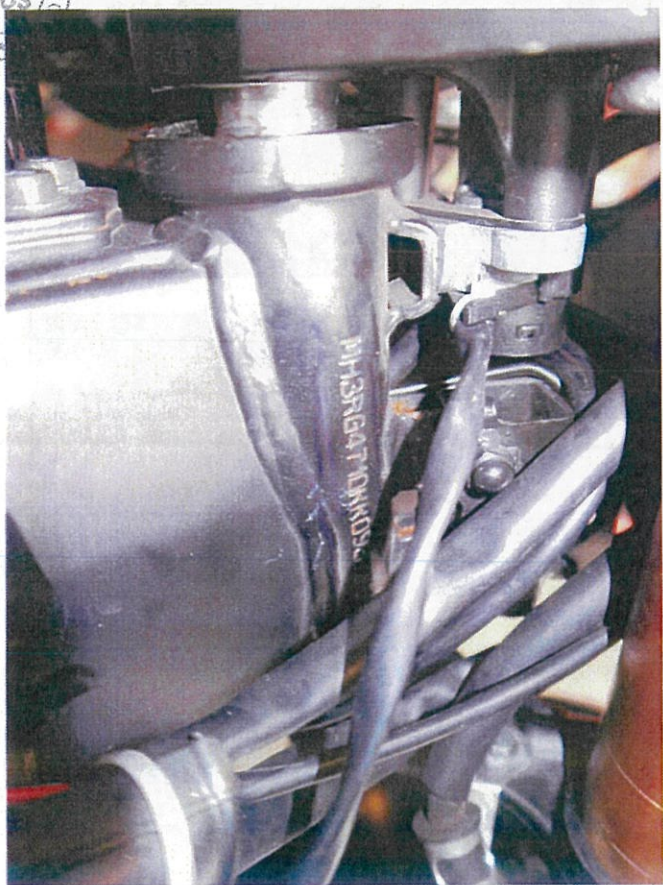




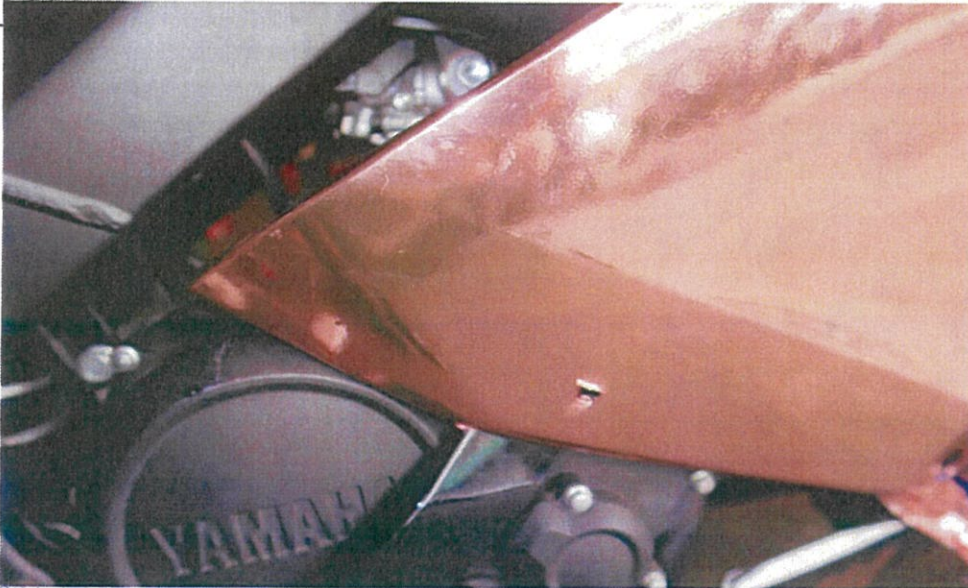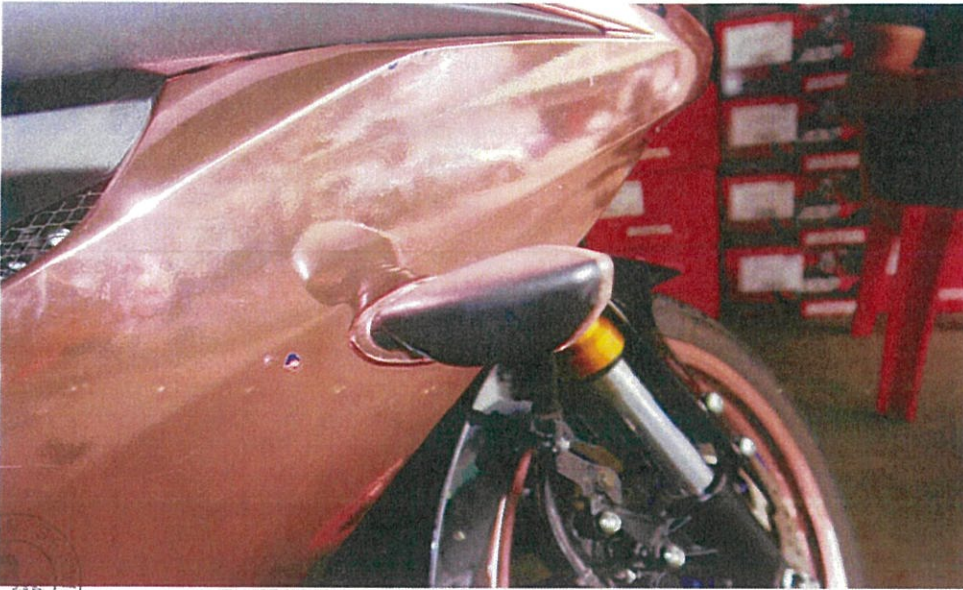



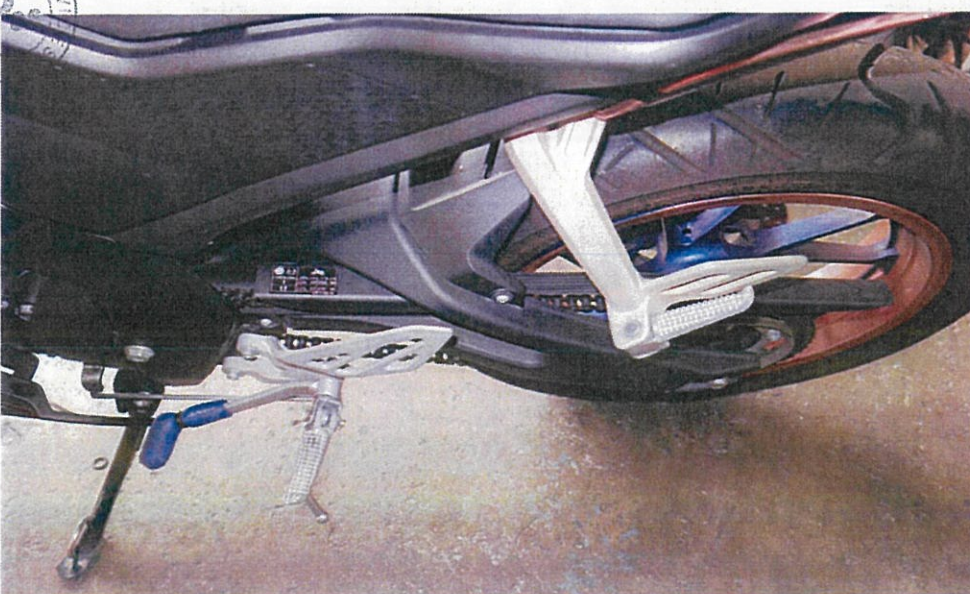



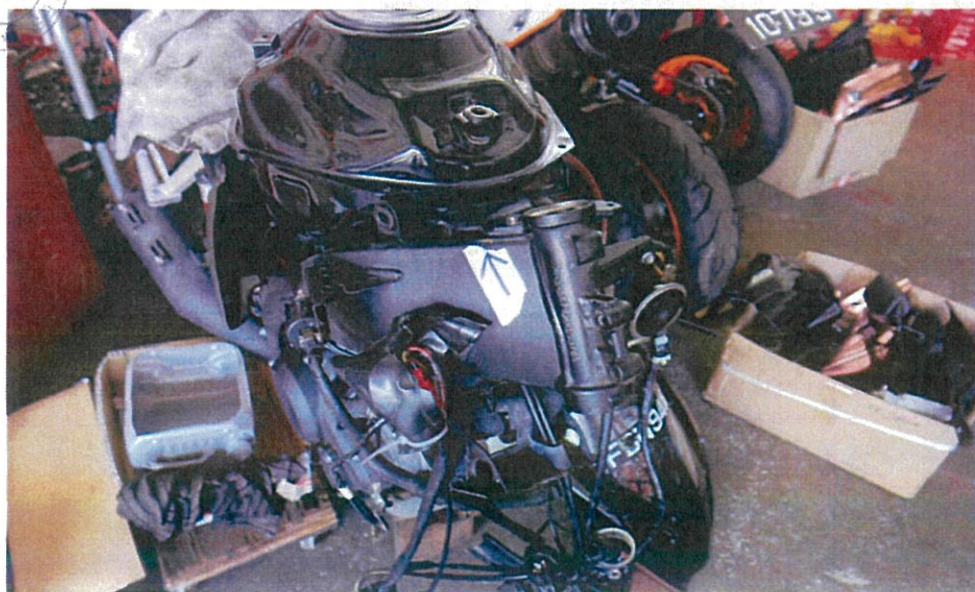



Report no: 95M0320.AHM

Vehicle no: FBN9418Y

