

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21003167/QGS3Q2
Date: 17/12/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900083552
Claimant Vehicle No :	SMA7354Z	Insured Vehicle No :	SMK4403H
Date of Loss:	06/03/2021	Nature of Claim:	TP
		Claim No:	9009614403SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMA7354Z	Engine No:	L15B5462544
Make & Model:	HONDA SHUTTLE, 1.5 (A)	Chassis No:	GK81202187
Reg. Date:	19/06/2018 (Man. Year: 2018)	Odometer:	49402 km
Colour:	Blue		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	205/50 R16	Rear Tyre Size:	205/50 R16
Front Left Side:	Falken 6 mm	Rear Left Side:	Falken 6 mm
Front Right Side:	Falken 6 mm	Rear Right Side:	Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,193.44	8,644.28	7,549.16	46.62
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,630.00	2,170.00	2,460.00	53.13
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	20,823.44	10,814.28	10,009.16	48.07
Approved Total (Overridden) (S\$)		8,650.00		

	(S\$)	20,823.44	8,650.00	12,173.44	58.46
	+ GST 7.00/7.00% (S\$)	1,457.64	605.50	852.14	58.46
	Nett Amount (S\$)	22,281.08	9,255.50	13,025.58	58.46
	+ Car Rental (8.0 x S\$100.00/day) (S\$)		800.00		
	+ Doc/Search Fee (S\$)		36.45		
	Nett Liability (S\$)		10,091.95		
	Global Sum Settlement (S\$)		10,000.00		

INSPECTION

Date of Assignment: 10/03/2021

Date Inspected: 10/03/2021

Estimated Period of Repair: 6.0 days

Inspected At:

My Car Consultant Pte Ltd (Jalan Lam Huat) (HQ)
60 Jalan Lam Huat, Carros Centre #05-21
Singapore 737869

Adjuster: OI SUN PIN**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Dented	1,493.00 FL	*1,093.00 FL
2	1		*TAILGATE INNER TRIM BOARD	Cracked	498.00 FL	*498.00 FL
3	1		*TAILGATE LOCK	Jammed	298.10 FL	*196.20 FL
4	1		*TAILGATE LOWER LOCK CATCH	Serviceable	38.00 FL	*- FL
5	2		*TAILGATE HINGES	Serviceable	130.00 FL	*- FL
6	2		*TAILGATE DAMPER	Serviceable	396.00 FL	*- FL
7	1		*TAILGATE OUTER CHROME MOULDING	Cracked	483.10 FL	*483.10 FL
8	1		*TAILGATE OUTER HANDLE C/W SENSOR	Serviceable	258.00 FL	*- FL
9	1		*TAILGATE EMBLEM HYBRID	Serviceable	65.00 FL	*- FL
10	1		*TAILGATE EMBLEM SHUTTLE	Necessary	68.00 FL	*68.00 FL
11	1		*TAILGATE LOCK SENSOR	Serviceable	175.50 FL	*- FL
12	1		*TAILGATE WEATHERSTRIP	Crumpled	180.30 FL	*180.30 FL
13	1		*TAILGATE EMBLEM LOGO	Necessary	68.00 FL	*68.00 FL
14	1		*TAILGATE INNER TRIM BOARD	Repeated	398.00 FL	*- FL
15	2		*TAILGATE LAMP	Cracked	642.00 FL	*642.00 FL
16	1		*TAILGATE WIPER MOTOR	Serviceable	698.00 FL	*- FL
17	1		*SET TAILGATE WINDSCREEN MOULDING	Necessary	198.00 FL	*198.00 FL
18	1		*TAILGATE DETECTOR	Serviceable	311.20 FL	*- FL
19	1		*REAR KEYLESS SENSOR	Serviceable	190.30 FL	*- FL
20	2		*TAILAMP	Serviceable	1,224.00 FL	*- FL
21	1		*REAR BUMPER	Crumpled	1,159.00 FL	*958.00 FL
22	1		*REAR BUMPER LOWER	Serviceable	698.00 FL	*- FL
23	2		*REAR BUMPER SPONGE	Crumpled	193.00 FL	*193.00 FL
24	2		*REAR BUMPER SIDE RETAINER	Serviceable	92.00 FL	*- FL
25	2		*REAR BUMPER REFLECTOR	Serviceable	150.00 FL	*- FL
26	2		*REAR BUMPER REFLECTOR COVER	Serviceable	164.00 FL	*- FL
27	1		*REAR BUMPER REFLECTOR INNER SPONGE LH	Serviceable	86.50 FL	*- FL
28	1		*REAR BUMPER REFLECTOR INNER SPONGE RH	Serviceable	86.50 FL	*- FL
29	1		*REAR BOOT TOOLS GARNISH BOX	Crumpled	358.60 FL	*358.60 FL
30	1		*REAR FENDER COWLING	N/S Cut	318.00 FL	*159.00 FL
31	2		*REAR FENDER INNER TRIM BOARD (BOTTOM)	Crumpled	1,788.00 FL	*1,578.00 FL
32	2		*REAR FENDER INNER TRIM BOARD (TOP)	Serviceable	1,024.00 FL	*- FL
33	1		*REAR FLOOR PANEL	Crumpled	1,025.00 FL	*1,025.00 FL
34	1		*REAR FLOOR PANEL TOP TRAY	Crumpled	494.10 FL	*420.00 FL
35	1		*REAR FLOOR PANEL TOP BOARD	Crumpled	398.00 FL	*398.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	2		*REAR FLOOR PANEL SIDE BOARD	Serviceable	224.00 FL	*- FL
37	1		*REAR END PANEL	Dented	760.80 FL	*760.80 FL
38	1		*REAR END PANEL TOP GARNISH	Crumpled	321.00 FL	*185.90 FL
39	1		*REAR CHASSIS EXTENSION RH	Serviceable	251.30 FL	*- FL
40	1		*REAR EXHAUST PIPE	Bent	1,125.00 FL	*693.70 FL
41	1		*REAR REVERSE SENSOR	Shorted	250.00 FS	*200.00 FS
42	1		*REVERSE CAMERA	Serviceable	350.00 FS	*- FS
43	1		*REAR BUMPER CLIP	Necessary	80.00 FS	*30.00 FS
44	1		*SET TAILGATE INNER TRIM CLIPS	Necessary	50.00 FS	*20.00 FS
45	1		*SET REAR FENDER INNER TRIM CLIPS	Necessary	50.00 FS	*20.00 FS
46	1		*SET REAR FENDER COWLING CLIPS	Serviceable	30.00 FS	*- FS
47	1		*REAR END PANEL GARNISH CLIP	Necessary	30.00 FS	*20.00 FS
48	1		*REAR WINDSCREEN INNER SEAL	Necessary	80.00 FS	*30.00 FS
49	1		*REAR WINDSCREEN GLASS SEALANT	Necessary	100.00 FS	*30.00 FS
50	1		*REAR FLOOR PANEL SEALANT	Necessary	150.00 FS	*40.00 FS
51	1		*REAR EXHAUST CHROME	Scratched	150.00 FS	*89.00 FS
52	1		*END PANEL SEALANT	Necessary	50.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	19,899.30	10,675.60
- List Item Discount on L Items 20.00/20.00% (S\$)	3,705.86	2,031.32
Total Parts (S\$)	16,193.44	8,644.28

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK ELECTRICAL WIRING	New	80.00	30.00
2	TO REMOVE AND REFIT REVERSE SENSOR	New	150.00	30.00
3	TO REMOVE AND REFIT REVERSE CAMERA	New	100.00	0.00
4	REMOVE AND REFIT UPHOLSTERY SEAT TO FACILITATE	New	300.00	50.00
5	TO RESPRAY UNDERCOATING	New	150.00	40.00
6	REMOVE AND REFIX REAR WINDSCREEN GLASS	New	150.00	120.00
7	REMOVE AND TRANSFER ALL REAR TAILGATE FITTING	New	150.00	60.00
8	CHECK AND TEST WATER LEAKING	New	150.00	0.00
9	APPLY ANTI RUST ON AFFECTED AREAS	New	200.00	40.00
10	SPRAY PAINTING ON AFFECTED AREAS	New	1,600.00	800.00
11	PANEL BEATING ON AFFECTED AREAS	New	1,600.00	1,000.00
			Gross Labour Cost (S\$)	4,630.00
				2,170.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >