

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/CTI21003175/GVF3E2

**Date:** 23/03/2021

### REFERENCE

Handling Insurer: China Taiping Insurance  
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00100042001

**Claimant Vehicle  
No :** GY5288P

**Insured Vehicle  
No :** YN9822R

Date of Loss: 06/03/2021

Nature of Claim: TP

Claim  
No: SNM21D201298/C02/TANKL

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **GY5288P**

Make & Model: TOYOTA DYNA 1.5T, 3.0 (A)

Engine No: 5L5584762

Reg. Date: 10/05/2005 (Man. Year: 2005)

Chassis No: JTFUF34Y903010484

Colour: Silver

Odometer: 575096 km

Engine Capacity: 2986 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 185 R14

Rear Tyre Size: 155 R12

Front Left Side: Dunlop 6 mm

Rear Left Side: Dunlop 6 mm

Front Right Side: Dunlop 6 mm

Rear Right Side: Dunlop 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 10/03/2021

Date Inspected: 11/03/2021 Inspected At:

Mje Motor (HQ)  
BLK 7 SIN MING IND EST SEC C  
#01-94 SINGAPORE 575642

Estimated Period of Repair: 4.0 days

**Adjuster:** XING GUO QIANG

**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000.00 -\$4,000.00

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	(Last Synchronised: 23 Mar 2021)	
<b>Parts:</b>	N/A	TOYOTA DYNA 1.5T 3.0 (A) (Model not available in database)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for GY5288P)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**