

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG21003184/GQD3E2

Date: 19/05/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : FBQ4175P

Insured Vehicle No : EU1428Z

Date of Loss: 25/02/2021

Nature of Claim: TP

Claim No: 6525255254SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBQ4175P**

Make & Model: YAMAHA GDR155A (AEROX), 155cc

Engine No: G3J8E0097594

Reg. Date: 26/09/2019 (Man. Year: 2019)

Chassis No: MH3SG4640KJ053020

Colour: Red

Odometer: 28576 km

Engine Capacity: 155 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 110/80-14

Rear Tyre Size: 140/70-14

Front Left Side: Pirelli 5 mm

Rear Left Side: Pirelli 5 mm

Front Right Side: 0 mm

Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 10/03/2021

Date Inspected: 11/03/2021 Inspected At:

HI Cycle Pte Ltd (HQ)

AUTOBAY @ KAKI BUKIT, 1 KAKI BUKIT AVE 6

#02-58

Singapore 417883

Estimated Period of Repair: 5.0 days

Adjuster: XING GUO QIANG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE: \$9,000.00

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT TYRE (70%)	* Check	0.00 F	*- F
2	1		*FRONT RIM	Cut	0.00 F	*- F
3	1		*FRONT TYRE RIM SPOKE	* Check	0.00 F	*- F
4	1		*FRONT FENDER WHEEL GUARD	* Check	0.00 F	*- F
5	1		*FRONT FORK ASSY	Bent	0.00 F	*- F
6	1		*FRONT HEADLAMP	Cracked	0.00 F	*- F
7	1		*FRONT HEADLAMP FAIRING	Cracked	0.00 F	*- F
8	1		*FRONT WING MIRROR LH	Missing	0.00 F	*- F
9	1		*FRONT LH SIGNAL LAMP	Cut	0.00 F	*- F
10	1		*HANDLE BAR	Bent	0.00 F	*- F
11	1		*HANDLE BAR GRIP	Necessary	0.00 F	*- F
12	1		*HANDLE BAR BALANCER RH	Cut	0.00 F	*- F
13	1		*HAND BRAKE LEVER LH	Cut	0.00 F	*- F
14	1		*SIDE FAIRING LH	Cracked	0.00 F	*- F
15	1		*SIDE FAIRING TOP GARNISH LH	Cracked	0.00 F	*- F
16	1		*SIDE FAIRING INNER GARNISH LH	Cracked	0.00 F	*- F
17	1		*REAR FAIRING LH	Cut	0.00 F	*- F
18	1		*LH STEP BOARD	Distorted	0.00 F	*- F
19	1		*LH STEP BOARD GARNISH	Bent	0.00 F	*- F
20	1		*AIR DUCT GARNISH	Cut	0.00 F	*- F
21	1		*FRONT BOX	* Check	0.00 F	*- F
22	1		*SEAT ASSY	Cut	0.00 F	*- F
23	1		*SIDE STAND	Cut	0.00 F	*- F
24	1		*REAR FOOT REST LH	Cut	0.00 F	*- F
25	1		*REAR WHEEL SIDE COVER	Cut	0.00 F	*- F
26	1		*REAR BOX	Cut	0.00 F	*- F
27	1		*REAR BOX BRACKET	* Check	0.00 F	*- F
28	1		*STICKER	Necessary	0.00 F	*- F
29	1		*REAR LH BOARD	Distorted	0.00 F	*- F
30	1		*REAR LH SIDE FAIRING	Cracked	0.00 F	*- F
31	1		*REAR LH SIDE FAIRING GARNISH	Cracked	0.00 F	*- F
32	1		*REAR LH BOARD EMBLEM	Cracked	0.00 F	*- F
33	1		*REAR LH FOOT REST GARNISH	Cut	0.00 F	*- F
34	1		*AUTO TRANSMISSION COVER	Cut	0.00 F	*- F

F=Franchise part.

Total Parts (S\$)0.000.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >