

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG21003302/ARS3Q2
Date: 10/06/2021

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900255430
Claimant Vehicle No :	GU47Y	Insured Vehicle No :	SLG4550Z
Date of Loss:	09/03/2021	Nature of Claim:	TP
		Claim No:	7751727268SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GU47Y	Engine No:	K9KC400D054608
Make & Model:	NISSAN NV200, 1.5 D MT ABS AIRBAG 2WD 6DR (A)	Chassis No:	VSKYBAM20Z0101339
Reg. Date:	26/11/2015 (Man. Year: 2015)	Odometer:	143260 km
Colour:	Silver		
Engine Capacity:	1461 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	175/70 R14	Rear Tyre Size:	175/70 R14
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,287.48	4,797.55	11,489.93	70.54
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,250.00	2,620.00	2,630.00	50.10
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	21,537.48	7,417.55	14,119.93	65.56
Approved Total (Overridden) (S\$)		5,900.00		

(S\$)	21,537.48	5,900.00	15,637.48	72.61
+ GST 7.00/7.00% (S\$)	1,507.62	413.00	1,094.62	72.61
Nett Amount (S\$)	23,045.10	6,313.00	16,732.10	72.61
+ Loss of Use (7.0 x S\$60.00/day) (S\$)		420.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		6,735.00		

INSPECTION

Date of Assignment: 10/03/2021

Date Inspected: 10/03/2021

Inspected At:

Cn Motors Pte Ltd (HQ)
 1 KAKI BUKIT AVENUE 6 BLK C #01-41 AUTOBAY @ KAKI BUKIT
 Singapore 417883

Estimated Period of Repair: 6.0 days

Adjuster: ADRIAN LING**Manager:** Jaslin Kok Chin Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR R/H BOOT LID	Distorted	1,056.00 F	*1,056.00 FL
2	1		*REAR R/H BOOT LID HINGE	Lower Damaged	205.80 F	*102.90 FL
3	1		*REAR R/H BOOT LID DCI LOGO	Necessary	56.20 F	*56.20 FL
4	1		*REAR R/H BOOT LID TOP LOCK	Not Necessary	261.00 F	*- FL
5	1		*REAR R/H BOOT LID LOWER LOCK	Damaged	290.60 F	*290.60 FL
6	1		*REAR R/H BOOT LID INNER RUBBER	Cut	96.40 F	*96.40 FL
7	1		*REAR R/H BOOT LID INNER TRIM BOARD	Not Necessary	152.50 F	*- FL
8	8		*REAR R/H BOOT LID INNER TRIM BOARD CLIP	Not Necessary	52.00 F	*- FL
9	1		*REAR L/H BOOT LID	Dented	1,281.10 F	*1,281.10 FL
10	2		*REAR L/H BOOT LID HINGE	Not Necessary	205.80 F	*- FL
11	1		*REAR L/H BOOT LID EMBLEM LOGO	Necessary	155.10 F	*155.10 FL
12	1		*REAR L/H BOOT LID NV 200 LOGO	Necessary	175.38 F	*175.38 FL
13	1		*REAR L/H BOOT LID CENTRE MOULDING	Not Necessary	336.00 F	*- FL
14	1		*REAR L/H BOOT LID TOP LOCK	Not Necessary	261.00 F	*- FL
15	1		*REAR L/H BOOT LID LOWER LOCK	Damaged	190.60 F	*190.60 FL
16	1		*REAR L/H BOOT LID INNER RUBBER	Not Necessary	96.40 F	*- FL
17	1		*REAR L/H BOOT LID INNER TRIM BOARD	Not Necessary	269.40 F	*- FL
18	10		*REAR L/H BOOT LID INNER TRIM BOARD CLIP	Not Necessary	65.00 F	*- FL
19	1		*REAR TAIL LAMP	O/S Cracked	517.40 F	*258.70 FL
20	4		*REAR TAIL LAMP CLIP	Necessary	32.00 F	*10.00 FL
21	1		*REAR BUMPER	Deformed	624.80 F	*624.80 FL
22	2		*REAR BUMPER SIDE RETAINER	Necessary	70.40 F	*70.40 FL
23	2		*REAR BUMPER SIDE REFLECTOR	Not Necessary	73.00 F	*- FL
24	1		*REAR BUMPER INNER FOAM	Cracked	133.80 F	*133.80 FL
25	1		*REAR BUMPER STICKER	Not Necessary	40.00 F	*- FL
26	1		*REAR END PANEL OUTER	Dented	386.20 F	*386.20 FL
27	1		*REAR END PANEL INNER	Repair	850.80 F	*- FL
28	1		*REAR END PANEL TOP MOULDING	Cracked	99.10 F	*99.10 FL
29	8		*REAR END PANEL TOP MOULDING CLIP	Necessary	52.00 F	*10.00 FL
30	1		*REAR END PANEL RUBBER	Not Necessary	91.30 F	*- FL
31	1		*REAR FLOOR PANEL	Repair	2,848.00 F	*- FL
32	1		*REAR SPARE TYRE BRACKET	Not Necessary	252.00 F	*- FL
33	1		*REAR CENTRE EXHAUST	Not Necessary	2,681.40 F	*- FL
34	1		*REAR R/H BOOT LID WINDSCREEN SEAL	Necessary	50.00 FS	*40.00 FS
35	1		*REAR L/H BOOT LID WINDSCREEN SEAL	Necessary	50.00 FS	*40.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	1		*REAR R/H BOOT LID 5 PAX STICKER	Necessary	20.00 FS	*10.00 FS
37	1		*REAR R/H BOOT LID 70KM/H STICKER	Necessary	20.00 FS	*10.00 FS
38	1		*REAR L/H BOOT LID NUMBER PLATE	Not Necessary	50.00 FS	*- FS
39	1		*REAR BUMPER REVERSE SENSOR	Damaged	350.00 FS	*200.00 FS
40	1		*REAR FLOOR PANEL CARPET	Not Necessary	650.00 FS	*- FS
41	1		*REAR FLOOR PANEL PLYWOOD	Not Necessary	450.00 FS	*- FS
42	1		*REAR EXHAUST	Not Necessary	689.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	16,287.48	5,297.28
- List Item Discount on L Items 0.00/10.00% (\$)	0.00	499.73
Total Parts (\$)	16,287.48	4,797.55

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE & REFIT CUSHION ,CARPET & PLYWOOD	New	380.00	180.00
2	TO REMOVE & REFIT REVERSE SENSOR	New	100.00	50.00
3	TO REMOVE & REFIT REAR & CENTRE EXHAUST	New	380.00	0.00
4	TO REMOVE & REFIT REAR L/H & R/H WINDSCREEN	New	240.00	120.00
5	GUM	New	100.00	80.00
6	TUFF KOTE	New	150.00	60.00
7	TO CHECK WIRING	New	100.00	30.00
8	PANEL BEATING	New	2,000.00	1,100.00
9	SPRAY PAINTING	New	1,800.00	1,000.00
Gross Labour Cost (\$\$)			5,250.00	2,620.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >