

# AUTO SPEC APPRAISER

25 Moonstone Lane #10-02 Singapore 328465  
Tel: 68468023 Fax: 68427801

## Vehicle Inspection Report

|                     |                            |                   |                                 |
|---------------------|----------------------------|-------------------|---------------------------------|
| Our Reference No.   | : SJJ6621Y29032015         | Registration No.  | : ASAK15034/2015                |
| Your Reference No.  | : Not Advised              | Date              | : 08/05/2015                    |
| Claim Type          | : T.P.                     | Date Of Survey    | : 31/03/2015                    |
| Assignment Given By | : Chin Teck Cheong         | Date Of Accident  | : 29/03/2015                    |
| Address             | : 132 Rivervale Street     | Survey Conduct At | : Autoexcel Engineering Pte Ltd |
|                     | : #08-806 Singapore 540132 | Address           | : Blk 19 Sin Ming Ind Estate    |
|                     |                            |                   | : #01-05 Singapore 575677       |

### Particulars of accident vehicle

|                      |              |                   |                 |
|----------------------|--------------|-------------------|-----------------|
| Vehicle Reg. No.     | : SJJ6621Y   | Engine Number     | : 1NZZD148995   |
| Date Of Registration | : 22/09/2008 | Chassis Number    | : NZE1416092176 |
| Make                 | : Toyota     | Transmission Type | : Auto          |
| Model                | : Axio       | Vehicle Colour    | : Metallic Blue |
|                      |              | Mileage Reading   | : 68827         |

### Visual and static test on vehicle during survey

|                      |               |                      |        |
|----------------------|---------------|----------------------|--------|
| Hand brake condition | : Serviceable | Body Condition       | : Good |
| Foot brake condition | : Serviceable | Paint Work condition | : Good |
| Steering condition   | : Serviceable | Remarks              | : None |
| Modification         | : Sport Rim   |                      |        |

### Condition of vehicle tyre

|            | Size        | Make / Right Tread | Make / Left Tread |
|------------|-------------|--------------------|-------------------|
| Front Tyre | : 185/70R14 | Nexen 7MM          | Nexen 7MM         |
| Rear Tyre  | : 185/70R14 | Nexen 7MM          | Nexen 7MM         |


### Description on vehicle's point of impact and damages

Rear and Front portion of the vehicle  
( For more detail of the damages, please refer photographs attached )

### Remarks

### Point Of Impact

In accordance to your instruction, we have **NOT** authorised any repairs.  
Estimated duration of repairs 21 days  
This survey was conducted entirely on a "**WITHOUT PREJUDICE**" basic.

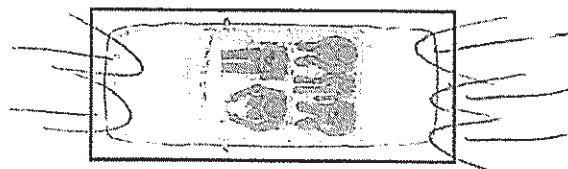

# AUTO SPEC APPRAISER

25 Moonstone Lane #10-02 Singapore 328465

Tel : 68468023 Fax : 68427801

## Annex A: Adjustment on Spare Parts

| S/No | Qty | Vehicle Parts Description    | Condition       | Workshop Estimate<br>Before Discount<br>(S\$) | Recommendation<br>(S\$) |
|------|-----|------------------------------|-----------------|-----------------------------------------------|-------------------------|
| 1    | 1   | Bootlid                      | Dented          | 1,325.00                                      | 1,325.00                |
| 2    | 1   | Bootlid Centre logo          | Necessary       | 61.00                                         | 61.00                   |
| 3    | 1   | Bootlid X emblem             | Necessary       | 55.00                                         | 55.00                   |
| 4    | 1   | Bootlid Axio emblem          | Necessary       | 58.00                                         | 58.00                   |
| 5    | 1   | Bootlid outer handle         | Bent            | 344.80                                        | 344.80                  |
| 6    | 1   | Bootlid lock                 | Dented          | 362.90                                        | 362.90                  |
| 7    | 1   | Bootlid weatherstrip         | Cut             | 199.40                                        | 199.40                  |
| 8    | 2   | Bootlid hinges               | Bent            | 440.00                                        | 440.00                  |
| 9    | 2   | Bootlid No.plate lamp        | Cracked         | 260.00                                        | 260.00                  |
| 10   | 1   | Bootlid insulator            | Cracked         | 390.00                                        | 390.00                  |
| 11   | 1   | Taillamps                    | Cracked         | 1,020.00                                      | 1,020.00                |
| 12   | 1   | Taillamp panels              | Dented          | 264.00                                        | 264.00                  |
| 13   | 1   | Taillamp lower brackets      | Cracked         | 180.00                                        | 180.00                  |
| 14   | 2   | Rear fenders                 | Repair          | 1,200.00                                      | 0.00                    |
| 15   | 2   | Rear fender undershields     | Tear            | 280.00                                        | 280.00                  |
| 16   | 2   | Rear fender inner side trims | Tear            | 1,088.00                                      | 1,088.00                |
| 17   | 2   | Rear fender air ducts        | Cracked         | 180.00                                        | 180.00                  |
| 18   | 1   | Rear bumper                  | Tear            | 1,056.00                                      | 1,056.00                |
| 19   | 10  | Rear bumper clips            | Necessary       | 50.00                                         | 50.00                   |
| 20   | 2   | Rear bumper brackets         | Dented          | 220.00                                        | 220.00                  |
| 21   | 2   | Raer bumper side retainers   | Cracked/Missing | 280.00                                        | 280.00                  |
| 22   | 1   | End panel                    | Bent            | 642.80                                        | 642.80                  |
| 23   | 1   | End panel top garnsih        | Dented          | 254.00                                        | 254.00                  |
| 24   | 1   | End panel top lock latch     | Bent            | 65.00                                         | 65.00                   |
| 25   | 1   | Spare tyre panel             | Dented          | 926.00                                        | 926.00                  |
| 26   | 1   | Spare tyre top board         | Dented          | 288.90                                        | 288.90                  |
| 27   | 1   | Spare tyre screw             | Bent            | 124.00                                        | 124.00                  |
| 28   | 1   | Rear exhaust                 | Cracked         | 908.10                                        | 908.10                  |
| 29   | 1   | Rear exhaust mounting        | Cracked         | 58.00                                         | 58.00                   |

# AUTO SPEC APPRAISER

25 Moonstone Lane #10-02 Singapore 328463

Tel : 68468023 Fax : 68427801

## Annex A: Adjustment on Spare Parts

| S/No                            | Qty | Vehicle Parts Description | Condition   | Workshop Estimate<br>Before Discount<br>(S\$) | Recommendation<br>(S\$) |
|---------------------------------|-----|---------------------------|-------------|-----------------------------------------------|-------------------------|
| 30                              | 1   | Rear exhaust heat shield  | Dented      | 188.50                                        | 188.50                  |
| 31                              | 2   | Rear chassis              | Repair      | 1,000.00                                      | 0.00                    |
| <b>TOTAL :</b>                  |     |                           |             | 13,769.40                                     | 11,569.40               |
| <i>less market discount 10%</i> |     |                           |             | 1,376.94                                      | 1,156.94                |
|                                 |     |                           |             | <b>12,392.46</b>                              | <b>10,412.46</b>        |
| <b>Special Nett Items</b>       |     |                           |             |                                               |                         |
| 1                               | 1   | Rear No.plate with holder | Dented      | 80.00                                         | 80.00                   |
| 2                               | 1   | Reverse camera            | Malfunction | 550.00                                        | 550.00                  |
| 3                               | 1   | Reverse sensor            | Cracked     | 320.00                                        | 320.00                  |
| 4                               | 1   | Spare tyre                | Cut         | 380.00                                        | 380.00                  |
| <b>TOTAL:</b>                   |     |                           |             | <b>1,330.00</b>                               | <b>1,330.00</b>         |
| <b>TOTAL FOR SPARE PARTS :</b>  |     |                           |             | <b>13,722.46</b>                              | <b>11,742.46</b>        |

# AUTO SPEC APPRAISER

25 Moonstone Lane #10-02 Singapore 328465  
Tel : 68468023 Fax : 68427801

## Annex A: Adjustment on Spare Parts

| S/No                           | Qty | Vehicle Parts Description   | Condition          | Workshop Estimate<br>Before Discount<br>(S\$) | Recommendation<br>(S\$) |
|--------------------------------|-----|-----------------------------|--------------------|-----------------------------------------------|-------------------------|
| 1                              | 1   | Front bumper                | Dented             | 1,072.00                                      | 1,072.00                |
| 2                              | 2   | Front bumper side retainers | Dented             | 280.00                                        | 280.00                  |
| 3                              | 1   | Front bumper reinforcement  | Dented             | 458.00                                        | 458.00                  |
| 4                              | 1   | Front bumper sponge         | Cracked            | 198.00                                        | 198.00                  |
| 5                              | 2   | Front bumper brackets       | Dented             | 240.00                                        | 240.00                  |
| 6                              | 1   | Bonnet                      | Bent               | 1,142.00                                      | 1,142.00                |
| 7                              | 1   | Bonnet lock                 | Dented             | 384.50                                        | 384.50                  |
| 8                              | 1   | Front support panel         | Dented             | 902.00                                        | 902.00                  |
| 9                              | 1   | Front brace panel           | Bent               | 95.00                                         | 95.00                   |
| 10                             | 2   | Headlamps                   | Scratches/ Cracked | 1,160.00                                      | 1,160.00                |
| 11                             | 2   | Horns                       | Dented/ Jam        | 220.00                                        | 220.00                  |
| 12                             | 1   | Front grille                | Cracked            | 558.00                                        | 558.00                  |
| 13                             | 1   | Front grille logo           | Necessary          | 61.00                                         | 61.00                   |
| 14                             | 1   | Front air-con condenser     | Serviceable        | 1,213.00                                      | 0.00                    |
|                                |     |                             |                    | <b>TOTAL :</b>                                |                         |
|                                |     |                             |                    | 7,983.50                                      | 6,770.50                |
|                                |     |                             |                    | <i>less market discount 10%</i>               |                         |
|                                |     |                             |                    | 798.35                                        | 677.05                  |
|                                |     |                             |                    | <b>7,185.15</b>                               | <b>6,093.45</b>         |
| <b>Special Nett Items</b>      |     |                             |                    |                                               |                         |
| 1                              | 1   | Front No.plate with holder  | Dented             | 80.00                                         | 80.00                   |
|                                |     |                             |                    | <b>TOTAL:</b>                                 |                         |
|                                |     |                             |                    | 80.00                                         | 80.00                   |
| <b>TOTAL FOR SPARE PARTS :</b> |     |                             |                    | <b>7,265.15</b>                               | <b>6,173.45</b>         |

## AUTO SPEC APPRAISER

25 Moonstone Lane #10-02 Singapore 328465

Tel : 68468023 Fax : 68427801

### Annex B: Adjustment on Labour and Spray Painting

| Item                                | Job Description                                     | Workshop<br>Quote (\$) | Adjusted<br>cost (\$) |
|-------------------------------------|-----------------------------------------------------|------------------------|-----------------------|
| 1                                   | Labour charges for front accident area              | 1,600.00               | 1,000.00              |
| 2                                   | To putty and spray painting on front affected areas | 1,800.00               | 1,200.00              |
| 3                                   | To do anti rust for front area                      | 160.00                 | 80.00                 |
| 4                                   | Focus headlamp and check front wiring system        | 180.00                 | 90.00                 |
| TOTAL FOR LABOUR & SPRAY PAINTING : |                                                     | 3,740.00               | 2,370.00              |

# AUTO SPEC APPRAISER


25 Moonstone Lane #10-02 Singapore 328465

Tel : 68468023 Fax : 68427801

## Annex B: Adjustment on Labour and Spray Painting

| Item           | Job Description                                       | Workshop<br>Quote (\$)                         | Adjusted<br>cost (\$)           |
|----------------|-------------------------------------------------------|------------------------------------------------|---------------------------------|
| 1              | Labour charges                                        | 2,200.00                                       | 1,600.00                        |
| 2              | To putty and spray painting on affected areas         | 2,400.00                                       | 1,800.00                        |
| 3              | To apply under sealings , anti rust                   | 280.00                                         | 150.00                          |
| 4              | Check wiring system, replace sensor etc               | 200.00                                         | 100.00                          |
| 5              | Remove and refix rear floor carpet, garnishes and etc | 350.00                                         | 250.00                          |
| 6              | Replace rear sopiler and lower skirting               | 250.00                                         | 150.00                          |
| 7              | To do body alignment for rear accident area           | 500.00                                         | 350.00                          |
| 8              | Labour to repair rear exhaust                         | 200.00                                         | 100.00                          |
| 9              | To do sealant seal gap waterproofing for rear area.   | 250.00                                         | 150.00                          |
| <b>Summary</b> |                                                       | <b>TOTAL FOR LABOUR &amp; SPRAY PAINTING :</b> | <b>6,630.00      4,650.00</b>   |
|                |                                                       | TOTAL FOR FRONT SPARE PARTS :                  | 7,265.15      6,173.45          |
|                |                                                       | TOTAL FOR REAR SPARE PARTS :                   | 13,722.46      11,742.46        |
|                |                                                       | LABOUR & SPRAY PAINTING FOR FRONT :            | 3,740.00      2,370.00          |
|                |                                                       | LABOUR & SPRAY PAINTING FOR REAR :             | 6,630.00      4,650.00          |
|                |                                                       | <b>TOTAL REPAIR COSTS :</b>                    | <b>31,357.61      24,935.91</b> |

Vehicle Surveyed By:

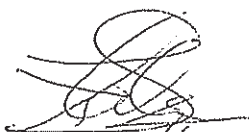

Ng Ching Chye  
Auto Spec Appraiser