

PREMIER APPRAISER SERVICES

VEHICLE INSPECTION REPORT

To : Mr. Lim Tung Li Darren
c/o 1 Kaki Bukit Ave 6
#02-34/36 AutoBay
Singapore 417883

Our Ref. : PT1808010-L
Policy No. : -
Claim No. : -
Sum Insured : -
Type of Claims : T/P Claim
Date : 31st August 2018

Assigned By : Mr. Lim Tung Li Darren
Date of Assignment : 25th Aug 2018
Date of Accident : 23rd Aug 2018
Date of Inspection : 25th Aug 2018 Follow up inspections were also conducted.
Name of Workshop : Precise Auto Service
Place of Inspection : 1 Kaki Bukit Ave 6 #02-34/36 AutoBay
Singapore 417883

PARTICULARS OF VEHICLE

Registration No.	: SKZ 49 T	Odometer/km	: 136133
Make/Model	: Mercedes Benz S350 CGIL	Chassis No.	: WDD2211572A408046
Type Of Body	: 4 Dr. Saloon	Engine No.	: 27695030009618
Year of Manuf./Regn.	: 2011	Engine Cap.	: 3498 cc
Colour	: Black	Carrying Cap.	: 4 Passengers

PRE-ACCIDENT CONDITION (Static tests only)

Handbrake	: Serviceable	Body Work	: Good	Market Value	: N/A
Footbrake	: Serviceable	Paint Work	: Good	Scrap Value	: -
Steering	: Serviceable	Modifications	: None	Others	: -

CONDITION OF TYRES

	Size	N/s - Tread Depth/Make	O/s - Tread Depth/Make
Front Tread	: 245/45 - ZR19	6mm - Dunlop	6mm - Dunlop
Rear Tread (inner)	:		
Rear Tread (outer)	: 275/40 - ZR19	6mm - Dunlop	6mm - Dunlop

The above represent an estimated remaining life of the tyre treads in mm.

POINT OF IMPACT/GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damages on the o/s front bodywork.

The front bumper, o/s front fender, o/s front wheel, o/s front door were scratched/ dented/ warped.
The o/s front suspension and undercarriage were also affected.

For details of damages please refer to our schedule attached.

REMARKS :

This survey was conducted strictly without prejudice.

This report is confidential and is given for the use of clients and their agents and any disclosure or publication of it or parts thereof shall be the responsibility of such person and no liability shall be attached to us therefore.

PREMIER APPRAISER SERVICES

Our Ref: PT1808010-L

Vehicle No : SKZ 49 T

Qty	Parts Descriptions	Conditions	Repairer's Est.	Our Revised
NETT ITEMS:				
1	o/s front fender emblem	damaged	S\$ 67.00	S\$ 67.00 ✓
1	o/s front fender chrome moulding	damaged	139.00	139.00 ✓
1	o/s front wheel rim	dented/warped	1,450.00	1,450.00 ✓
1	o/s front wheel bearing	damaged	726.00	726.00 ✓
1	o/s front shock absorber	bent/stiffened	3,445.00	3,445.00 X
1	o/s front knuckle arm	damaged	1,215.00	1,215.00 X
1	o/s front upper arm	damaged	895.00	895.00 X
1	o/s front lower arm	damaged	872.00	872.00 X
1	o/s front strut arm	damaged	695.00	695.00 X
			S\$ 9,504.00	S\$ 9,504.00
			LESS 10%	10%
			950.40	950.40
			S\$ 8,553.60	S\$ 8,553.60
			TOTAL S/PARTS	
			S\$ 8,553.60	S\$ 8,553.60
Labour charges to repair, panel beat and straighten damaged parts.			700.00	560.00
To dismantle/replace o/s front suspension & undercarriage parts.			350.00	280.00
To replace o/s front wheel rim include wheel balancing.			120.00	80.00
To check & adjust wheel alignment.& steering geometry. (before & after)			240.00	240.00
To reset electrical module system.			280.00	250.00
To putty, apply primer & spray-paint the affected areas.			850.00	750.00
TOTAL			S\$ 11,093.60	S\$ 10,713.60

Note: The repairer has agreed to undertake the repairs at our adjusted amount of **S\$ 9,100.00 lump sum** corresponding to supply of parts, labour and spray painting charges.

The estimated period of repairs is **FIVE (5) days**. Pursuant to your instruction we have **not** authorised repairs on your behalf.

PREMIER APPRAISER SERVICES

LESLIE K C LIM CAE (UK), MIMI (UK)
MSAAA, Automotive Appraiser
Dip.MTM. Automotive Engineer