

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS / AG121003714/49f3

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: SMS 2435L
at Workshop m/s JMK
of _____
Insured: SLT 1353C
Policy No. _____
Claims No. C10009500/KY
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: 68
IDAC Accident Rpt: Consistent?: Yes or No
GIA / PR Seen: Consistent?: Yes or No
Est. Repairs: 2 days Res.: Yes or No
Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMS 2435L Yr Regn: 8/9/10
Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or (A)

Make: Mer Benz 280 c.c. 1796

Colour: Black A/C: Insured / Std / NI / NA

Sp. Reading: 146565 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WDD2120472A164807

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: _____

R: 245/352R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FALKEN

Front

R/Bal. 6 mm

Rear

R/Bal. 6 mm

L/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 20/3/21

D.O.I. 25/3/21

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear O/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

LTA # 31097 we until 30-6-2030

hpr 1535.32

27/3/21 4/5 # 1650 Confirmed with Shuman (Red # 1432.59, 467.7)

Date/Time, File Pass to?

☐

: Preli. Report

Days Of Repair: 2

1) 29/3/21

☐

: Final Report

Resurvey No. of Trip: 1

Date/Time, File Return to?

2)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

____ S + RS, ____ SI

Photos

Others

TOTAL

Report Format :

TP

Lump Sum / I.B.A. (\$) 1650

REPAIR ESTIMATE

ATTN: MOTOR CLAIMS DEPARTMENT
 OWNER: TOH CHONG NEO
 INSURER: Auto & General Southeast Asia (SEA)
 DOA: 20/03/2021

Est No. : EST21030111
 Date : 26-Mar-21
 Vehicle Num : SMS2435L
 Make/Model : Mercedes Benz E250
 Chassis # : WDD2120472A164807
 Engine # : 27186030030003
 Yr. Of Manu : 2010

*not Approved
 25/3/21
 2 days 2/5 \$1650*

No.	Description <i>nett</i>	Qty	U/P	Amt
Section: LIST ITEMS				
1	Rear bumper <i>DD</i>	1.00	1508.90	1508.90
2	Rear bumper side bracket lower <i>ols</i> <i>one</i>	1.00	27.00	27.00
3	Rear bumper chrome moulding <i>Self</i> <i>168.21</i>	1.00	216.40	216.40
4	Rear bumper tow hook cover <i>11</i>	1.00	77.90	77.90 X
5	Rear parking sensor centre <i>Rh</i> <i>one</i>	1.00	258.10	258.10 X
6	Rear end panel <i>11</i>	1.00	1336.80	1336.80 X
Amt S\$				3425.10
Discount (10.00%) S\$				342.51
Subtotal S\$				3082.59

Section: LABOUR

7	To Panel Beat and Renewal Of All Necessary Damaged Parts	1.00	680.00	680.00 <i>200</i>
8	To Sand Down, Putty and Spray Paint on Necessary Damaged Parts	1.00	480.00	480.00 <i>300</i>
9	To Check All Wiring	1.00	50.00 <i>11</i>	50.00 X
10	To Dismantle & Reinstall Parking Sensor	1.00	120.00	120.00 <i>40</i>
Amt S\$				1330.00
Discount (0.00%) S\$				0.00
Subtotal S\$				1330.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date:

LIST ITEMS Subtotal S\$ 3082.59 *1658.85*
 LABOUR Subtotal S\$ 1330.00
 Total S\$ 4412.59

Joo Hak Kee Auto Pte. Ltd.