

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG21003888/R1PA3Q2

**Date:** 28/04/2021

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 0999993682

**Claimant**  
**Vehicle No :** GBJ2585P **Insured Vehicle No :** GBK4100L

Date of Loss: 22/03/2021 Nature of Claim: TP Claim No: 0880585132SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBJ2585P		
Make & Model:	TOYOTA DYNA 150, 3.0 D 5MT (M)	Engine No:	1KD2833244
Reg. Date:	25/02/2019 (Man. Year: 2018)	Chassis No:	JTFAT35Y30K211975
Colour:	Blue	Odometer:	17595 km
Engine Capacity:	2982 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	195/75 R15	Rear Tyre Size:	155 R12C (D)
Front Left Side:	Bridgestone 7 mm	Rear Left Side:	Bridgestone 5/5 mm
Front Right Side:	Bridgestone 7 mm	Rear Right Side:	Bridgestone 5/5 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (\$\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 25/03/2021

Date Inspected: 13/04/2021 Inspected At:

Teamwork Garage Pte Ltd (HQ)  
53 Ubi Ave 1 #01-24, Paya Ubi  
Industrial Park  
Singapore 408934

Estimated Period of Repair: 4.0 days

**Adjuster:** MOHD RASUL

**Manager:** CHEW HSIAO TONG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Repair	0.00 F	*- F
2	1		*FRT CORNER PANEL LH	Cracked	0.00 F	*- F
3	1		*FRT LH HEADLAMP ASSY	Scratched	0.00 F	*- F
4	1		*FRT LH DOOR	Repair	0.00 F	*- F
5	1		*FRT DOOR LETTERING LH	Necessary	0.00 F	*- F
F=Franchise part.						
<b>Total Parts (S\$)</b>					<b>0.00</b>	<b>0.00</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
---

**< END OF ESTIMATES >**