

# CL APPRAISER PTE LTD

No. 46 Soo Chow View, Singapore 575438  
Email: [clappraiser@yahoo.com](mailto:clappraiser@yahoo.com) Hp: 9068 8689 Fax: 6452 9783  
Reg No: 201000228E

## INVOICE

Chen Wei  
C/o: 889 Car Servicing Pte Ltd  
10 Kaki Bukit Road 2 #03-34  
First East Centre, Singapore 417868

Invoice No: CL/15797  
Ref No: 899/10/1501/TP  
Date: 17 November 2015

### DESCRIPTION

### AMOUNT

#### OUR SERVICE FEE CHARGES:

- SURVEY INSPECTION FOR VEHICLE NO. SJK 3312 D
- RESURVEY INSPECTION
- DIGITAL PHOTOGRAPHS SERVICES  
(*INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS*)
- TRANSPORTATION

**GRAND TOTAL**

**S\$ 760.00**

E & O. E

All cheque payment should be "Crossed" and made payable to " **C L APPRAISER PTE LTD** "

We shall be grateful if you could forward our payment at your early convenience.



**CL Appraiser Pte Ltd**

# CL APPRAISER PTE LTD

No. 46 Soo Chow View, Singapore 575438  
Email: [clappraiser@yahoo.com](mailto:clappraiser@yahoo.com) Hp: 9068 8689 Fax: 6452 9783  
Reg No: 201000228E

## VEHICLE INSPECTION REPORT

To: Chen Wei  
C/o: 889 Car Servicing Pte Ltd  
10 Kaki Bukit Road 2 #03-34  
First East Centre, Singapore 417868

Date : 17 November 2015  
Our ref : 899/10/1501/TP

Accident Date : 19 Octoer 2015  
Inspection Date : 21 October 2015  
Repairer Name : 889 Car Servicing Pte Ltd  
10 Kaki Bukit Road 2 #03-34  
First East Centre, Singapore 417868

Type of Survey : Third Party

### PARTICULARS OF VEHICLE

Registration No	: SJK 3312 D	Year / Capacity	: 2008 / 1995 cc
Make / Model	: BMW 520 i	Colour	: Black
Chassis No	: WBANT12060CX29549	Mileage	: 129760
Engine No	: A4671244N46B20BE		

### CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front Nearside	: Bridgestone	225/55 R16	5 mm	Sport
Front Offside	: Bridgestone	225/55 R16	5 mm	Sport
Rear Nearside	: Bridgestone	225/55 R16	5 mm	Sport
Rear Offside	: Bridgestone	225/55 R16	5 mm	Sport

### GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the rear portion.  
(Details refer to the photographs attached)

Enclosed number of photographs: 130 copies

### REMARKS

This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis  
and we have not given authorization and instruction to the repairer to proceed with the repair

### RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$11,800.00** on a contractual basis.

Under normal circumstances, the repair period would be about 8 (**Eight**) working days.

Vehicle Registration No: SJK 3312 D

Our Ref No: 899/10/1501/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

**SPARE PARTS - LIST ITEMS**

1	Rear boot lid	Damage	\$ 1,658.78	\$ 1,658.78
2	Rear boot hinges	Intact	\$ 274.72	
1	Rear boot inner lock	Damage	\$ 195.13	\$ 195.13
1	Rear boot logo	Necessary	\$ 54.45	\$ 54.45
1	Rear boot rubber	Necessary	\$ 193.33	\$ 193.33
1	Rear boot "520 I" emblem	Necessary	\$ 49.73	\$ 49.73
2	Rear taillamps	Damage	\$ 689.14	\$ 689.14
1	Rear end panel	Damage	\$ 1,018.57	\$ 1,018.57
1	Rear end panel inner garnish	Damage	\$ 157.37	\$ 157.37
1	Rear bumper	Damage	\$ 1,350.92	\$ 1,350.92
2	Rear bumper brackets	Damage	\$ 178.00	\$ 178.00
2	Rear bumper reflectors	Damage	\$ 119.44	\$ 119.44
1	Rear bumper reinforcement	Damage	\$ 635.93	\$ 635.93
2	Rear bumper side retainers	Necessary	\$ 178.00	\$ 178.00
1	Rear bumper inner top pad	Damage	\$ 82.85	\$ 82.85
4	Rear bumper PDC sensors	Damage	\$ 1,254.16	\$ 1,254.16
1	Rear bumper centre guide	Damage	\$ 126.50	\$ 126.50
1	Rear bumper side lower guide	Damage	\$ 82.85	\$ 82.85
1	Rear bumper sensor wire harness (1 set)	Necessary	\$ 386.00	\$ 386.00
1	Rear spare tyre panel	Repair	\$ 1,556.50	
1	Rear exhaust silencer	Damage	\$ 1,672.85	\$ 1,672.85
4	Rear exhaust mountings	Necessary	\$ 452.32	\$ 452.32
1	Front seat head rest	Damage	\$ 455.00	\$ 455.00
1	Front seat crash- active head restraint kit	Necessary	\$ 425.00	\$ 425.00
1	Front o/s door lock	Damage	\$ 285.00	\$ 285.00
1	Front n/s safety belt tensioner assy	Damage	\$ 480.00	\$ 480.00
			<b>\$ 14,012.54</b>	<b>\$ 12,181.32</b>
			<i>Less 5%</i>	
			\$ 700.63	\$ 609.07
<b>Total Cost - List Items</b>			<b>\$ 13,311.91</b>	<b>\$ 11,572.25</b>

**Total cost of parts**
**\$ 13,311.91 \$ 11,572.25**

Vehicle Registration No: SJK 3312 D

Our Ref No: 899/10/1501/TP

S/No	Description	Repairer's Estimate	Revised Amount
<b>Total cost of parts c/f</b>		<b>\$ 13,311.91</b>	<b>\$ 11,572.25</b>
<b><u>LABOUR</u></b>			
1	To remove, refit, replaced damaged lamps and check up rear electrical wiring	\$ 80.00	\$ 50.00
2	To remove and refit inner garnishes, inner trim to assist repair.	\$ 150.00	\$ 120.00
3	To remove and refit rear reverse sensor.	\$ 120.00	\$ 80.00
4	To transfer boot lid mechanism and wiring assembly to assist repair.	\$ 80.00	\$ 60.00
5	To remove, refit and replace exhaust silencer and mountings.	\$ 150.00	\$ 120.00
6	To apply undercoating on repaired and replaced panel.	\$ 200.00	\$ 120.00
7	To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident.	\$ 1,600.00	\$ 1,250.00
8	To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident.	\$ 1,500.00	\$ 1,100.00
9	To diagnose erase fault memory after repair.	\$ 350.00	\$ 250.00
<b>GRAND TOTAL</b>		<b>\$ 17,541.91</b>	<b>\$ 14,722.25</b>

Vehicle Registration No: SJK 3312 D

Our Ref No: 899/10/1501/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 11,800.00**

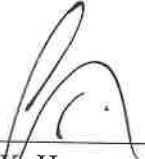
By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

**Disclaimer**

*The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.*

**C L APPRAISER PTE LTD**

  
\_\_\_\_\_  
Cheong K. H  
Automotive Appraiser























