

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC4/AIG20007727/T1GA3Q2-1  
**Date:** 26/11/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100260845
<b>Claimant Vehicle No :</b>	SHD1379K	<b>Insured Vehicle No :</b>	SJD277D
Date of Loss:	25/07/2020	Nature of Claim:	TP
		Claim No:	5914300373SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SHD1379K</b>		
Make & Model:	HYUNDAI I30 GDH, 1.6 D TCI 5DR DCT (M)	Engine No:	D4FBGZ122871
Reg. Date:	14/06/2017 (Man. Year: 2016)	Chassis No:	TMAD281UVHJ127998
Colour:	Silver	Odometer:	179865 km
Engine Capacity:	1582 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

**CONDITION OF TYRES**

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Maxxis 6 mm	Rear Left Side:	Maxxis 6 mm
Front Right Side:	Maxxis 6 mm	Rear Right Side:	Maxxis 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	150.00	100.00	50.00	33.33
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,170.00	830.00	340.00	29.06
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>1,320.00</b>	<b>930.00</b>	<b>390.00</b>	<b>29.55</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>92.40</b>	<b>65.10</b>	<b>27.30</b>	<b>29.55</b>

<b>Nett Amount (S\$)</b>	<b>1,412.40</b>	<b>995.10</b>	<b>417.30</b>	<b>29.55</b>
<b>+ Loss of Use (3.0 x S\$40.00/day) (S\$)</b>		120.00		
<b>+ Car Rental (3.0 x S\$50.29/day) (S\$)</b>		150.87		
<b>(S\$)</b>		1,265.97		
<b>Liabe Amount (50.00%) (S\$)</b>		<b>632.99</b>		
<b>+ Doc/Search Fee (S\$)</b>		2.00		
<b>Nett Liability (S\$)</b>		<b>634.99</b>		

INSPECTION

Date of Assignment: 27/07/2020

Date Inspected: 27/07/2020

Estimated Period of Repair: 2.0 days

Inspected At:

Premier Automotive Services Pte Ltd (HQ)  
 23 Changi South Ave 2, #01-02  
 Singapore 486443

**Adjuster:** MOHD TAUFIKH BIN HAMID**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SET N/S DOOR STICKER	Cut	100.00 FS	*100.00 FS
2	1		*SUNDRY	Not Necessary	50.00 FS	*- FS
F=Franchise part. S=SpcNett.						
					Total Parts (S\$)	
					150.00	100.00

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Labour Items</u></b>				
1	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS.INCLUDING KNOCK -OUT ,STRAIGHTEN ,REPAIR ,RESHAPE AND ADJUST OF THE REAR N/S DOOR ETC	New	450.00	300.00
2	TO PUTTY AND SPRAY PAINTING ON REAR N/S DOOR ,REAR N/S FENDER,N/S ROCKER PANEL	New	600.00	500.00
3	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS	New	120.00	30.00
<b>Gross Labour Cost (S\$)</b>			<b>1,170.00</b>	<b>830.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >