



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103901

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 03/06/2021
Reference CC4/FCI21004068/Aea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SLN 9785T
Insured Veh. XD 7126U
Claim No. D21000981MFVS/2
Policy No. D-21096931MFVS
Accident Date 26/03/2021
Inspection Date 31/03/2021

Description	Total
Survey Inspection	407.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	407.00
GST (7%)	28.49
Grand Total	435.49

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI21004068/Aea3q2	
			Date: 03/06/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	XD 7126U	Veh. Inspected	SLN 9785T
	Policy No.	D-21096931MFVS	Coverage (\$)	0.00
	Claim No.	D21000981MFVS/2	Excess (\$)	0.00
	Assign From	KAREN TAN	Assign Date	30/03/2021
2. Vehicle Particulars & Condition				
	Make & Model	KIA CARENS	c.c	1685
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	KNAHU815VH7182862	Colour	BRONZE
	Odometer	66364 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/55 R16	KAPSEN	6 mm
	L/H Front Tyre	205/55 R16	KAPSEN	6 mm
	R/H Rear Tyre	205/55 R16	KAPSEN	6 mm
	L/H Rear Tyre	205/55 R16	KAPSEN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	26/03/2021	Inspection Date	31/03/2021
	Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLN 9785T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	RR FENDER LH	TO REPAIR SEE LABOUR	1,345.00	-
1	RR TAILLAMP PANEL LH	NOT NECESSARY	250.00	-
1	RR FENDER INNERSHIED LH	TORN	268.00	268.00
1	RR FENDER INNER TRIM LH	NOT NECESSARY	568.00	-
1	RR FENDER OUTER QUARTER GLASS LH	NOT NECESSARY	441.00	-
1	RR BUMPER	DISTORTED	576.00	576.00
1	RR BUMPER LOW	TORN	226.00	226.00
1	RR BUMPER LOW GARNISH	TORN	214.00	214.00
1	RR BUMPER SIDE RETAINER RH	NOT NECESSARY	31.00	-
1	RR BUMPER SIDE RETAINER LH	DAMAGED	31.00	31.00
1	RR BUMPER UPP BRACKET RH	NOT NECESSARY	30.00	-
1	RR BUMPER UPP BRACKET LH	DAMAGED	30.00	30.00
1	RR BUMPER LOW BRACKET RH	NOT NECESSARY	30.00	-
1	RR BUMPER LOW BRACKET CENTRE	NOT NECESSARY	30.00	-
1	RR BUMPER LOW BRACKET LH	NOT NECESSARY	30.00	-
1	RR BUMPER REINFORCEMENT	CRACKED	440.00	440.00
1	RR KEY RECEIVER SENSOR	NOT NECESSARY	108.00	-
1	RR BUMPER REINFORCEMENT STAY LH	NOT NECESSARY	190.00	-
2	RR BUMPER REVERSE SENSOR	DAMAGED (1 PCS ONLY)	388.00	194.00
4	RR BUMPER REVERSE SENSOR HOLDER	NOT NECESSARY	288.00	-
4	RR BUMPER REVERSE SENSOR RUBBER SEAL	NOT NECESSARY	48.00	-
1	RR BUMPER REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	301.00	-
1	RR BUMPER REFLECTOR LH	CRACKED	138.00	138.00
1	RR TAILGATE	TO REPAIR SEE LABOUR	1,196.00	-
1	RR TAILGATE KIA LOGO	NECESSARY	103.00	103.00
1	RR TAILGATE CARENS EMBLEM	NECESSARY	43.00	43.00
1	RR TAILGATE CRDI EMBLEM	NECESSARY	43.00	43.00
1	RR TAILGATE LOCK	NOT NECESSARY	130.00	-
1	RR TAILGATE LOCK STRIKER	NOT NECESSARY	16.00	-

Report Ref No. CC4/FCI21004068/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RR TAILGATE REFLECTOR RH (LED)	NOT NECESSARY	927.00	-
1	RR TAILGATE REFLECTOR LH	CUT	927.00	285.00
1	RR TAILGATE WEAHTERSTRIP	CUT	157.00	157.00
1	RR TAILLAMP RH (LED)	NOT NECESSARY	924.00	-
1	RR TAILLAMP LH	CRACKED	924.00	428.00
1	RR END PANEL	DENTED	543.00	543.00
1	RR END PANEL TOP GARNISH	NOT NECESSARY	85.00	-
1	RR FENDER AIR DUCT LH (ADDITIONAL)	CRACKED	86.00	86.00
	LESS 10% DISCOUNT		-1,210.50	-380.50
			10,894.50	3,424.50
	<u>SPECIAL NETT ITEMS</u>			
1	RR TAILGATE C&C EMBLEM (SN)	NECESSARY	56.00	56.00
10	FENDER INNERSHIELD CLIP (SN)	NECESSARY	60.00	30.00
10	RR BUMPER CLIP (SN)	NECESSARY	60.00	30.00
5	RR END PANEL TOP GARNISH CLIP (SN)	NOT NECESSARY	30.00	-
1	RR WINDSCREEN SEALANT (SN)	NOT NECESSARY	65.00	-
1	RR WINDSCREEN INNER SEAL (SN)	NOT NECESSARY	40.00	-
1	RR WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	200.00	-
1	RR QUARTER GLASS SEALANT (SN)	NOT NECESSARY	65.00	-
1	RR QUARTER GLASS INNER SEAL (SN)	NOT NECESSARY	40.00	-
			616.00	116.00
	<u>LABOUR</u>			
	TO DISMANTLE /RENEW THE ACCIDENT DAMAGED PORTION ,TO PANEL BEATING ,RESHAPE ,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF RR FENDER LH AND RR TAILGATE .		1,400.00	700.00
	CARRY OUT SPRAY PAINTING ON ACCIDENT AFFECTED AREA RR BUMPER ,RR END PANEL ,RR SPARE TYRE PANEL ,RR FENDER LH ,RR TAILGATE .		1,400.00	800.00
	TO CONDUCT ANTI RUST OF UNDER CARRIAGE TUFF COAT.		100.00	60.00
	TO DISCONNECT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS ,RECONNECT AND CHECK ELECTRICAL FUNCTION AFTER REPAIR .		120.00	30.00

Report Ref No. CC4/FCI21004068/Aea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIX REVERSE SENSOR AND CONDUCT TEST .		100.00	50.00
	TO REMOVE AND REFIX REVERSE CAMERA AND CONDUCT TEST .	NOT NECESSARY	100.00	-
	TO CONDUCT TRANSFER OF PARTS FROM OLD TAILGATE TO NEW TAILGATE .	NOT NECESSARY	160.00	-
	TO CONDUCT WATER LEAKAGE TEST AFTER REPAIRS OF VEHICLE .	NOT NECESSARY	80.00	-
	TO REMOVE AND REFIT FUEL TANK TO FACILITATE ACCIDENT REPAIR .	NOT NECESSARY	160.00	-
	TO REMOVE AND REFIX REAR TAIL GATE WINDSCREEN .	NOT NECESSARY	160.00	-
	TO REMOVE AND REFIX REAR QUARTER GLASS .	NOT NECESSARY	160.00	-
	TO PERFORM DIAGNOSIS RESET FAULT CODE AFTER REPAIR VEHICLE .	NOT NECESSARY	300.00	-
			4,240.00	1,640.00
GRAND TOTAL			15,750.50	5,180.50

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,100.00
---	--	--	-----------------

Report Ref No. CC4/FCI21004068/Aea3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLN 9785T

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

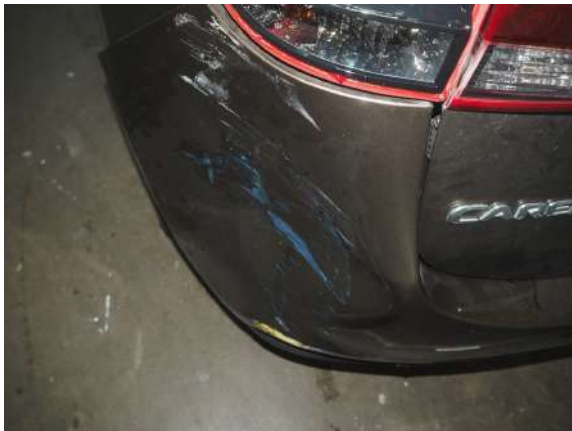



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

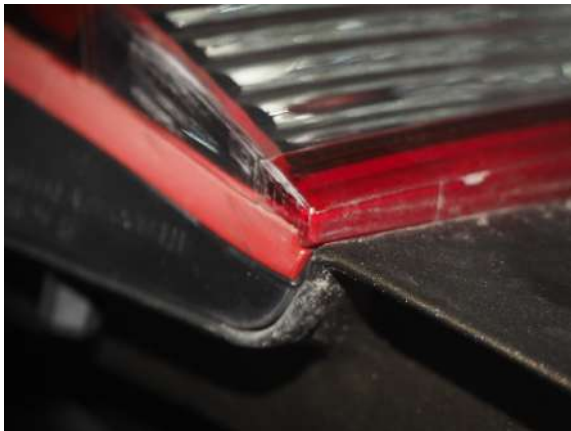



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLN 9785T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

