

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/ICS21004230/R1VF3E2

Date: 20/05/2021

REFERENCE

Handling Insurer: ECICS Limited Policy No: MPC20B00008400
Claimant Vehicle No : SMC88C Insured Vehicle No : SLA2035P
Date of Loss: 28/03/2021 Nature of Claim: TP Claim No: DMPC2100104H

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMC88C**
Make & Model: LAMBORGHINI AVENTADOR LP700-4, 6.5 (A) Engine No: DHU001939
Reg. Date: 11/01/2019 (Man. Year: 2018) Chassis No: ZPBEA1ZL2KLA01439
Colour: White Odometer: 26571 km
Engine Capacity: 3996 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 285/45Z R21 Rear Tyre Size: 285/45Z R21
Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm
Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,335.96	7,428.60	6,907.36	48.18
Miscellaneous Items	0.00	0.00	0.00	
Labour	9,600.00	6,400.00	3,200.00	33.33
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	23,935.96	13,828.60	10,107.36	42.23
+ GST 7.00/7.00% (S\$)	1,675.52	968.00	707.52	42.23
Nett Amount (S\$)	25,611.48	14,796.60	10,814.88	42.23

INSPECTION

Date of Assignment: 01/04/2021
Date Inspected: 07/04/2021 Inspected At: 24 Leng Kee Road #08-02
Estimated Period of Repair: 5.0 days Repairer: Eurosports Auto Pte Ltd (HQ)

Adjuster: MOHD RASUL

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 20 May 2021)
Parts:	M1-COUPE	LAMBORGHINI AVENTADOR LP700-4 6.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMC88C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER, COMPLETE (PRIMER)	Deformed	3,374.00 F	*2,640.00 FL
2	1		*BUMPER, COVER	Serviceable	3,304.00 F	*- FL
3	1		*BUMPER CARRIER	Serviceable	627.00 F	*- FL
4	1		*ORNAMENTAL GRILLE	Serviceable	364.00 F	*- FL
5	1		*COVER LH	Not Necessary	118.48 F	*- FL
6	1		*COVER RH	Not Necessary	118.48 F	*- FL
7	1		*REAR DIFFUSER	Cut	5,614.00 F	*5,614.00 FL
8	1		*REINFORCEMENT (REAR)	Serviceable	816.00 F	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	14,335.96	8,254.00
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	825.40
Total Parts (\$\$)	14,335.96	7,428.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR	New	4,800.00	2,400.00
2	SPRAY PAINTING	New	3,200.00	2,400.00
3	TO INSTALL MATTE PPF	New	1,600.00	1,600.00
Gross Labour Cost (\$)			9,600.00	6,400.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >