

Your Ref: ACC-IND-21-08

Date: 23<sup>th</sup> April 2021

Our Ref: CS1/SCD21004288/Qtf3e2

**M/s Singapore Civil Defence Force (MHA05)**

91 Ubi Ave 4

Singapore 408827

Attn : Jamin Tan

Dear Sir / Madam,

**EVALUATION REPORT (PAPER SURVEY) OF ACCIDENT VEHICLE NO: QX 1293L  
ACCIDENT DATE: 05/01/2021**

We thank you for your instruction on 01/04/2021.

We acknowledge receipt of the following documents:-

- a) Automobile Inspection Report of QX 1293L from M/s Indeco Engineers Pte Ltd.
- b) Colour damaged vehicle photographs of QX 1293L.

Based on the documents received from you, we have evaluated the damages of the vehicle and have the following comments:-

1. Information Recorded: -

Registration Number	: QX 1293L
Make & Model	: -
Chassis Number	: -
Year of Registration	: -
Engine Capacity	: -

- 2. We recommend that the repairs of the entire damage require about \_\_\_\_ - \_\_\_\_ working days to complete.
- 3. We hereby provide our recommendations on the cost of repair to the damaged vehicle as stated in the following page.

**Registration No. QX 1293L**

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	SCOPE OF REPAIRS					
1.1	Remove & replace bonnet sticker & wording					4
1.2	Panel beat dented bonnet					2
1.3	Putty & spray paint bonnet					3
1.4	Spray lacquer over after putting up sticker & wording for bonnet					3
1.5	Remove & replace front bumper retainer					0.5
1.6	Remove & replace front dented bumper					3
1.7	Remove & replace dented AP panel					1
1.8	Remove & replace dented radiator grill					2
1.9	Remove & replace R/H fender sticker					1
1.10	Panel beat dented R/H fender					2
1.11	Remove & replace front dented number plate					0.5
1.12	Panel beat dented siren speaker bracket					1
1.13	Remove & replaced dislodged siren speaker					1
1.14	Remove & replace dented power streeling pipe					1
1.15	Remove & replace air con motor fan					2
1.16	Remove & replace air con condenser					2
1.17	Remove & replace radiator					5
1.18	Remove & replace radiator top & bottom hose					1
1.19	Putty & spray paint AP panel & R/H fender					3
COSTING		TOTAL PARTS COST				
		TOTAL MAN-HOUR				38

**Registration No. QX 1293L**

Vehicle Inspected By:



**OI SUN PIN**

*Asst. Automotive Assessor*



**ADRIAN LING WAI PING**

*B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI*

*Licensed Appraiser*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.