

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/GRB21004340/UBS3Q2
Date: 07/09/2021**REFERENCE**

Handling Insurer:	India International Insurance Pte Ltd	Policy No:	D21MFL0000447
Claimant Vehicle No :	FBQ9739E	Insured Vehicle No :	SLM9784B
Date of Loss:	02/04/2021	Nature of Claim:	TP
		Claim No:	MFL2021D0001412

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBQ9739E		
Make & Model:	YAMAHA AEROX GDR155A, 155cc CVT ABS	Engine No:	G3J1E0425711
Reg. Date:	20/01/2020 (Man. Year: 2019)	Chassis No:	MH3SG4620KJ068676
Colour:	Multi-colour	Odometer:	53504 km
Engine Capacity:	155 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	120/70 -14	Rear Tyre Size:	140/70-14
Front Left Side:	Maxxis 7 mm	Rear Left Side:	Maxxis 7 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,673.00	1,677.60	995.40	37.24
Miscellaneous Items	0.00	0.00	0.00	
Labour	300.00	280.00	20.00	6.67
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	2,973.00	1,957.60	1,015.40	34.15
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment: 06/04/2021

Date Inspected: 07/04/2021

Estimated Period of Repair: 3.0 days

Inspected At:

Hua Ho Trading (HQ)
Blk 6 Defu Lane 10, #01-540 Defu Industrial Estate Park C
Singapore 539187

Adjuster: MARCUS CHUA**Manager:** CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 02 Jun 2021)	
Parts:	N/A	YAMAHA AEROX GDR155A 155cc CVT ABS (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBQ9739E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SET FRONT FORK	Bent / Cracked	820.00 F	*720.00 FL
2	1		*SET HEADLIGHT	Cracked	286.00 F	*280.00 FL
3	1		*LEFT SIGNAL LIGHT	Cracked	65.00 F	*65.00 FL
4	1		*SET TOP COWLING	Cracked	250.00 F	*250.00 FL
5	1		*INTER PANEL CENTER	Cracked	192.00 F	*192.00 FL
6	1		*LEFT FOOT PANEL	Distorted	105.00 F	*90.00 FL
7	1		*OUTER PANEL	Distorted	192.00 F	*192.00 FL
8	1		*REAR LEFT SIDE BOX	Repair	200.00 F	*- FL
9	1		*LEFT SIDE BODY BRACKET	Not Necessary	85.00 F	*- FL
10	1		*FRONT FENDER	Cut	98.00 F	*75.00 FL
11	1		*UNDER BRACKET	Not Necessary	380.00 F	*- FL
						F=Franchise part. L=ListItemDisc.
					Sub Total (\$\$)	2,673.00
					- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00
					Total Parts (\$\$)	2,673.00
						1,864.00
						186.40
						1,677.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	LABOUR CHARGE	New	300.00	280.00
Gross Labour Cost (\$)			300.00	280.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >