



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2107823

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 15/11/2021
Reference CC6/CTI21004451/Krs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJP 7717S
Insured Veh. SLD 444P
Claim No. SNM21D201908/LKKDS
Policy No. DMPCSNW00041162001
Accident Date 02/04/2021
Inspection Date 06/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21004451/Krs3q2	
			Date: 15/11/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLD 444P	Veh. Inspected	SJP 7717S	
Policy No.	DMPCSNW00041162001	Coverage (\$)	0.00	
Claim No.	SNM21D201908/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	06/04/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA WISH (A)	c.c	1794	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	JTDER12W403002206	Colour	METALLIC BLUE	
Odometer	220629 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	FALKEN	8 mm	
L/H Front Tyre	195/65 R15	FALKEN	8 mm	
R/H Rear Tyre	195/65 R15	FALKEN	8 mm	
L/H Rear Tyre	195/65 R15	FALKEN	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	02/04/2021	Inspection Date	06/04/2021	
Survey held at	K.KIM HIN AUTOMOTIVE PTE LTD 160 SIN MING DRIVE, #02-20 SIN MING AUTOCITY SINGAPORE 575722			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			14 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJP 7717S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	BENT	601.90	601.90
2	FRONT BUMPER SIDE RETAINER (LH/RH) @\$63.40	SERVICEABLE	126.80	-
1	FRONT BUMPER REINFORCEMENT	BENT	336.30	336.30
1	FRONT BUMPER SPONGE	CRACKED	128.20	128.20
10	FRONT BUMPER CLIPS @\$5.00	NECESSARY	50.00	50.00
1	FRONT BUMPER LOWER CENTRE GRILLE	SERVICEABLE	145.70	-
2	FRONT BUMPER FOG COVER (LH/RH) @\$60.70	SERVICEABLE	121.40	-
2	FRONT BUMPER REINFORCEMENT BRACKET (LH/RH) @\$77.60	TO REPAIR SEE LABOUR	155.20	-
1	FRONT GRILLE	DISTORTED	117.10	117.10
2	FRONT GRILLE SIDE STOPPER CLIPS (LH/RH) @\$20.00	NECESSARY	40.00	40.00
1	BONNET	BENT	665.00	665.00
2	BONNET HINGES (LH/RH) @\$58.00	TO REPAIR SEE LABOUR	116.00	-
1	BONNET LOCK	DISTORTED	90.00	90.00
1	BONNET OUTER CHROME	DENTED	215.00	215.00
1	BONNET LOGO	NECESSARY	55.00	55.00
8	BONNET INSULATOR CLIPS @\$5.00	NECESSARY	40.00	40.00
1	BONNET INNER SEAL	SERVICEABLE	45.00	-
8	BONNET INNER SEAL CLIPS @\$5.00	NOT NECESSARY	40.00	-
2	HEADLAMP ASSY (LH/RH) @\$1014.30	MTG CRACKED	2,028.60	2,028.60
1	FRONT BRACE PANEL	BENT	95.00	95.00
1	FRONT SUPPORT PANEL ASSY	BUCKLED	1,000.00	1,000.00
1	FRONT SUPPORT PANEL TOP GARNISH	DISTORTED	136.00	136.00
6	FRONT SUPPORT PANEL TOP GARNISH CLIPS @\$5.00	NECESSARY	30.00	30.00
2	FRONT SUPPORT PANEL AIR GUIDE (LH/RH) @\$66.00	NOT NECESSARY	132.00	-
2	HORN (LH/RH) @\$149.00	SERVICEABLE	298.00	-
1	AIR CON CONDENSER	BENT	1,607.00	1,607.00
1	RADIATOR ASSY	PUNCTURE	1,824.00	1,824.00
2	RADIATOR TOP BRACKET (LH/RH) @\$58.10	TO REPAIR SEE LABOUR	116.20	-
2	RADIATOR TOP BUSH (LH/RH) @\$38.30	SERVICEABLE	76.60	-

Report Ref No. CC6/CTI21004451/Krs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	RADIATOR LOWER BUSH (LH/RH) @\$38.30	SERVICEABLE	76.60	-
1	RADIATOR FAN MOTOR	TORN	466.00	466.00
1	RADIATOR FAN BLADE	CRACKED	147.00	147.00
1	RADIATOR FAN COWLING	CRACKED	218.70	218.70
2	REAR NUMBER PLATE LAMP (LH/RH) @\$57.10	SERVICEABLE	114.20	-
1	REAR BUMPER	BENT	500.30	500.30
2	REAR BUMPER SIDE RETAINER (LH/RH) @\$71.10	N/S DISTORTED	142.20	71.10
2	REAR BUMPER REFLECTOR (LH/RH) @\$66.60	SERVICEABLE	133.20	-
10	REAR BUMPER CLIPS @\$5.00	NECESSARY	50.00	50.00
2	REAR BUMPER INNER DAMPER @\$60.00	DENTED	120.00	120.00
1	TAILGATE	BENT	1,275.00	1,275.00
1	SET TAILGATE GLASS MOULDING	NECESSARY	120.00	120.00
1	TAILGATE LOCK	DENTED	470.00	470.00
1	TAILGATE LOCK CATCH	TO REPAIR SEE LABOUR	50.00	-
1	TAILGATE LOCK OUTER CHROME	WARPED / CRACKED	245.00	245.00
1	TAILGATE LOOG	NECESSARY	68.00	68.00
1	TAILGATE OPENING SWITCH	DENTED	165.00	165.00
1	TAILGATE INNER PULL HANDLE	DENTED	50.00	50.00
1	TAILGATE INNER TRIM BOARD	MTG CRACKED	450.00	450.00
13	TAILGATE INNER TRIM BOARD CLIPS @\$5.00	NECESSARY	65.00	65.00
2	TAIL LAMP ASSY (LH/RH) @\$497.70	N/S CRACKED	995.40	497.70
1	N/S REAR FENDER	BUCKLED	900.00	900.00
1	N/S REAR FENDER 1/4 GLASS	MOULDING NECESSARY	512.10	512.10
1	N/S REAR FENDER INNER TRIM BOARD	TO REPAIR SEE LABOUR	850.00	-
1	N/S REAR FENDER INNER AIR VENT	SERVICEABLE	114.00	-
1	REAR END PANEL	BENT	468.00	468.00
1	REAR END PANEL TOP GARNISH	BUCKLED	245.00	245.00
	LESS 25% DISCOUNT		-4,860.68	-4,040.75
			14,582.02	12,122.25

Report Ref No. CC6/CTI21004451/Krs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	DENTED	40.00	20.00
1	RADIATOR COOLANT (50%) (SN)	NECESSARY	48.00	24.00
1	REAR NUMBER PLATE (SN)	DENTED	40.00	40.00
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	40.00	40.00
1	TAILGATE GLASS DAMPING SEAL (SN)	NECESSARY	20.00	20.00
1	REVERSE SENSOR ASSY (SN)	DENTED	220.00	200.00
1	N/S REAR FENDER 1/4 GLASS SEALANT (SN)	NECESSARY	40.00	40.00
1	N/S REAR FENDER 1/4 GLASS DAMPING SEAL (SN)	NECESSARY	20.00	20.00
			468.00	404.00
	<u>LABOUR</u>			
	TO REMOVE ,CUT OUT DAMAGED PARTS ,PANEL BEATING ,WELDING ,ALIGN ,REFIX AND TO RENEW AFFECTED PARTS.INCLUDING OF THE REPAIR OF FRONT BUMPER REINFORCEMENT BRACKET (LH/RH),BONNET HINGES (LH/RH),RADIATOR TOP BRACKET (LH/RH) ,TAILGATE LOCK CATCH AND N/S REAR FENDER INNER TRIM BOARD .		1,600.00	1,400.00
	TO REMOVE AND REFIT REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		120.00	120.00
	TO REMOVE AND REFIT REAR UPHOLSTERY TRIMMING ,ROOF LINING ,SEATS ,SPEAKER BOARD IN ORDER TO FACILITATE REPAIRING WORKS .		120.00	100.00
	TO REMOVE AIRCON CONDENSER ,PIPES AND DRIERS ,VACUUM AND RECHARGE GAS .		100.00	100.00
	TO APPLY UNDERSEALING.		150.00	150.00
	TO TRANSFER TAILGATE'S FITTINGS .		80.00	60.00
	TO REMOVE AND REFIT REVERSE SENSOR ASSY .		60.00	50.00
	TO PUTTY AND RESPRAY ON AFFECTED PORTIONS.		1,800.00	1,600.00
	TO FOCUS HEADLAMPS AND TAILLAMPS .TO CHECK FRONT AND REAR LIGHTING OPERATION AND REWIRING.		80.00	40.00
			4,110.00	3,620.00
	GRAND TOTAL		19,160.02	16,146.25

Report Ref No. CC6/CTI21004451/Krs3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			12,000.00
---	--	--	-----------

Report Ref No. CC6/CTI21004451/Krs3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 7717S

INSPECTION

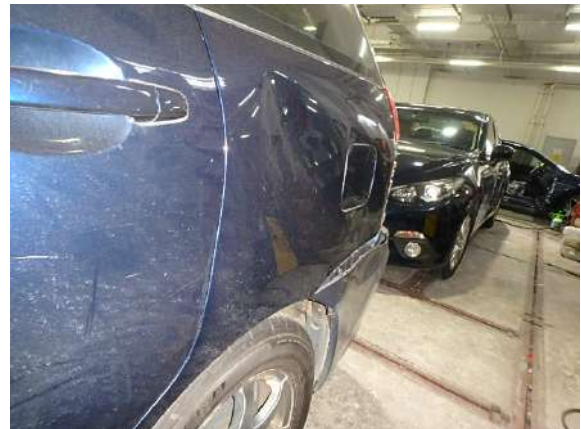



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

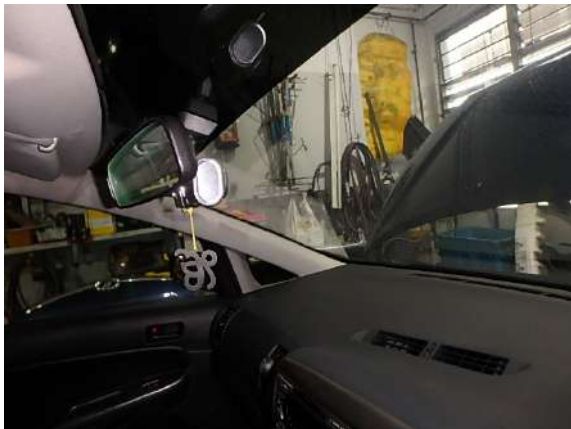



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 7717S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJP 7717S

RE-INSPECTION

