



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2300890

INV Date 15/02/2023

Reference CC4/LPC21004501/Kps3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 317X
Insured Veh. SKK 5107E
Claim No. 20/21/21/VP05/024420
Policy No. Z20VP05027145
Accident Date 06/04/2021
Inspection Date 08/04/2021

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
Subtotal	350.00
GST (8%)	28.00
Grand Total	378.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21004501/Kps3q2	
			Date: 15/02/2023	
			Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SKK 5107E	Veh. Inspected	SHD 317X
	Policy No.	Z20VP05027145	Coverage (\$)	0.00
	Claim No.	20/21/21/VP05/024420	Excess (\$)	0.00
	Assign From	KENNY	Assign Date	08/04/2021
2. Vehicle Particulars & Condition				
	Make & Model	RENAULT LATITUDE (A)	c.c	1995
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	VF1ABL15AUC282370	Colour	METALLIC WHITE / RED
	Odometer	477843 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	SAILUN	9 mm
	L/H Front Tyre	215/60 R16	SAILUN	9 mm
	R/H Rear Tyre	215/60 R16	SAILUN	8 mm
	L/H Rear Tyre	215/60 R16	SAILUN	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	06/04/2021	Inspection Date	08/04/2021
	Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks				
	A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 317X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BUMPER COVER FRT	BUCKLED / MTG CRACKED	747.20	747.20
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER BEAM FRT	TO REPAIR SEE LABOUR	663.70	-
1	BUMPER BRACKET KIT FRT RH	DISTORTED	101.40	101.40
1	DOOR PANEL FRT RH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR HINGE UPPER FRT RH	TO REPAIR SEE LABOUR	261.28	-
1	DOOR HINGE LOWER FRT RH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR REGULATOR FRT RH	SERVICEABLE	505.19	-
1	DOOR REGULATOR MOTOR FRT RH	SERVICEABLE	796.46	-
1	DOOR WEATHERSTRIP FRT RH	SERVICEABLE	410.27	-
1	FENDER PANEL FRT RH	BENT	437.10	437.10
1	WHEELARCH FRT RH	DISTORTED	191.40	191.40
1	HEADLAMP RH	SERVICEABLE	743.60	-
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	WIPER RESERVOIR	SERVICEABLE	179.60	-
	LESS 10% DISCOUNT		-878.43	-147.71
			7,905.87	1,329.39
<u>SPECIAL NETT ITEMS</u>				
1	SET FENDER CLIP (SN)	NOT NECESSARY	65.00	-
1	SET FENDER LINER CLIP (SN)	NECESSARY	60.00	60.00
1	DOOR STICKER TRANSCAB (SN)	NECESSARY	100.00	60.00
1	DOOR STICKER CLASSIC (SN)	NECESSARY	100.00	15.00
1	BUMPER CLIP FRT (SN)	NECESSARY	85.00	66.00
1	BUMPER RETAINER CLIP FRT (SN)	NOT NECESSARY	70.00	-
1	SET BUMPER BRACKET CTR CLIP (SN)	NOT NECESSARY	33.00	-
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-

Report Ref No. CC4/LPC21004501/Kps3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	BUMPER CLIP FRT (SN)	NOT NECESSARY	85.00	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	70.00	-
			728.00	201.00
	LABOUR			
	TO REMOVE AND REFIT REAR BIG AND SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	300.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		3,000.00	660.00
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BUMPER BEAM FRT,DOOR PANEL FRT RH ,DOOR HINGE UPPER FRT RH AND DOOR HINGE LOWER FRT RH .		3,000.00	500.00
	TO RUST-PROOFING OF THE AFFECTED AREAS .		170.00	30.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .	NOT NECESSARY	170.00	-
	TO TRANSFER OF BOOTLID FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX ,RENEW THE SAME ,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST .	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	15.00
			7,880.00	1,265.00
GRAND TOTAL			16,513.87	2,795.39



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			2,250.00
---	--	--	-----------------

Report Ref No. CC4/LPC21004501/Kps3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 317X

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

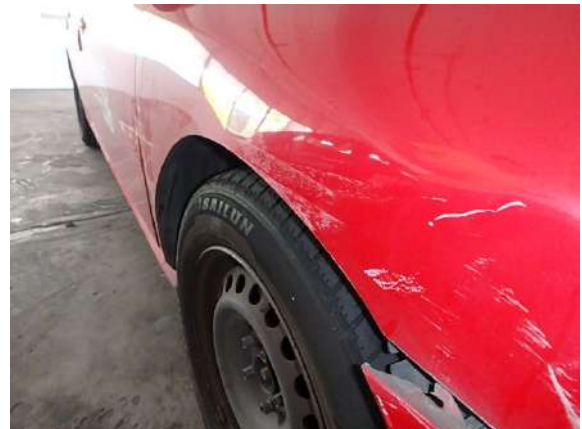



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

