

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21004611/GTF3N2**Date:** 15/12/2021REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00069152000
Claimant Vehicle No : SLH4123T **Insured Vehicle No :** GBH101B
 Date of Loss: 01/04/2021 Nature of Claim: TP **Claim No:** SNM21D201931/C02/LEWLC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLH4123T**
 Make & Model: HONDA SHUTTLE, 1.5 (A) Engine No: LEB4263113
 Reg. Date: 02/11/2016 (Man. Year: 2016) Chassis No: GP71043301
 Colour: Silver Odometer: 0 km
 Engine Capacity: 1496 cc
 Market Value/New Car Price: N/A
 Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 185/60R15 Rear Tyre Size: 185/60R15
 Front Left Side: ROADMARCH 6 mm Rear Left Side: ROADMARCH 6 mm
 Front Right Side: ROADMARCH 6 mm Rear Right Side: ROADMARCH 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	30,749.28	18,358.96	12,390.32	40.29
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,030.00	4,090.00	3,940.00	49.07
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	38,779.28	22,448.96	16,330.32	42.11
Approved Total (Overridden) (\$\$)		17,950.00		
	38,779.28	17,950.00	20,829.28	53.71
+ GST 7.00/7.00% (\$\$)	2,714.55	1,256.50	1,458.05	53.71
Nett Amount (\$\$)	41,493.83	19,206.50	22,287.33	53.71

INSPECTION

Date of Assignment: 12/04/2021
 Date Inspected: 12/04/2021 Inspected At: 60 JALAN LAM HUAT# 04-35/36
 CARROS CENTRE, 737869
 SINGAPORE.
 REPAIRER: LION CITY RENTALS PTE LTD
 Estimated Period of Repair: 10.0 days

Adjuster: XING GUO QIANG**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 15 Dec 2021)	
Parts:	N/A	HONDA SHUTTLE 1.5 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLH4123T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT WINDSCREEN GLASS	Cracked	2,300.00 FL	*1,850.00 FL
2	1		*FRONT BONNET	Buckled	1,380.00 FL	*1,080.00 FL
3	1		*FRONT BONNET LH HINGE	Bent	60.00 FL	*60.00 FL
4	1		*FRONT BONNET RH HINGE	Bent	60.00 FL	*60.00 FL
5	1		*FRONT BONNET INSULATOR	Deformed	165.00 FL	*135.00 FL
6	1		*FRONT BONNET LOCK ASSY	Bent	195.00 FL	*158.00 FL
7	1		*FRONT BONNET LOCK CATCH	Bent	150.00 FL	*75.00 FL
8	1		*FRONT BONNET SEAL	Twisted	75.00 FL	*75.00 FL
9	1		*F/L FENDER	Buckled	1,100.00 FL	*489.90 FL
10	1		*F/R FENDER	Repair	1,100.00 FL	*- FL
11	1		*F/L FENDER INNER LINER	Torn	240.00 FL	*110.00 FL
12	1		*F/R FENDER INNER LINER	Torn	240.00 FL	*110.00 FL
13	1		*F/FENDER HYBRID EMBLEM	Necessary	86.80 FL	*86.80 FL
14	1		*F/R FENDER HYBRID EMBLEM	Necessary	86.80 FL	*86.80 FL
15	1		*FRONT SUPPORT PANEL TOP COVER	Deformed	250.00 FL	*95.00 FL
16	1		*FRONT SUPPORT PANEL	Distorted	1,050.00 FL	*790.00 FL
17	1		*RADIATOR GRILLE CENTER MOULDING	Distorted	390.00 FL	*228.00 FL
18	1		*RADIATOR GRILLE BASE	Distorted	325.00 FL	*248.00 FL
19	1		*RADIATOR GRILLE LOWER MOULDING	Distorted	330.00 FL	*198.00 FL
20	1		*RADIATOR GRILLE EMBLEM	Distorted	48.00 FL	*48.00 FL
21	1		*F/L HEADLAMP	Distorted	1,215.00 FL	*780.00 FL
22	1		*F/R HEADLAMP	Distorted	1,215.00 FL	*780.00 FL
23	1		*F/L HEADLAMP LOWER BRACKET	Distorted	115.00 FL	*64.00 FL
24	1		*F/R HEADLAMP LOWER BRACKET	Distorted	115.00 FL	*64.00 FL
25	1		*FRONT BUMPER	Distorted	1,350.00 FL	*1,100.00 FL
26	1		*FRONT BUMPER REINFORCEMENT	Bent	660.00 FL	*485.80 FL
27	1		*FRONT BUMPER RH TOW COVER	Cut	54.00 FL	*25.00 FL
28	1		*FRONT BUMPER RH SIDE RETAINER	Cut	21.00 FL	*21.00 FL
29	1		*FRONT BUMPER LH SIDE RETAINER	Cut	21.00 FL	*21.00 FL
30	1		*FRONT BUMPER RH FOG LAMP COVER	Cut	150.00 FL	*75.00 FL
31	1		*FRONT BUMPER LH FOG LAMP COVER	Cut	150.00 FL	*75.00 FL
32	1		*FRONT BUMPER LOWER GRILLE	Distorted	294.00 FL	*122.00 FL
33	1		*FRONT WINDSCREEN WASHER TANK	Deformed	250.00 FL	*147.50 FL
34	1		*FRONT RH WHEEL HOUSE UPPER MEMBER	Repair	480.00 FL	*- FL
35	1		*FRONT RH WHEEL HOUSE LOWER EXTENSION	Repair	480.00 FL	*- FL
36	1		*RADIATOR ASSY	Bent	1,800.00 FL	*1,311.90 FL
37	1		*AIR CON CONDENSER	Bent	900.00 FL	*900.00 FL
38	1		*RADIATOR FAN MOTOR	Not Necessary	850.00 FL	*- FL
39	1		*AIRCON CONDENSER MOTOR	Not Necessary	700.00 FL	*- FL
40	1		*RADIATOR SHROUD	Cracked	250.00 FL	*125.00 FL
41	1		*INLET MANIFOLD	Cracked	480.00 FL	*380.00 FL
42	1		*DRIVER AIR BAG	Activated	3,000.00 FL	*1,850.00 FL
43	1		*PASSENGER AIR BAG	Activated	3,000.00 FL	*2,480.00 FL
44	1		*DASHBOARD	Activated	2,000.00 FL	*2,000.00 FL
45	1		*SRS ECU	Activated	2,030.00 FL	*1,580.00 FL
46	1		*F/R CRASH SENSOR	Activated	200.00 FL	*185.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*F/L CRASH SENSOR	Activated	200.00 FL	*185.00 FL
48	1		*F/L SAFETY BELT	Activated	750.00 FL	*750.00 FL
49	1		*F/R SAFETY BELT	Activated	750.00 FL	*750.00 FL
50	1		*F/L SAFETY BELT BUCKLE	Not Necessary	120.00 FL	*- FL
51	1		*F/R SAFETY BELT BUCKLE	Not Necessary	120.00 FL	*- FL
52	1		*STEERING REEL COIL	Not Necessary	400.00 FL	*- FL
53	1		*FRONT AIR CON PIPE (HIGH PRESSUE)	Bent	350.00 FL	*150.00 FL
54	1		*FRONT AIR CON PIPE (RUBBER HOSE)	Twisted	250.00 FL	*120.00 FL
55	1		*FRONT AIR CON PIPE	Bent	200.00 FL	*100.00 FL
56	1		*FRONT WATER PUMP	Not Necessary	450.00 FL	*- FL
57	1		*FRONT AIR CON COMPRESSOR	Not Necessary	1,500.00 FL	*- FL
58	1		*FRONT RESONATOR BOX	Cracked	250.00 FL	*188.00 FL
59	1		*FRONT EXPANSION TANK	Not Necessary	160.00 FL	*- FL
60	1		*FRONT STATOR MOTOR	Not Necessary	750.00 FL	*- FL
61	1		*SET FRONT WINDSCREEN SEALANT	Necessary	120.00 FS	*50.00 FS
62	1		*SET BODY SEALANT	Not Necessary	300.00 FS	*- FS
63	1		*SET FRONT BUMPER CLIPS	Necessary	120.00 FS	*30.00 FS
64	1		*SET FRONT NUMBER PLATE	Bent	80.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	38,281.60	22,918.70
- List Item Discount on L Items 20.00/20.00% (\$)	7,532.32	4,559.74
Total Parts (\$)	30,749.28	18,358.96

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE FRONT SUPPORT PANEL,FRONT BONNET,FRONT BUMPER,F/R WHEEL HOUSING UPPER MEMBER AND F/R CHASSIS OUTER MEMBER OUT TO FACILITATE REPAIRS AND REPLACEMENT OF DAMAGED PARTS ALSO INCDE CUTTING AND WELDING OF DAMAGED PARTS	New	2,500.00	1,750.00
2	TO RESPRAY FRONT BONNET,BOTH FRONT FENDERS,SUPPORT PANEL,F/R WHEELHOUSE AND FRONT BUMPER (INNER/OUTER)	New	1,800.00	1,320.00
3	TO REMOVE & INSTALL FRONT WINDSCREEN	New	160.00	120.00
4	TO APPLY RUSTPROOFING/TUFFCOATING TREATMENT TO REPLACED PARTS	New	80.00	60.00
5	TO ACTIVATE AND DEACTIVATE HIGH VOLTAGE HYBRID BATTERY AS A REQUIREMENT FOR SAFETY PRECAUTIONS	New	300.00	200.00
6	TO CONDUCT A STANDARD OF OPERATING PROCEDURES POST REPAIRS DIAGNOSTIC SCAN TEST AS A REQUIREMENTFOR HYBRID CARS UPON COMPLETION OF COLLISON REPAIRS	New	300.00	120.00
7	TO LABOUR CHARGE FOR REMOVING AND INSTALLING ENGINE ASSY OUT TO FACILITATE REPAIRS AND REPLACEMENT OF DAMAGED PARTS	New	500.00	0.00
8	TOWING FEE	New	50.00	0.00
9	TO LABOUR CHARGE FOR PREMOVING AIR CON SYSTEM OUT TO FACILITATE REPLACEMENT OF DAMAGED PARTS AND INCLUDE VACUUMING OF AIR CON GAS	New	300.00	120.00
10	TO LABOUR CHARGE FOR REMOVING AND INSATTING DASHBOARD TO FACILITATE REPLACEMENT OF SRS AIR BAG	New	500.00	200.00
11	TO CONFIGURE AND REPROGRAM SRS AIR BAG ECU BACK TO FACTORY SPECIFICATION	New	500.00	200.00
12	TO REMOVE AND INSTALL FRONT ENGINE ASSY OUT TO FACILITATE REPAIRS AND REPLACEMENT OF DAMAGED PARTS	New	500.00	0.00
13	TO LABOUR CHARGE FOR REMOVING AIR CON SYSTEM OUT TO FACILITATE REPLACEMENT OF DAMAGED AIR CON PARTS.ALSO INCLUDE VACUUMING AND RENEWING AIR CON GAS	New	380.00	0.00
14	TO REMOVE AND INSTALL FRONT WINDSCREEN GLASS	New	160.00	0.00
Gross Labour Cost (\$)			8,030.00	4,090.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >