

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/AIG21004644/KVF3E2

Date: 06/10/2021

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2070150334
Claimant Vehicle No :	SMX1570J	Insured Vehicle No :	SDD6009T
Date of Loss:	10/04/2021	Nature of Claim:	TP
		Claim No:	2934275508SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMX1570J	Engine No:	LEB5907120
Make & Model:	HONDA VEZEL, 1.5 (A)	Chassis No:	RU31207110
Reg. Date:	02/09/2016 (Man. Year: 2016)	Odometer:	75190 km
Colour:	Metallic Pearl Red		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60 R17	Rear Tyre Size:	215/60 R17
Front Left Side:	Michelin 3 mm	Rear Left Side:	Michelin 3 mm
Front Right Side:	Michelin 3 mm	Rear Right Side:	Michelin 3 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	20,636.32	10,919.81	9,716.51	47.08
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,820.00	4,110.00	1,710.00	29.38
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	26,456.32	15,029.81	11,426.51	43.19
Approved Total (Overridden) (S\$)		12,800.00		
Nett Amount (S\$)	26,456.32	12,800.00	13,656.32	51.62

INSPECTION

Date of Assignment:	13/04/2021		
Date Inspected:	13/04/2021	Inspected At:	160 Sin Ming Auto City, #08-13 Repairer: Aero Garage Pte Ltd
Estimated Period of Repair:	12.0 days		

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Bent	1,140.00 FL	*953.00 FL
2	1		*TAILGATE WINDSCREEN MOULDING	Necessary	198.00 FL	*198.00 FL
3	1		*TAILGATE WINDSCREEN INNER SEAL	Necessary	48.00 FS	*30.00 FS
4	1		*TAILGATE BADGE	Necessary	65.50 FL	*65.50 FL
5	1		*TAILGATE VEZEL EMBLEM	Necessary	89.80 FL	*89.80 FL
6	1		*TAILGATE HYBRID EMBLEM	Necessary	94.50 FL	*94.50 FL
7	1		*TAILGATE OUTER GARNISH	Serviceable	49.50 FL	*- FL
8	2		*TAILGATE NUMBER PLATE LAMPS	Serviceable	156.00 FL	*- FL
9	1		*TAILGATE OPENER SWITCH	Serviceable	214.50 FL	*- FL
10	1		*TAILGATE LAMPS	Broken	398.70 FL	*398.70 FL
11	1		*TAILGATE STOPPER	Necessary	3.00 FL	*3.00 FL
12	1		*TAILGATE INNER TRIM	Cracked	476.70 FL	*368.20 FL
13	1		*TAILGATE INNER SIDE TRIM	Serviceable	268.20 FL	*- FL
14	1		*TAILGATE INNER TOP TRIM	Serviceable	298.90 FL	*- FL
15	1		*TAILGATE POCKET HANDLE	Serviceable	98.90 FL	*- FL
16	1		*TAILGATE INNER LOCK	Dented	678.00 FL	*678.00 FL
17	1		*TAILGATE LOCK CATCH	Repair	79.00 FL	*- FL
18	1		*TAILGATE WEATHERSTRIP (\$276.90) (50%)	Distorted / Dented	221.52 FS	*138.45 FS
19	1		*TAILGATE AUTO LOCK ACTUATOR	Serviceable	319.20 FL	*- FL
20	2		*TAILGATE HINGES	Repair	228.00 FL	*- FL
21	1		*TAILGATE ABSORBERS	O/S Punctured	535.80 FL	*192.50 FL
22	1		*TAILLAMPS	O/S Cracked	568.80 FL	*284.40 FL
23	1		*TAILLAMPS INNER SEALER	O/S Necessary	35.00 FL	*17.50 FL
24	1		*TAILLAMPS INNER PANEL RH	Bent	168.00 FL	*168.00 FL
25	1		*REAR BUMPER	Bent	698.20 FL	*762.70 FL
26	1		*REAR BUMPER SIDE RETAINERS	O/S Cracked	197.80 FL	*78.40 FL
27	1		*REAR BUMPER ATTACHEMENT RETAINERS	O/S Cracked	264.40 FL	*132.20 FL
28	1		*REAR BUMPER REFLECTORS LAMPS	O/S Cracked	355.80 FL	*110.00 FL
29	1		*REAR BUMPER SIDE PAD	O/S Bent	469.80 FL	*195.00 FL
30	1		*REAR BUMPER UNDER COVER	Distorted / Buckled	349.90 FL	*250.00 FL
31	1		*REAR AIR VENTS	Dented	278.90 FL	*120.70 FL
32	1		*END PANEL	Bent	512.80 FL	*415.60 FL
33	1		*END PANEL TOP TRIM	Distorted	258.90 FL	*188.00 FL
34	1		*REAR FLOOR PANEL	Repair	898.00 FL	*- FL
35	1		*REAR FLOOR PANEL TOP BOARD	Deformed	356.70 FL	*356.70 FL
36	1		*REAR FLOOR PANEL TOP TOOL SPONGE	Cracked	413.20 FL	*413.20 FL
37	1		*SPARE TYRE UNDER DUST COVER	Cracked	368.70 FL	*368.70 FL
38	1		*REAR CHASSIS FRAME MEMBER RH	Repair	523.40 FL	*- FL
39	1		*REAR FENDER RH	Buckled	1,096.00 FL	*988.50 FL
40	1		*REAR FENDER INNER TRIM RH	Deformed	499.20 FL	*365.80 FL
41	1		*REAR FENDER INNER TOP TRIM RH	Serviceable	345.60 FL	*- FL
42	1		*REAR FENDER QUARTER GARNISH RH	Serviceable	128.00 FL	*- FL
43	1		*REAR FENDER ARCH GARNISH RH	Buckled	268.90 FL	*199.10 FL
44	1		*REAR FENDER INNER SHIELD	O/S Cracked	199.60 FL	*99.80 FL
45	1		*REAR EXHAUST SILENCER	Bent	900.00 FL	*785.20 FL
46	2		*REAR EXHAUST MOUNTINGS	Distorted	92.00 FL	*66.00 FL
47	1		*REAR EXHAUST GASKET	Necessary	48.00 FL	*48.00 FL
48	1		*CENTER EXHAUST PIPE	Bent	950.00 FL	*950.00 FL
49	2		*CENTER EXHAUST MOUNTINGS	Serviceable	92.00 FL	*- FL
50	1		*CENTER EXHAUST GASKET	Necessary	48.00 FL	*48.00 FL
51	1		*REAR KEY ANTENNA SENSOR	Serviceable	197.80 FL	*- FL
52	1		*ALARM SENSOR SPEAKER	Serviceable	234.20 FL	*- FL
53	1		*REAR RETRACTABLE BOARD	Serviceable	427.70 FL	*- FL
54	1		*REAR SHOCK ABSORBER RH	Bent	425.00 FL	*292.30 FL
55	1		*REAR WHEEL BEARING RH	Necessary	353.50 FL	*353.50 FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1		*REAR LOWER ARM RH	No such part	456.40 FL	*- FL
57	1		*REAR KNUCKLE ARM RH	No such part	345.80 FL	*- FL
58	1		*REAR AXLE BEAM	Bent	2,902.80 FL	*1,490.70 FL
59	1		*TAILGATE WINDSCREEN SEALANT	Necessary	60.00 FS	*40.00 FS
60	1		*SET TAILGATE LAMP CLIPS	Not Necessary	50.00 FS	*- FS
61	1		*SET TAILGATE INNER TRIM CLIPS	Necessary	60.00 FS	*60.00 FS
62	1		*TAILGATE OUTER GARNISH CLIPS	Not Necessary	50.00 FS	*- FS
63	1		*REAR NUMBER PLATE WITH COVER	Serviceable	120.00 FS	*- FS
64	1		*SET REAR BUMPER CLIPS	Necessary	60.00 FS	*60.00 FS
65	1		*SET REAR BUMPER UNDER COVER CLIPS	Necessary	60.00 FS	*60.00 FS
66	1		*SET END PANEL TOP TRIM CLIPS	Necessary	60.00 FS	*60.00 FS
67	1		*SET TAILLAMP CLIPS	O/S Necessary	50.00 FS	*20.00 FS
68	1		*SET REAR FENDER INNER TRIM CLIPS	Necessary	60.00 FS	*60.00 FS
69	1		*SET REAR FENDER INNER SIDE TRIM CLIPS	Not Necessary	60.00 FS	*- FS
70	1		*SET REAR FENDER INNER TOP TRIM CLIPS	Not Necessary	60.00 FS	*- FS
71	1		*SET REAR FENDER ARCH GARNISH CLIPS	Necessary	60.00 FS	*60.00 FS
72	1		*SET REAR FENDER INNER SHIELD CLIPS	Not Necessary	60.00 FS	*- FS
73	1		*SET REVERSE SENSOR	Dented / Shorted	280.00 FS	*200.00 FS
74	1		*REAR SPORT RIM RH	Serviceable	450.00 FS	*- FS
75	1		*REAR TYRE RH	Serviceable	350.00 FS	*- FS
76	1		*SET BODY PANEL JOINT SEALANT	Necessary	120.00 FS	*60.00 FS
77	1		*REAR FLOOR PANEL INSULATOR PAD	Not Necessary	150.00 FS	*- FS
78	1		*REAR FLOOR PANEL TOP INSULATOR TRAY	Not Necessary	450.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	25,060.52	13,437.65
- List Item Discount on L Items 20.00/20.00% (S\$)	4,424.20	2,517.84
Total Parts (S\$)	20,636.32	10,919.81

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	2,000.00	1,600.00
2	SPRAY PAINTING	New	1,800.00	1,400.00
3	CHECK WIRING	New	100.00	20.00
4	ANTI RUST	New	180.00	90.00
5	TOWING FEES. (KING DOLLY)	New	150.00	120.00
6	REMOVE AND INSTALL REAR WINDSCREEN	New	140.00	120.00
7	REMOVE AND INSTALL TAILGATE PARTS	New	90.00	60.00
8	REMOVE AND INSTALL CARPET AND SEAT	New	150.00	120.00
9	REMOVE AND INSTALL REVERSE SENSOR	New	90.00	50.00
10	REMOVE AND INSTALL REAR UNDERCARRIAGE	New	650.00	220.00
11	TO PERFORM COMPUTERIZE WHEEL ALIGNMENT	New	90.00	60.00
12	TO JACK AND ALIGNMENT CHASSIS FRAME MEMBER	New	380.00	250.00
Gross Labour Cost (\$)			5,820.00	4,110.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >