



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJG 4927U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	CRUMPLED	598.00	468.00
1	FRONT BUMPER SIDE RETAINER LH	BROKEN	45.00	45.00
1	FRONT BUMPER FOGLAMP CHROME LH	SCRATCHED	159.00	108.00
1	FRONT BUMPER FOGLAMP LH	SERVICEABLE	321.00	-
1	HEADLAMP LH	SCRATCHED	698.00	580.00
1	HEADLAMP TOP PANEL LH	SERVICEABLE	212.00	-
1	FRONT FENDER LH	DENTED	498.00	498.00
1	FRONT FENDER TOP GARNISH LH	SERVICEABLE	49.00	-
1	FRONT FENDER INNER COWLING LH	DEFORMED	159.00	110.00
1	SIDE MIRROR LH	SERVICEABLE	587.00	-
1	FRONT DOOR LH	SERVICEABLE	869.40	-
1	FRONT DOOR WEATHERSTRIP LH	SERVICEABLE	198.20	-
1	FRONT WHEEL HUP LH	SERVICEABLE	395.00	-
1	FRONT KNUCKLE ARM LH	BENT	376.20	376.20
1	FRONT KNUCKLE ARM BEARING LH	JAMMED	179.50	131.40
1	FRONT LOWER ARM LH	SERVICEABLE	394.70	-
1	FRONT STABILIZER BAR LH	SERVICEABLE	498.20	-
1	FRONT SHOCK ABSORBER LH	SERVICEABLE	412.30	-
1	FRONT ABS SENSOR LH	SERVICEABLE	212.00	-
	LESS 25% DISCOUNT		-1,715.37	-579.15
			5,146.13	1,737.45
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	FRONT FENDER SEALANT (SN)	NECESSARY	80.00	30.00
1	SET FRONT FENDER COWLING CLIPS (SN)	NECESSARY	50.00	20.00
1	SET FRONT DOOR INNER TRIM CLIPS (SN)	SERVICEABLE	50.00	-
1	FRONT TYRE LH (SN)	SERVICEABLE	350.00	-
1	FRONT SPORTS RIM LH (SN)	CUT	800.00	300.00
1	BRAKE OIL (SN)	SERVICEABLE	30.00	-
			1,410.00	380.00

Report Ref No. CS/SMR21004756/Quf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	SPRAY PAINTING ON AFFECTED AREAS.		800.00	400.00
	PANEL BEATING ON AFFECTED AREAS.		800.00	400.00
	TO CHECK ELECTRICAL WIRING.		150.00	30.00
	REMOVE AND REFIT FRONT UNDER CARRIAGE.		350.00	100.00
	REFOCUS HEADLAMP BEAM.	NOT NECESSARY	80.00	-
	CONDUCT FULL WHEEL ALIGNMENT.		120.00	60.00
	APPLY ANTI RUST ON AFFECTED AREAS.		200.00	30.00
			2,500.00	1,020.00
	GRAND TOTAL		9,056.13	3,137.45
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,500.00

Report Ref No. CS/SMR21004756/Quf3n2

OI SUN PIN

Asst. Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.