



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105371

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 01/08/2021
Reference CC3/CTI21004781/Qea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 5555C
Insured Veh. SMZ 112U
Claim No. SNM21D202136/C02
Policy No. DMPCSNW00056282100
Accident Date 13/04/2021
Inspection Date 14/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21004781/Qea3q2 Date: 01/08/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMZ 112U	Veh. Inspected	SHB 5555C
	Policy No.	DMPCSNW00056282100	Coverage (\$)	0.00
	Claim No.	SNM21D202136/C02	Excess (\$)	0.00
	Assign From		Assign Date	14/04/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS 4	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	JTDKB3FUX03575669	Colour	MAROON
	Odometer	410269 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	ATREZZO	6 mm
	L/H Front Tyre	195/65 R15	ATREZZO	6 mm
	R/H Rear Tyre	195/65 R15	ATREZZO	6 mm
	L/H Rear Tyre	195/65 R15	ATREZZO	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	13/04/2021	Inspection Date	14/04/2021
	Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5555C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
10	CLIPS PIECE,FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
1	GRILLE SUB-ASSY (DISC 25%)	CRUMPLED	335.60	251.70
1	EMBLEM ASSY FRONT (DISC 25%)	NECESSARY	87.10	65.33
1	SEAL ,HOOD TO FR END (DISC 25%)	CRUMPLED	24.40	18.30
1	COVER ,FR BUMPER (DISC 25%)	CRUMPLED	495.50	371.63
1	EMBLEM SUB-ASSY REAR (DISC 25%)	NECESSARY	46.30	34.73
1	TAIL GATE LOCK COVER ,BACK DOOR (DISC 25%)	CRUMPLED	25.30	18.98
2	TAIL GATE DAM ,BACK DOOR GLASS UPPER @\$27.90 (DISC 25%)	NECESSARY	55.80	41.85
1	TAIL GATE LOWER GLASS SUB-ASSY ,BACK DOOR (DISC 25%)	BROKEN	725.90	544.43
1	NAME PLATE (PRIUS) LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	52.30	39.23
1	NAME PLATE (HYBRID) LUGGAGE COMPARTMENT (DISC 25%)	NECESSARY	52.30	39.23
1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB (DISC 25%)	CRUMPLED	891.20	668.40
1	TAIL GATE WEATHERSTRIP ,BACK DOOR (DISC 25%)	CRUMPLED	360.70	270.53
1	TAIL GATE PANEL SUB- ASSY ,BACK DOOR (DISC 25%)	DENTED	929.60	697.20
1	COVER ,REAR FLOOR UNDER CENTER (DISC 25%)	CRACKED	222.60	166.95
1	COVER ,REAR FLOOR UNDER ,RH (DISC 25%)	MISSING	169.50	127.13
1	COVER ,GUARD RR BUMPER LOWER (DISC 25%)	CRUMPLED	14.80	11.10
1	GUARD ,RR BUMPER ,LOWER (DISC 25%)	CRUMPLED	558.30	418.73
10	CLIPS PIECE ,FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
1	RETAINER ,RR BUMPER LH (DISC 25%)	BROKEN	111.50	83.63
1	RETAINER ,RR BUMPER RH (DISC 25%)	BROKEN	112.70	84.53
3	PAD ,RR BUMPER ,CTR @\$2.20 (DISC 25%)	NECESSARY	6.60	4.95
2	PAD ,RR BUMPER ,RH & LH 3 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD ,RR BUMPER ,RH & LH 2 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
2	PAD ,RR BUMPER ,RH & LH 1 @\$3.80 (DISC 25%)	NECESSARY	7.60	5.70
1	REAR BUMPER REINFORCEMENT (DISC 25%)	BENT	318.80	239.10
1	COVER ,RR BUMPER ASSY (DISC 25%)	CRUMPLED	423.90	317.93
1	FILLER ,RR BUMPER LH (DISC 25%)	CRUMPLED	119.90	89.93

Report Ref No. CC3/CTI21004781/Qea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE TRIM LOWER (DISC 25%)	CRUMPLED	218.50	163.88
1	END PANEL SUB-ASSY ,BODY LOWER BACK (DISC 25%)	CRUMPLED	629.80	472.35
1	ABSORBER ,FR BUMPER (DISC 25%)	CRUMPLED	70.30	52.73
1	GRILLE RADIATOR (DISC 25%)	CRUMPLED	165.00	123.75
1	COVER ASSY ,ENGINE (DISC 25%)	CRUMPLED	180.10	135.08
1	SUPPORT S/A UPPER (DISC 25%)	CRUMPLED	364.90	273.68
1	SUPPORT S/A RH (DISC 25%)	BENT	237.00	177.75
1	SUPPORT S/A LH (DISC 25%)	BENT	237.00	177.75
1	SUPPORT SUB-ASSY LOWER (DISC 25%)	CRUMPLED	397.40	298.05
1	END PANEL COVER ,DECK TRIM ,REAR (DISC 25%)	CRUMPLED	122.80	92.10
1	PANEL ASSY ,DECK TRIM SIDE ,RH (DISC 25%)	CRUMPLED	344.70	258.53
1	BOARD ,REAR FLOOR ,NO.1 (DISC 25%)	CRUMPLED	502.20	376.65
1	REAR BUMPER PROTECTOR CHROME MOULDING (DISC 50%)	CRUMPLED	200.00	100.00
1	TAIL GATE LOCK ASSY ,BACK DOOR (DISC 10%)	JAMMED	452.10	406.89
1	LENS & BODY ASSY ,RR BUMPER RH (DISC 10%)	CRUMPLED	486.80	438.12
1	LENS & BODY ,REAR COMBINATION LAMP ,RH (DISC 10%)	CRUMPLED	438.10	394.29
1	UNIT ,HEADLAMP LH (DISC 10%)	CRACKED	2,558.90	2,303.01
1	UNIT ,HEADLAMP RH (DISC 10%)	SCRATCHED	2,558.90	2,303.01
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
3	SEALANT W/SCREEN @\$37.00 (SN)	NECESSARY	111.00	111.00
1	SENSOR REVERSE (SN)	SHORTED	180.00	180.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	NUMBER PLATE (SN)	DENTED	35.00	35.00
3	SPARE TYPE INSULATOR SHEET @\$15.00 (SN)	NECESSARY	45.00	45.00
1	COVER ASSY ,ENGINE	SERVICEABLE	180.10	-
1	SET COVER ASSY ,ENGINE UNDER CENTER	SERVICEABLE	452.80	-
1	COVER ,ENGINE UNDER CENTER	SERVICEABLE	94.50	-
1	LAMP ASSY ,FOG, RH	SERVICEABLE	910.20	-
1	LAMP ASSY ,FOG, LH	SERVICEABLE	910.20	-
1	UNIT ,HEADLAMP ,LH	SERVICEABLE	2,558.90	-
1	UNIT ,HEADLAMP ,RH	SERVICEABLE	2,558.90	-

Report Ref No. CC3/CTI21004781/Qea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	COMPUTER SUB-ASSY ,HEADLAMP LH NO.1	SERVICEABLE	486.40	-
1	GRILLE ,RADIATOR	SERVICEABLE	165.00	-
1	ABSORBER FR BUMPER LOWER	SERVICEABLE	117.00	-
1	REINFORCEMENT FRONT LOWER	SERVICEABLE	238.50	-
1	EXTENSION SUB-ASSY ,RH	SERVICEABLE	116.30	-
1	EXTENSION SUB-ASSY ,LH	SERVICEABLE	116.30	-
1	ABSORBER ,FR BUMPER	SERVICEABLE	70.30	-
1	REINFORCEMENT FRONT UPPER	SERVICEABLE	691.10	-
1	NUMBR PLATE FRAME	SERVICEABLE	25.00	-
1	NUMBER PLATE	SERVICEABLE	35.00	-
1	NUMBER PLATE FRAME	SERVICEABLE	25.00	-
1	NUMBER PLATE	SERVICEABLE	35.00	-
1	BRACKET ,FR BUMPER	SERVICEABLE	99.80	-
1	COVER ,FR BUMPER LH	SERVICEABLE	28.10	-
1	COVER ,FR BUMPER RH	SERVICEABLE	28.10	-
1	SUPPORT ,FR BUMPER LH	SERVICEABLE	82.30	-
1	SUPPORT ,FR BUMPER RH	SERVICEABLE	76.90	-
1	SEALANT SIKAFLEX	SERVICEABLE	37.00	-
1	SPARE TYRE PANEL ,PAN REAR FLOOR	SERVICEABLE	564.80	-
1	END PANEL SUB-ASSY ,BODY LOWER BACK	SERVICEABLE	629.80	-
1	WIRE ,TAIL GATE BACK DOOR ,NO.2	SERVICEABLE	246.80	-
1	WIRE ,TAIL GATE BACK DOOR	SERVICEABLE	246.80	-
1	LAMP SET ,STOP CENTER	SERVICEABLE	186.50	-
1	SPOILER SUB-ASSY ,REAR	SERVICEABLE	1,322.10	-
2	TAIL GATE BACK DOOR HINGE ASSY ,RH & LH	SERVICEABLE	59.10	-
1	TAILGATE BOARD ,COVER	SERVICEABLE	24.10	-
1	TAILGATE BOARD ASSY	SERVICEABLE	251.50	-
1	TAILGATE TRIM ,LOWER	SERVICEABLE	218.50	-
1	TAILGATE TRIM LH	SERVICEABLE	92.10	-
1	TAILGATE TRIM RH	SERVICEABLE	92.10	-
1	TAILGATE TRIM ,UPPER	SERVICEABLE	50.50	-
1	TAIL GATE GLASS SUB ASSY ,BACK DOOR	SERVICEABLE	1,569.70	-
1	COVER ,REAR FLOOR UNDER ,LH	SERVICEABLE	234.30	-

Report Ref No. CC3/CTI21004781/Qea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	COVER ,REAR COMBINATION LAMP LH	SERVICEABLE	54.00	-
1	COVER ,REAR COMBINATION LAMP RH	SERVICEABLE	54.00	-
1	LENS & BODY ASSY ,RR BUMPER LH	SERVICEABLE	486.80	-
1	LENS & BODY ,REAR COMBINATION LAMP ,LH	SERVICEABLE	438.10	-
1	ANTENNA ELECTRICAL KEY	SERVICEABLE	60.30	-
1	FILLER ,RR BUMPER ,LH	SERVICEABLE	119.90	-
1	FILLER ,RR BUMPER ,RH	SERVICEABLE	119.90	-
1	SEAL ,RR BUMPER ,LH	SERVICEABLE	85.20	-
1	SEAL ,RR BUMPER ,RH	SERVICEABLE	85.20	-
2	SEAL ,RR BUMPER ARM ,RH & LH	SERVICEABLE	11.00	-
1	COMPUTER SUB-ASSY ,HEADLAMP RH NO.1	SERVICEABLE	486.40	-
1	PAD ,FR WHEEL LH	SERVICEABLE	57.70	-
1	LINER ,FR FENDER ,LH	SERVICEABLE	194.30	-
1	EMBLEM SIDE PANEL (HYBRID)	SERVICEABLE	52.90	-
1	FENDER SUB-ASSY ,FR ,LH	SERVICEABLE	933.10	-
1	PAD ,FR WHEEL RH	SERVICEABLE	57.70	-
1	LINER ,FR FENDER ,RH	SERVICEABLE	198.40	-
1	EMBLEM SIDE PANEL (HYBRID)	SERVICEABLE	52.90	-
1	FENDER SUB-ASSY ,FR ,RH	SERVICEABLE	933.10	-
1	INLET AIR CLEANER NO.2	SERVICEABLE	93.90	-
1	INLET AIR CLEANER NO.3	SERVICEABLE	35.30	-
1	SUPPORT RADIATOR UPPER LH	SERVICEABLE	76.70	-
1	SUPPORT RADIATOR UPPER RH	SERVICEABLE	76.70	-
1	SUPPORT SUB-ASSY LOWER	SERVICEABLE	397.40	-
1	SUPPORT S/A LH	SERVICEABLE	237.00	-
1	SUPPORT S/A RH	SERVICEABLE	237.00	-
1	SUPPORT S/A UPPER	SERVICEABLE	364.90	-
1	BRACE ,HOOD LOCK SUPPORT	SERVICEABLE	76.20	-
1	HINGE ASSY ,HOOD ,LH	SERVICEABLE	57.00	-
1	HINGE ASSY ,HOOD ,RH	SERVICEABLE	57.00	-
1	HOOD SUB-ASSY	TO REPAIR SEE LABOUR	938.40	-
			39,934.10	13,713.14

Report Ref No. CC3/CTI21004781/Qea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING & BODY WORK.INCLUSIVE OF THE REPAIR OF HOOD SUB-ASSY .		2,521.00	1,400.00
	SPRAY PAINT.		4,588.00	1,300.00
	TO REMOVE AND REFIX REAR WINDSCREEN .		120.00	100.00
	TO REMOVE AND REFIX TAILGATE GLASS .		120.00	60.00
	TO TRANSFER REAR TAILGATE MECHANISM .		120.00	60.00
	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM.	NOT NECESSARY	350.00	-
	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM.		125.00	125.00
	TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR .		120.00	30.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	30.00
	TO CHECK WIRING AND SYSTEM FUNCTION .		80.00	20.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
	TO APPLY RUST-PROOFING ON AFFECTED AREA.		100.00	30.00
			8,524.00	3,155.00
	GRAND TOTAL		48,458.10	16,868.14
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			14,150.00

Report Ref No. CC3/CTI21004781/Qea3q2

OI SUN PIN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5555C

INSPECTION

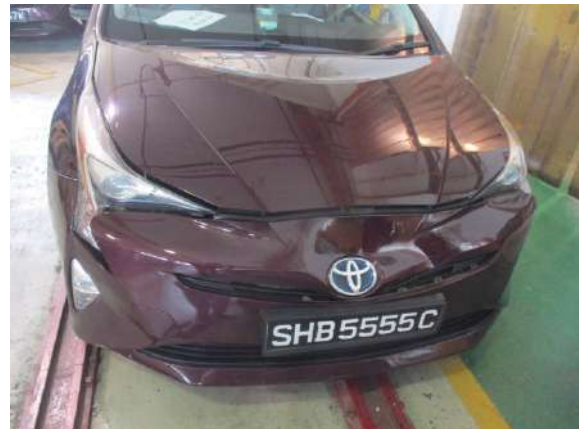



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

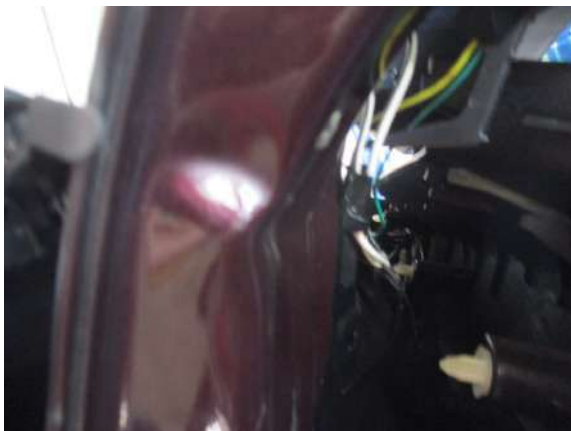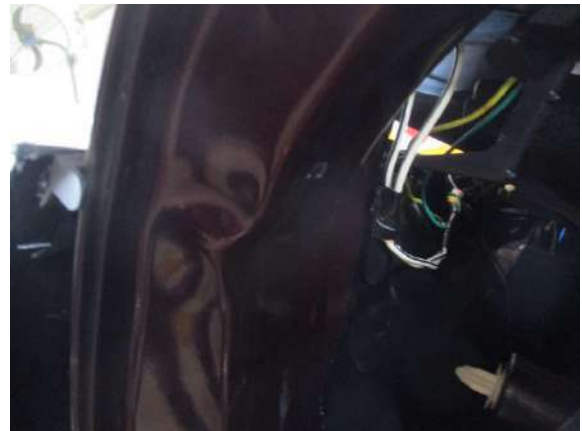



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5555C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

