



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJL 8094U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	HEADLAMP RH	CRACKED	815.00	774.60
1	FRONT BUMPER	BUCKLED / CRACKED	835.60	638.00
10	FRONT BUMPER CLIPS	NECESSARY	39.00	39.00
1	FRONT BUMPER SIDE RETAINER LH	SERVICEABLE	21.70	-
1	FRONT BUMPER SIDE RETAINER RH	SERVICEABLE	21.70	-
1	FRONT BUMPER BRACKET LH	TO REPAIR SEE LABOUR	60.10	-
1	FRONT BUMPER BRACKET RH	TO REPAIR SEE LABOUR	60.10	-
1	FRONT BUMPER GRILLE	SERVICEABLE	313.90	-
1	FRONT BUMPER GRILLE CHROME	SERVICEABLE	287.20	-
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	113.50	-
1	FOG LAMP RH }	SERVICEABLE	371.80	-
1	FOG LAMP GARNISH RH }		-	-
1	RH FRONT FENDER	BUCKLED / BENT	819.30	783.10
1	RH FRONT FENDER UNDERSHIELD	SERVICEABLE	95.70	-
10	RH FRONT FENDER UNDERSHIELD CLIP	NOT NECESSARY	35.00	-
1	RH FRONT FENDER SIGNAL LAMP	SERVICEABLE	28.20	-
1	RH FRONT RIM	SERVICEABLE	922.40	-
	LESS 20% DISCOUNT		-968.04	-446.94
			3,872.16	1,787.76
<b><u>SPECIAL NETT ITEMS</u></b>				
1	RH FRONT TYRE (SN)	SERVICEABLE	350.00	-
			350.00	-
<b><u>LABOUR</u></b>				
	TO RENEW DAMAGED PARTS & KNOCK OUT ACCIDENT REPAIR AREA. (BONNET, FRONT BUMPER, RHF FENDER, SUPPORT PANEL). INCLUSIVE OF THE REPAIR OF FRONT BUMPER BRACKET LH AND FRONT BUMPER BRACKET RH.		800.00	400.00

Report Ref No. CS/SMR21004885/Kuf3e2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PUTTY, RESPRAY PAINT FOR AFFECTED ACCIDENT REPAIR AREA .(BONNET, FRONT BUMPER, RHF FENDER, SUPPORT PANEL)		800.00	400.00
	TO CHECK WIRING, FOCUS HEADLAMP.		50.00	20.00
	TO DO WHEEL ALIGNMENT.	NOT NECESSARY	120.00	-
	TO TUFF COAT.		100.00	30.00
			1,870.00	850.00
GRAND TOTAL			6,092.16	2,637.76
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,100.00

Report Ref No. CS/SMR21004885/Kuf3e2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.