



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBM 7229U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
2	FRONT FORK TUBE ASSY }	BENT / TWISTED	640.00	580.00
1	FORK UNDER BRACKET }		180.00	-
1	HEADLAMP COVER INNER	CRACKED	80.00	80.00
1	FRONT INNER COVER	CRACKED	115.00	115.00
1	FRONT WHEEL RIM	NOT NECESSARY	280.00	-
1	FRONT RIM SHAFT	NOT NECESSARY	45.00	-
1	FRONT RIM BEARING	NOT NECESSARY	38.00	-
1	FRONT BRAKE DISC	NOT NECESSARY	155.00	-
1	HANDLE-BAR	BENT	88.00	88.00
1	HANDLE-BAR ENDS	SCRATCHED	64.00	30.00
1	HEADLAMP	CRACKED	285.00	285.00
1	HEADLAMP COVER OUTER	CRACKED	135.00	135.00
1	METER ASSY	CRACKED	485.00	350.00
2	SIDE MIRRORS	N/S MISSING / O/S CUT	110.00	80.00
1	BRAKE LEVER	SCRATCHED	32.00	32.00
2	FRONT SIGNALS	O/S CRACKED	140.00	60.00
1	SET FAIRING ASSY	BROKEN	560.00	560.00
2	FRONT FOOTREST	O/S CUT	110.00	50.00
2	FRONT FOOTREST BRACKET	BENT (1PC ONLY)	130.00	68.00
1	BRAKE PEDAL	SERVICEABLE	42.00	-
2	REAR FOOTREST	NOT NECESSARY	80.00	-
2	REAR FOOTREST BRACKET	NOT NECESSARY	156.00	-
1	EXHAUST PIPE	TO REPAIR SEE LABOUR	480.00	-
1	EXHAUST PROTECTOR - REAR	CUT	78.00	60.00
1	EXHAUST END CAP	NOT NECESSARY	68.00	-
2	FRONT SIDE INNER COVERS	CRACKED	120.00	120.00
	LESS 10% DISCOUNT		-469.60	-269.30
			4,226.40	2,423.70

Report Ref No. CS/UOI21004993/Uvf3e2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET NUMBER PLATE (SN)	FRONT BENT	28.00	10.00
2	FORK OILS (SN)	NOT NECESSARY	30.00	-
2	FORK OIL SEALS (SN)	NOT NECESSARY	56.00	-
1	SET STEERING CONE (SN)	NECESSARY	90.00	65.00
1	SET STICKER (SN)	NECESSARY	95.00	80.00
			299.00	155.00
	<b><u>LABOUR</u></b>			
	TO PROVIDE TOWING SERVICE (LOD).		30.00	30.00
	TO CHECK WIRING AND RESET HEADLAMP FOCUSING.	NOT NECESSARY	80.00	-
	TO PROVIDE LABOUR. INCLUSIVE OF THE REPAIR OF EXHAUST PIPE.		400.00	300.00
	TO REPAIR BODY FRAME.	NOT NECESSARY	350.00	-
			860.00	330.00
<b>GRAND TOTAL</b>			<b>5,385.40</b>	<b>2,908.70</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>2,300.00</b>

Report Ref No. CS/UOI21004993/Uvf3e2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.