

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way, #09-16  
Singapore 079120

**Our File No:** CC3/AIG21005035/AVCN2**Date:** 14/09/2021**REFERENCE**

Insured/Claimant:	FU WAN PEI CHERYLIN	Policy No:	2100485002	
Date of Loss:	15/04/2021	Nature of Claim:	OD	Claim No: 3636624614SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SLG4090J</b>	Engine No:	CHH119261
Make & Model:	AUDI TT, 2.0 COUPE (A)	Chassis No:	TRUZZZFV9G1010931
Reg. Date:	29/09/2016 (Man. Year: 2015)	Odometer:	47316 km
Colour:	Silver		
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$135,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	245/40R18	Rear Tyre Size:	245/40R18
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

*The above values represent the remaining tyre tread depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	36,859.00	7,590.96	29,268.04	79.41
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,872.00	2,772.00	3,100.00	52.79
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>42,731.00</b>	<b>10,362.96</b>	<b>32,368.04</b>	<b>75.75</b>
<b>- Excess (S\$)</b>	800.00	800.00	0.00	0.00
<b>(S\$)</b>	41,931.00	9,562.96	32,368.04	77.19
<b>+ GST 7.00/7.00% (S\$)</b>	2,935.17	669.41	2,265.76	77.19
<b>Nett Amount (S\$)</b>	<b>44,866.17</b>	<b>10,232.37</b>	<b>34,633.80</b>	<b>77.19</b>

**INSPECTION**

Date of Assignment:	22/04/2021	
Date Inspected:	21/04/2021	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	4.0 days	

**Adjuster:** ADRIAN LING**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	2,506.00 FS	*2,004.80 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	486.00 FS	*- FS
3	2		*FRONT BUMPER CLOSING ELEMENTS LH/RH	Not Necessary	222.00 FS	*- FS
4	1		*FRONT GRILLE-CENTER	Cracked	161.00 FS	*128.40 FS
5	1		*FRONT BUMPER CLOSING ELEMENT LOWER CENTRE	Not Necessary	156.00 FS	*- FS
6	2		*AIR GUIDE GRILLE LH/RH	Cracked	434.00 FS	*346.40 FS
7	1		*RADIATOR GRILLE	Cracked	1,359.00 FS	*1,087.20 FS
8	2		*ULTRASOUND SENSOR LH/RH	Not Necessary	68.00 FS	*- FS
9	1		*AUDI QUATTRO EMBLEM	Necessary	99.00 FS	*79.04 FS
10	1		*AUDI QUATTRO BRACKET	Not Necessary	68.00 FS	*- FS
11	1		*RADIATOR GRILLE CENTRE COVER	Not Necessary	107.00 FS	*- FS
12	2		*ULTRASOUND SENSOR BRACKET LH/RH	Not Necessary	96.00 FS	*- FS
13	2		*FRONT BUMPER COVER LH/RH	Deformed	112.00 FS	*89.44 FS
14	1		*FRONT BUMPER COVER CENTRE	Not Necessary	65.00 FS	*- FS
15	1		*FRONT BUMPER SUPPORT ELEMENT	Not Necessary	35.00 FS	*- FS
16	1		*FRONT BUMPER FOAM	Not Necessary	129.00 FS	*- FS
17	1		*FRONT REINFORCEMENT BEAM	Not Necessary	1,084.00 FS	*- FS
18	2		*FRONT REINFORCEMENT GUIDE SECTION LH/RH	Not Necessary	78.00 FS	*- FS
19	1		*FRONT BUMPER REINFORCEMENT COVER	Not Necessary	127.00 FS	*- FS
20	1		*CAUTION SIGNAGE	Not Necessary	14.00 FS	*- FS
21	1		*AIR CONDITIONER STICKER	Not Necessary	8.00 FS	*- FS
22	2		*FRONT BUMPER INNER SENSOR (Npa)	Not Necessary	0.00 FS	*- FS
23	4		*FRONT BUMPER SENSOR SEAL RING	Not Necessary	14.00 FS	*- FS
24	1		*BONNET	Dented	4,357.00 FS	*3,485.60 FS
25	1		*BONNET ATTACHMENT PARTS	Not Necessary	102.00 FS	*- FS
26	2		*BONNET HINGE LH/RH	Not Necessary	684.00 FS	*- FS
27	2		*BONNET IMPACT PROTECTION LH/RH	Necessary	102.00 FS	*80.64 FS
28	1		*BONNET EDGE PROTECTION	Necessary	30.00 FS	*24.00 FS
29	2		*BONNET STRIKER LH/RH	Not Necessary	212.00 FS	*- FS
30	1		*BONNET COVER	Not Necessary	10.00 FS	*- FS
31	2		*BOWDEN CABLE-CENTER	Not Necessary	58.00 FS	*- FS
32	2		*BONNET LOCK SWITCH	Not Necessary	399.00 FS	*- FS
33	1		*BOWDEN CABLE SIDE	Not Necessary	58.00 FS	*- FS
34	1		*BONNET RELEASE LEVER	Not Necessary	14.00 FS	*- FS
35	2		*LED MATRIX HEADLIGHT LH/RH	Not Necessary	22,162.00 FS	*- FS
36	2		*LIFT CYLINDER LH/RH	Not Necessary	318.00 FS	*- FS
37	1		*LIFT CYLINDER HOSE	Not Necessary	77.00 FS	*- FS
38	2		*RADIATOR AIR GUIDE LH/RH	Not Necessary	72.00 FS	*- FS
39	1		*RADIATOR AIR GUIDE SEAL RH OUTER	Not Necessary	8.00 FS	*- FS
40	2		*WHEEL HOUSING LINERS LH/RH	Not Necessary	234.00 FS	*- FS
41	1		*AUDI CHROME LOGO	Necessary	138.00 FS	*110.00 FS
42	1		*FRONT NO PLATE	Dented	60.00 FS	*60.00 FS
43	1		*SUNDRIES	Necessary	250.00 FS	*27.44 FS
44	2		*FRONT WHEEL HOUSING LINER SECURING STRIP-LH/RH (Supplementary)	Necessary	86.00 FS	*68.00 FS

F=Franchise part. S=SpcNett.

**Total Parts (\$\$)**    **36,859.00**    **7,590.96**

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE,CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS,HORNS,OUTSIDE TEMPERATURE SENSOR,HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER BOTH HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	700.00	0.00
3	TO DISMANTLE AND RENEW FRONT BUMPER,BONNET AND BOTH HEADLIGHTS.RE-ORGANISE CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	2,100.00	1,000.00
4	TO RESPRAY FRONT BUMPER,BONNET AND HINGES	New	2,400.00	1,100.00
5	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
<b>Gross Labour Cost (\$\$)</b>			<b>5,872.00</b>	<b>2,772.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >