

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.  
4 Shenton Way, #21-01 SGX Centre 2  
Singapore 068807

**Our File No:** CS/MSG21005081/R1QF3E2

**Date:** 09/12/2021

### REFERENCE

|                   |               |                  |            |                  |
|-------------------|---------------|------------------|------------|------------------|
| Insured/Claimant: | Tan Kok Cheng | Policy No:       | 1001402263 |                  |
| Date of Loss:     | 18/04/2021    | Nature of Claim: | OD         | Claim No: 256212 |

### DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                       |             |                   |
|-----------------------------|---------------------------------------|-------------|-------------------|
| Reg No:                     | SKR7576J                              |             |                   |
| Make & Model:               | VOLKSWAGEN SHARAN, 2.0 TSI 7N24MY (A) | Engine No:  | DED012358         |
| Reg. Date:                  | 31/05/2017 (Man. Year: 2017)          | Chassis No: | WVWZZZ7NZHV236794 |
| Colour:                     | Blue                                  | Odometer:   | 67128 km          |
| Engine Capacity:            | 1984 cc                               |             |                   |
| Market Value/New Car Price: | S\$102,000.00                         |             |                   |
| Sum Insured (\$\$):         | Market Value/New Car Price            |             |                   |

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |                         |                      |                          |                         |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition:       | Steering (Serviceable): | Yes                  | Footbrake (Serviceable): | Yes                     |
| Handbrake (Serviceable): | Yes                     | Engine Modification: | No                       | Pre-accident Condition: |

### CONDITION OF TYRES

|                   |               |                  |               |
|-------------------|---------------|------------------|---------------|
| Front Tyre Size:  | 225/50 R17    | Rear Tyre Size:  | 225/50 R17    |
| Front Left Side:  | Goodyear 6 mm | Rear Left Side:  | Goodyear 6 mm |
| Front Right Side: | Goodyear 6 mm | Rear Right Side: | Goodyear 6 mm |

The above values represent the remaining tyre tread depth

| COST OF CLAIMS                       | Repairer's       | Adjuster's       | Difference       | Diff %       |
|--------------------------------------|------------------|------------------|------------------|--------------|
| Parts                                | 43,288.93        | 19,317.54        | 23,971.39        | 55.38        |
| Miscellaneous Items                  | 0.00             | 0.00             | 0.00             |              |
| Labour                               | 15,220.00        | 4,900.00         | 10,320.00        | 67.81        |
| Paintwork Labour                     | 0.00             | 0.00             | 0.00             |              |
| Towing                               | 0.00             | 0.00             | 0.00             |              |
| <b>Calculated Gross Total (\$\$)</b> | <b>58,508.93</b> | <b>24,217.54</b> | <b>34,291.39</b> | <b>58.61</b> |
| <b>- Excess (\$\$)</b>               | <b>1,500.00</b>  | <b>1,500.00</b>  | <b>0.00</b>      | <b>0.00</b>  |
| <b>(\$\$)</b>                        | <b>57,008.93</b> | <b>22,717.54</b> | <b>34,291.39</b> | <b>60.15</b> |
| <b>+ GST 7.00/7.00% (\$\$)</b>       | <b>3,990.63</b>  | <b>1,590.23</b>  | <b>2,400.40</b>  | <b>60.15</b> |
| <b>Nett Amount (\$\$)</b>            | <b>60,999.56</b> | <b>24,307.77</b> | <b>36,691.79</b> | <b>60.15</b> |

### INSPECTION

|                             |                          |                                                                                                                       |
|-----------------------------|--------------------------|-----------------------------------------------------------------------------------------------------------------------|
| Date of Assignment:         | 23/04/2021               |                                                                                                                       |
| Date Inspected:             | 23/04/2021 Inspected At: | Vantage Automotive Limited (Alexandra)<br>305 Alexandra Road #02-01, Vantage Automotive<br>Centre<br>Singapore 159942 |
| Estimated Period of Repair: | 14.0 days                |                                                                                                                       |

**Adjuster:** MOHD RASUL

**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

## REPAIR DETAILS

### Reference

**Part Source:** MRM-SG      Version: 1.0 (Last Synchronised: 09 Dec 2021)

**Parts:** M1-MPV      VOLKSWAGEN SHARAN 2.0 TSI 7N24MY (A) (Catalogue:Merimen Singapore 1.0)

**Labour:** Repairer's      (Price-denominated Standard List)

**Print Code:** (Unsubmitted, no print-code for SKR7576J)

**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk \*.

### Recommended Parts

| No. | Qty | Part No. | Particulars                      | Condition     | Repairer's  | Amount       |
|-----|-----|----------|----------------------------------|---------------|-------------|--------------|
| 1   | 1   |          | *FRONT BUMPER LH LOWER COVER     | Not Necessary | 133.18 FS   | *- FS        |
| 2   | 1   |          | *FRONT DOOR RH                   | Bent          | 1,411.78 FS | *1,411.78 FS |
| 3   | 1   |          | *FRONT DOOR SEAL                 | Necessary     | 175.46 FS   | *175.46 FS   |
| 4   | 1   |          | *FRONT DOOR CHROME               | Not Necessary | 129.37 FS   | *- FS        |
| 5   | 1   |          | *FRONT DOOR HINGES RH (UPPER)    | Not Necessary | 53.77 FS    | *- FS        |
| 6   | 1   |          | *FRONT DOOR HINGES RH (LOWER)    | Not Necessary | 53.77 FS    | *- FS        |
| 7   | 1   |          | *FRONT DOOR WINDOW LIFTER        | Not Necessary | 171.48 FS   | *- FS        |
| 8   | 1   |          | *FRONT DOOR WINDOW MOTOR         | Not Necessary | 157.75 FS   | *- FS        |
| 9   | 1   |          | *FRONT WING MIRROR HOUSING       | Cut           | 529.68 FS   | *529.68 FS   |
| 10  | 1   |          | *FRONT WING MIRROR COVER         | Repair        | 60.97 FS    | *- FS        |
| 11  | 1   |          | *FRONT WING MIRROR GASS          | Not Necessary | 124.75 FS   | *- FS        |
| 12  | 1   |          | *REAR DOOR RH SEAL               | Necessary     | 292.03 FS   | *292.03 FS   |
| 13  | 1   |          | *REAR DOOR RH HINGE              | Not Necessary | 159.90 FS   | *- FS        |
| 14  | 1   |          | *REAR DOOR RH WINDOW LIFTER      | Not Necessary | 179.27 FS   | *- FS        |
| 15  | 1   |          | *REAR DOOR RH MOTOR              | Not Necessary | 157.75 FS   | *- FS        |
| 16  | 1   |          | *REAR DOOR RH LOCK               | Not Necessary | 382.68 FS   | *- FS        |
| 17  | 1   |          | *RR DOOR POWER LOCK MOTOR        | Not Necessary | 334.18 FS   | *- FS        |
| 18  | 1   |          | *REAR QUARTER GLASS RH           | Not Necessary | 291.36 FS   | *- FS        |
| 19  | 1   |          | *ROCKER PANEL WITH B-PILLAR RH   | Buckled       | 1,011.82 FS | *1,011.82 FS |
| 20  | 1   |          | *REAR DOOR TOP CHROME RH         | Not Necessary | 142.25 FS   | *- FS        |
| 21  | 1   |          | *FRONT DOOR TOP CHROME RH        | Not Necessary | 186.29 FS   | *- FS        |
| 22  | 1   |          | *CURTAIN ROOF AIRBAG RH          | Activated     | 1,068.05 FS | *1,068.05 FS |
| 23  | 1   |          | *ROOF LINING                     | Deformed      | 1,178.13 FS | *1,178.13 FS |
| 24  | 1   |          | *A-PILLAR INNER COVER RH UPPER   | Not Necessary | 160.60 FS   | *- FS        |
| 25  | 1   |          | *A-PILLAR INNER COVER RH - LOWER | Not Necessary | 22.78 FS    | *- FS        |
| 26  | 1   |          | *FRONT SEAT AIR BAG RH           | Activated     | 711.23 FS   | *711.23 FS   |
| 27  | 1   |          | *WIRE HARNESS                    | Not Necessary | 156.33 FS   | *- FS        |
| 28  | 1   |          | *PADDING ITEM                    | Not Necessary | 212.44 FS   | *- FS        |
| 29  | 1   |          | *FRONT SEAT LEATHER RH           | Torn          | 898.70 FS   | *898.70 FS   |
| 30  | 1   |          | *FRONT SEAT RAIL RH              | Not Necessary | 750.19 FS   | *- FS        |
| 31  | 1   |          | *FRONT SEAT BELT RH              | Activated     | 430.46 FS   | *430.46 FS   |
| 32  | 1   |          | *FRONT SEAT BELT LH              | Activated     | 430.46 FS   | *430.46 FS   |
| 33  | 1   |          | *REAR SEAT BELT RH               | Activated     | 430.46 FS   | *430.46 FS   |
| 34  | 1   |          | *B-PILLAR INNER COVER RH UPPER   | Not Necessary | 141.99 FS   | *- FS        |
| 35  | 1   |          | *AIRBAG STICKER (RH B-PILLAR)    | Not Necessary | 10.86 FS    | *- FS        |
| 36  | 1   |          | *AIRBAG CONTROL UNIT MODULE      | Necessary     | 980.07 FS   | *980.07 FS   |
| 37  | 1   |          | *RH FRONT RIM                    | Not Necessary | 457.63 FS   | *- FS        |
| 38  | 1   |          | *RH REAR RIM                     | Not Necessary | 457.63 FS   | *- FS        |
| 39  | 1   |          | *LH FRONT RIM }                  | Scratched     | 1,762.66 FS | *1,762.66 FS |
| 40  | 1   |          | *LH REAR RIM }                   | Scratched     | 0.00 FS     | *- FS        |
| 41  | 1   |          | *LH REAR SHOCK ABSORBER          | Not Necessary | 191.71 FS   | *- FS        |
| 42  | 1   |          | *LH REAR WHEEL BEARING           | Not Necessary | 339.49 FS   | *- FS        |
| 43  | 1   |          | *RH REAR SHOCK ABSORBER          | Not Necessary | 191.71 FS   | *- FS        |
| 44  | 1   |          | *RH REAR WHEEL BEARING           | Not Necessary | 339.49 FS   | *- FS        |
| 45  | 1   |          | *LH FRONT SHOCK ABSORBER         | Not Necessary | 223.75 FS   | *- FS        |
| 46  | 1   |          | *LH FRONT WHEEL BEARING          | Not Necessary | 299.30 FS   | *- FS        |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                         | Condition     | Repairer's  | Amount       |
|-----|-----|----------|-------------------------------------|---------------|-------------|--------------|
| 47  | 1   |          | *LH FRONT LOWER ARM                 | Not Necessary | 297.06 FS   | *- FS        |
| 48  | 1   |          | *LH FRONT UPPER ARM                 | Not Necessary | 300.62 FS   | *- FS        |
| 49  | 1   |          | *LH TIE ROD                         | Not Necessary | 58.36 FS    | *- FS        |
| 50  | 1   |          | *STEERING RACK AND PINION           | Not Necessary | 3,329.49 FS | *- FS        |
| 51  | 1   |          | *CROSS MEMBER                       | Not Necessary | 908.57 FS   | *- FS        |
| 52  | 1   |          | *LH REAR KING PIN                   | Not Necessary | 420.40 FS   | *- FS        |
| 53  | 1   |          | *LH REAR TRAILING ARM               | Not Necessary | 157.83 FS   | *- FS        |
| 54  | 1   |          | *RH REAR KING PIN                   | Not Necessary | 420.40 FS   | *- FS        |
| 55  | 1   |          | *RH REAR TRAILING ARM               | Not Necessary | 157.83 FS   | *- FS        |
| 56  | 1   |          | *LH FRONT KING PIN                  | Not Necessary | 386.37 FS   | *- FS        |
| 57  | 1   |          | *REAR DOOR RH CHROME                | Not Necessary | 133.95 FS   | *- FS        |
| 58  | 1   |          | *LH REAR SEAT BELT                  | Not Necessary | 474.61 FS   | *- FS        |
| 59  | 1   |          | *FRONT RH DOOR GARNISH (LOWER TRIM) | Necessary     | 132.00 FS   | *132.00 FS   |
| 60  | 1   |          | *REAR RH DOOR GARNISH (LOWER TRIM)  | Necessary     | 203.50 FS   | *203.50 FS   |
| 61  | 1   |          | *RH REAR AIR VENT                   | Cracked       | 48.71 FS    | *48.71 FS    |
| 62  | 1   |          | *FRONT LH SEAT BELT ADJUSTER        | Jammed        | 91.61 FS    | *91.61 FS    |
| 63  | 1   |          | *RH FRT DOOR                        | Not Necessary | 1,482.48 FS | *- FS        |
| 64  | 1   |          | *RH FRT DOOR SEAL OUTER             | Not Necessary | 181.05 FS   | *- FS        |
| 65  | 1   |          | *RH FRT DOOR SEAL INNER             | Cut           | 228.76 FS   | *228.76 FS   |
| 66  | 1   |          | *RR RH DOOR                         | Bent          | 1,731.35 FS | *1,731.35 FS |
| 67  | 1   |          | *RUBBER STOPPER UPPER               | Necessary     | 35.48 FS    | *35.48 FS    |
| 68  | 1   |          | *RUBBER STOPPER LOWER               | Necessary     | 35.48 FS    | *35.48 FS    |
| 69  | 1   |          | *CATCH PLATE UPPER                  | Necessary     | 49.54 FS    | *49.54 FS    |
| 70  | 1   |          | *CATCH PLATE LOWER                  | Necessary     | 49.54 FS    | *49.54 FS    |
| 71  | 1   |          | *DOOR SEAL W/SENSOR                 | Not Necessary | 302.14 FS   | *- FS        |
| 72  | 1   |          | *DOOR ROLLER GUIDE                  | Bent          | 259.34 FS   | *259.34 FS   |
| 73  | 1   |          | *TRIM ROLLER GUIDE                  | Deformed      | 17.86 FS    | *17.86 FS    |
| 74  | 1   |          | *DOOR SEAL LOWER                    | Necessary     | 49.54 FS    | *49.54 FS    |
| 75  | 1   |          | *RH FRT WINDOW REGULATOR            | Bent          | 177.64 FS   | *177.64 FS   |
| 76  | 1   |          | *RH PANEL SEAL                      | Necessary     | 116.70 FS   | *116.70 FS   |
| 77  | 1   |          | *RR RH DOOR INNER SEAL              | Not Necessary | 203.54 FS   | *- FS        |
| 78  | 1   |          | *SIDE PANEL OUTER RH                | Bent          | 1,783.98 FS | *1,783.98 FS |
| 79  | 1   |          | *RH RR PANEL                        | Not Necessary | 164.16 FS   | *- FS        |
| 80  | 1   |          | *TAIL LIGHT PANEL                   | Not Necessary | 133.84 FS   | *- FS        |
| 81  | 1   |          | *ROOF LINING                        | Not Necessary | 1,215.91 FS | *- FS        |
| 82  | 1   |          | *TRIM FOR SEAT BELT                 | Necessary     | 26.18 FS    | *26.18 FS    |
| 83  | 20  |          | *GROMMET                            | Necessary     | 17.00 FS    | *17.00 FS    |
| 84  | 1   |          | *ROOF LIGHTING FRAME FRT            | Not Necessary | 48.57 FS    | *- FS        |
| 85  | 20  |          | *BOLT                               | Necessary     | 19.20 FS    | *19.20 FS    |
| 86  | 20  |          | *CLIPS                              | Necessary     | 48.20 FS    | *48.20 FS    |
| 87  | 1   |          | *SUNGLASS HOLDER                    | Not Necessary | 56.77 FS    | *- FS        |
| 88  | 1   |          | *SEALANT                            | Necessary     | 27.91 FS    | *27.91 FS    |
| 89  | 1   |          | *PADDING FOR BACKREST               | Cut           | 219.21 FS   | *219.21 FS   |
| 90  | 1   |          | *CLIPS                              | Not Necessary | 4.04 FS     | *- FS        |
| 91  | 1   |          | *2ND BENCH BACKREST LEATHER         | Not Necessary | 1,377.37 FS | *- FS        |
| 92  | 1   |          | *2ND BENCH BACKREST PADDING         | Not Necessary | 166.98 FS   | *- FS        |
| 93  | 1   |          | *BALANCE WEIGHT                     | Not Necessary | 104.36 FS   | *- FS        |
| 94  | 20  |          | *POP RIVET                          | Necessary     | 28.00 FS    | *28.00 FS    |
| 95  | 1   |          | *LH FRT SEAT BELT                   | Not Necessary | 474.62 FS   | *- FS        |
| 96  | 1   |          | *LH FRT SEAT BUCKER                 | Not Working   | 160.00 FS   | *160.00 FS   |
| 97  | 1   |          | *RH FRT SEAT BELT                   | Not Necessary | 474.62 FS   | *- FS        |
| 98  | 1   |          | *RH FRT SEAT BUCKER                 | Not Working   | 160.00 FS   | *160.00 FS   |
| 99  | 1   |          | *SIDE AIRBAG RH FRT                 | Not Necessary | 726.62 FS   | *- FS        |
| 100 | 1   |          | *SIDE AIRBAG WIRE HARNESS           | Shorted       | 163.68 FS   | *163.68 FS   |
| 101 | 1   |          | *ROOF SIDE AIRBAG                   | Not Necessary | 1,176.77 FS | *- FS        |
| 102 | 1   |          | *2ND BENCH SEAT BELT RH             | Not Necessary | 474.62 FS   | *- FS        |
| 103 | 1   |          | *CONTROL UNIT FOR AIRBAG            | Not Necessary | 1,034.88 FS | *- FS        |
| 104 | 1   |          | *AIRBAG SENSOR FRT                  | Necessary     | 209.92 FS   | *209.92 FS   |
| 105 | 1   |          | *AIRBAG SENSOR SIDE                 | Necessary     | 241.31 FS   | *241.31 FS   |
| 106 | 1   |          | *CENTRE PILLAR INNER                | Bent          | 345.19 FS   | *345.19 FS   |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars              | Condition     | Repairer's | Amount     |
|-----|-----|----------|--------------------------|---------------|------------|------------|
| 107 | 1   |          | *CENTRE PILLAR UPPER     | Not Necessary | 31.30 FS   | *- FS      |
| 108 | 20  |          | *NUT SQUARE              | Necessary     | 18.40 FS   | *18.40 FS  |
| 109 | 1   |          | *FRT PILLAR LOWER        | Not Necessary | 416.64 FS  | *- FS      |
| 110 | 1   |          | *CENTRE PILLAR           | Bent          | 740.17 FS  | *740.17 FS |
| 111 | 1   |          | *SEAT BELT MOUNTING      | Necessary     | 15.18 FS   | *15.18 FS  |
| 112 | 1   |          | *2ND ROW LH SEAT BELT    | Activated     | 358.60 FS  | *358.60 FS |
| 113 | 1   |          | *REAR DOOR RH INNER SEAL | Necessary     | 197.37 FS  | *197.37 FS |

F=Franchise part. S=SpcNett.

|                           |                  |                  |
|---------------------------|------------------|------------------|
| <b>Total Parts (\$\$)</b> | <b>43,288.93</b> | <b>19,317.54</b> |
|---------------------------|------------------|------------------|

|                                               |
|-----------------------------------------------|
| Report was unsubmitted during this print-out. |
|-----------------------------------------------|

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                              | Particulars                                                                                                                                                                 | Lab.Type | Repairer's       | Amount          |
|---------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|------------------|-----------------|
| <b>Labour Items</b>             |                                                                                                                                                                             |          |                  |                 |
| 1                               | TO CONDUCT OD CLAIM - MSIG INS. DOA 18/04/2021 (NPA)                                                                                                                        | New      | 0.00             | 0.00            |
| 2                               | LABOUR TO REMOVE & REPLACE FRONT DOOR RH, REAR DOOR RH, ROCKER PANEL RH, CENTRE DOOR PILLAR RH, REAR FENDER RH, FRONT FENDER RH, FRONT BUMPER, REAR BUMPER & FLOOR PANEL RH | New      | 3,600.00         | 2,100.00        |
| 3                               | LABOUR TO RESPRAY & PUTTY FRONT DOOR RH, REAR DOOR RH, ROCKER PANEL RH, CENTRE DOOR PILLAR RH, REAR FENDER RH, FRONT FENDER RH, FRONT BUMPER, REAR BUMPER & FLOOR PANEL RH  | New      | 2,800.00         | 1,000.00        |
| 4                               | TO CONDUCT ECU PROGRAMMING CHECK & CLEAR FAULT CODES                                                                                                                        | New      | 480.00           | 250.00          |
| 5                               | TO CONDUCT FULL WHEEL ALIGNMENT                                                                                                                                             | New      | 350.00           | 100.00          |
| 6                               | TO REMOVE & INSTALL FRONT LH SUSPENSION INSPECTION AND REPLACE DAMAGED PARTS                                                                                                | New      | 380.00           | 0.00            |
| 7                               | TO REMOVE & INSTALL REAR LH SUSPENSION, REAR LH AXLE & CONTROL SYSTEM TO FACILITATE THE WORK ON REPAIR BENCH                                                                | New      | 380.00           | 0.00            |
| 8                               | TO REMOVE & INSTALL REAR SUSPENSION, REAR AXLE AND CONTROL SYSTEM FOR INSPECTION AND REPLACE DAMAGED PARTS                                                                  | New      | 580.00           | 0.00            |
| 9                               | TO MOUNT VEHICLE ON REPAIR BENCH TO FACILITATE RE-ALIGNMENT OF CHASSIS ACCORDING TO SPECIFICATION                                                                           | New      | 1,680.00         | 0.00            |
| 10                              | TO REMOVE & INSTALL REAR HAT-TRAY, REAR SEAT, CARPET & ROOF TOP LINING TO FACILITATE THE CUTTING OF THE CENTRE, PILLAR RH, PILLAR LH & ROCKER PANEL RH                      | New      | 600.00           | 250.00          |
| 11                              | TO REMOVE & INSTALL FRONT & REAR RH WINDOW GLASS INCLUDING TO CONDUCT WATER LEAK TEST                                                                                       | New      | 280.00           | 200.00          |
| 12                              | TO REPLACE LEATHER SEAT COVERS ON FRONT SEAT RH INCLUDING TO REMOVE AND INSTALL SEATS                                                                                       | New      | 480.00           | 200.00          |
| 13                              | TO TRANSFER LOCK MECHANISM FRONT & REAR DOOR (RH), DOOR TRIM BOARD AND WINDOW REGULATOR MOTOR                                                                               | New      | 760.00           | 200.00          |
| 14                              | TO CHECK ELECTRICAL WIRING SYSTEM AND TO RESET AIRBAG WARNING LIGHT ON                                                                                                      | New      | 380.00           | 0.00            |
| 15                              | TO REPLACE BOTH FRONT & REAR SEAT BELT TENSIONER                                                                                                                            | New      | 560.00           | 200.00          |
| 16                              | TO REPLACE ROOF TOP HEADLINING AND HEAD AIR BAG                                                                                                                             | New      | 680.00           | 0.00            |
| 17                              | TO REPLACE FRONT RH SEAT AIRBAG                                                                                                                                             | New      | 680.00           | 250.00          |
| 18                              | TO CARRY OUT BODY CAVITY PRESERVATION                                                                                                                                       | New      | 270.00           | 150.00          |
| 19                              | TO SUPPLY 2PCS TYRE - 225/50R17                                                                                                                                             | New      | 280.00           | 0.00            |
| <b>Gross Labour Cost (\$\$)</b> |                                                                                                                                                                             |          | <b>15,220.00</b> | <b>4,900.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >