

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC6/AIG21005153/UPS3Q2  
**Date:** 07/06/2021

### REFERENCE

|                              |                                      |                             |              |
|------------------------------|--------------------------------------|-----------------------------|--------------|
| Handling Insurer:            | AIG Asia Pacific Insurance Pte. Ltd. | Policy No:                  | 7210018329   |
| <b>Claimant Vehicle No :</b> | SKT8526L                             | <b>Insured Vehicle No :</b> | GBF8043T     |
| Date of Loss:                | 23/04/2021                           | Nature of Claim:            | TP           |
|                              |                                      | Claim No:                   | 8367752559SG |

### DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                           |             |                   |
|-----------------------------|-------------------------------------------|-------------|-------------------|
| Reg No:                     | <b>SKT8526L</b>                           | Engine No:  | 1ZRX517747        |
| Make & Model:               | TOYOTA COROLLA ALTIS, 1.6 CLASSIC CVT (A) | Chassis No: | MR053REH104534841 |
| Reg. Date:                  | 25/06/2015 (Man. Year: 2015)              | Odometer:   | 185258 km         |
| Colour:                     | Silver                                    |             |                   |
| Engine Capacity:            | 1598 cc                                   |             |                   |
| Market Value/New Car Price: | N/A                                       |             |                   |
| Sum Insured (S\$):          | <b>Market Value/New Car Price</b>         |             |                   |

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |     |                         |     |                          |     |
|--------------------------|-----|-------------------------|-----|--------------------------|-----|
| General Condition:       |     | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification:    | No  | Pre-accident Condition:  |     |

### CONDITION OF TYRES

|                   |               |                  |               |
|-------------------|---------------|------------------|---------------|
| Front Tyre Size:  | 205/55 R16    | Rear Tyre Size:  | 205/55 R16    |
| Front Left Side:  | Achilles 6 mm | Rear Left Side:  | Achilles 6 mm |
| Front Right Side: | Achilles 6 mm | Rear Right Side: | Achilles 6 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                    | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                    | 18,630.82         | 8,620.64          | 10,010.18         | 53.73         |
| Miscellaneous Items                      | 0.00              | 0.00              | 0.00              |               |
| Labour                                   | 5,340.00          | 3,500.00          | 1,840.00          | 34.46         |
| Paintwork Labour                         | 0.00              | 0.00              | 0.00              |               |
| Towing                                   | 0.00              | 0.00              | 0.00              |               |
| <b>Calculated Gross Total (S\$)</b>      | <b>23,970.82</b>  | <b>12,120.64</b>  | <b>11,850.18</b>  | <b>49.44</b>  |
| <b>Approved Total (Overridden) (S\$)</b> |                   | <b>9,100.00</b>   |                   |               |

|                                    |                  |                 |                  |              |
|------------------------------------|------------------|-----------------|------------------|--------------|
| (S\$)                              | 23,970.82        | 9,100.00        | 14,870.82        | 62.04        |
| <b>+ GST 7.00/7.00% (S\$)</b>      | 1,677.96         | 637.00          | 1,040.96         | 62.04        |
| <b>Nett Amount (S\$)</b>           | <b>25,648.78</b> | <b>9,737.00</b> | <b>15,911.78</b> | <b>62.04</b> |
| <b>Global Sum Settlement (S\$)</b> |                  | <b>0.00</b>     |                  |              |

INSPECTION

Date of Assignment: 27/04/2021

Date Inspected: 27/04/2021

Estimated Period of Repair: 12.0 days

Inspected At: Tan Lim Motor Pte Ltd (Defu)  
1 Defu Lane 6  
Singapore 539365

**Adjuster:** MARCUS CHUA**Manager:** CHEW HSIAO TONG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

| No. | Qty | Part No. | Particulars                          | Condition        | Repairer's  | Amount       |
|-----|-----|----------|--------------------------------------|------------------|-------------|--------------|
| 1   | 1   |          | *REAR BUMPER                         | Distorted        | 486.50 FL   | *486.50 FL   |
| 2   | 8   |          | *REAR BUMPER CLIPS                   | Necessary        | 34.40 FL    | *34.40 FL    |
| 3   | 1   |          | *O/S REAR BUMPER REFLECTOR           | Broken           | 58.00 FL    | *58.00 FL    |
| 4   | 1   |          | *REAR BUMPER PARKING SENSOR HOLDER   | Not Necessary    | 35.00 FL    | *- FL        |
| 5   | 1   |          | *REAR BUMPER SIDE RETAINER           | O/S Cracked      | 240.00 FL   | *65.50 FL    |
| 6   | 2   |          | *REAR BUMPER BRACKET                 | Not Necessary    | 136.00 FL   | *- FL        |
| 7   | 1   |          | *REAR BUMPER BEAM                    | Bent             | 395.00 FL   | *395.00 FL   |
| 8   | 1   |          | *REAR BOOTLID                        | Dented / Buckled | 755.00 FL   | *755.00 FL   |
| 9   | 2   |          | *REAR BOOTLID REFLECTOR              | Serviceable      | 710.00 FL   | *- FL        |
| 10  | 1   |          | *REAR BOOTLID INNER TRIM             | Not Necessary    | 307.50 FL   | *- FL        |
| 11  | 2   |          | *REAR BOOTLID HINGE                  | Repair           | 136.00 FL   | *- FL        |
| 12  | 1   |          | *REAR BOOTLID LOCK                   | Not Necessary    | 382.50 FL   | *- FL        |
| 13  | 1   |          | *REAR BOOTLID COROLLA EMBLEM         | Necessary        | 61.00 FL    | *41.00 FL    |
| 14  | 1   |          | *REAR BOOTLID ALTIS EMBLEM           | Necessary        | 48.00 FL    | *45.00 FL    |
| 15  | 1   |          | *REAR BOOTLID TOYOTA LOGO            | Necessary        | 57.30 FL    | *50.70 FL    |
| 16  | 1   |          | *REAR BOOTLID OUTER CHROME MOULDING  | Not Necessary    | 233.70 FL   | *- FL        |
| 17  | 1   |          | *REAR BOOTLID WEATHERSTRIP           | Twisted          | 185.00 FL   | *175.80 FL   |
| 18  | 1   |          | *REAR BOOTLID CATCH                  | Not Necessary    | 26.00 FL    | *- FL        |
| 19  | 2   |          | *TAILLAMP                            | Cracked          | 790.00 FL   | *783.40 FL   |
| 20  | 1   |          | *TAILLAMP CLIPS (O/S)                | Necessary        | 4.30 FL     | *4.30 FL     |
| 21  | 1   |          | *O/S TAILLAMP PANEL                  | Badly Dented     | 84.00 FL    | *84.00 FL    |
| 22  | 1   |          | *REAR END PANEL                      | Badly Dented     | 590.00 FL   | *590.00 FL   |
| 23  | 1   |          | *REAR END PANEL TOP GARNISH          | Not Necessary    | 240.00 FL   | *- FL        |
| 24  | 1   |          | *O/S REAR FENDER                     | Distorted        | 986.80 FL   | *986.80 FL   |
| 25  | 1   |          | *O/S REAR FENDER INNER COWLING       | Torn             | 52.80 FL    | *52.80 FL    |
| 26  | 1   |          | *O/S REAR FENDER INNER COWLING CLIPS | Necessary        | 4.30 FL     | *4.30 FL     |
| 27  | 1   |          | *O/S REAR FENDER INNER TRIM          | Distorted        | 256.00 FL   | *256.00 FL   |
| 28  | 1   |          | *O/S REAR FENDER INNER GARNISH       | Not fitted       | 759.00 FL   | *- FL        |
| 29  | 1   |          | *O/S REAR FENDER INNER GARNISH CLIPS | Not fitted       | 4.30 FL     | *- FL        |
| 30  | 1   |          | *O/S REAR FENDER INNER PANEL         | Repair           | 265.00 FL   | *- FL        |
| 31  | 1   |          | *O/S REAR FENDER INNER TOW GARNISH   | Not Necessary    | 105.00 FL   | *- FL        |
| 32  | 1   |          | *O/S REAR DOOR                       | Badly Dented     | 1,079.60 FL | *1,079.60 FL |
| 33  | 1   |          | *O/S REAR DOOR LOCK                  | Shorted / Jammed | 445.00 FL   | *445.00 FL   |
| 34  | 1   |          | *O/S REAR DOOR OUTER HANDLE          | Cut              | 143.00 FL   | *143.00 FL   |
| 35  | 1   |          | *O/S REAR DOOR OUTER MOULDING        | Not Necessary    | 111.60 FL   | *- FL        |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                                      | Condition      | Repairer's  | Amount       |
|-----|-----|----------|--------------------------------------------------|----------------|-------------|--------------|
| 36  | 1   |          | *O/S REAR DOOR WEATHERSTRIP                      | Not Necessary  | 174.60 FL   | *- FL        |
| 37  | 1   |          | *O/S REAR DOOR POWER WINDOW MOTOR                | Not Necessary  | 585.00 FL   | *- FL        |
| 38  | 1   |          | *O/S REAR DOOR POWER WINDOW REGULAR              | Not Necessary  | 265.00 FL   | *- FL        |
| 39  | 1   |          | *O/S REAR DOOR INNER TRIM BOARD                  | Not Necessary  | 746.50 FL   | *- FL        |
| 40  | 1   |          | *N/S REAR FENDER                                 | Repair         | 986.80 FL   | *- FL        |
| 41  | 1   |          | *N/S REAR FENDER INNER TRIM                      | Not Necessary  | 759.00 FL   | *- FL        |
| 42  | 1   |          | *N/S REAR FENDER INNER TRIM CLIPS                | Not Necessary  | 4.30 FL     | *- FL        |
| 43  | 1   |          | *FLOOR PANEL                                     | Repair         | 797.00 FL   | *- FL        |
| 44  | 1   |          | *FLOOR BOARD                                     | Not Necessary  | 267.00 FL   | *- FL        |
| 45  | 1   |          | *SPEAKER PANEL                                   | Repair         | 256.00 FL   | *- FL        |
| 46  | 1   |          | *SPEAKER BOARD                                   | Not Necessary  | 756.20 FL   | *- FL        |
| 47  | 1   |          | *REAR WINDSCREEN PANEL                           | No such part   | 658.00 FL   | *- FL        |
| 48  | 1   |          | *ROOF LINING                                     | Not Necessary  | 1,120.00 FL | *- FL        |
| 49  | 1   |          | *REAR AXLE                                       | Bent / Twisted | 2,850.00 FL | *1,815.12 FL |
| 50  | 1   |          | *O/S REAR WHEEL BEARING                          | Damaged        | 670.00 FL   | *355.00 FL   |
| 51  | 1   |          | *O/S REAR ABSORBER                               | Twisted        | 200.00 FL   | *192.30 FL   |
| 52  | 1   |          | *EXHAUST BOX                                     | Dented         | 939.00 FL   | *799.10 FL   |
| 53  | 1   |          | *REAR WINDSCREEN GLASS                           | Shattered      | 985.90 FL   | *985.90 FL   |
| 54  | 2   |          | *REAR BUMPER PARKING SENSOR                      | Not Necessary  | 319.90 FS   | *- FS        |
| 55  | 1   |          | *REAR WINDSCREEN PRIMER                          | Necessary      | 30.00 FS    | *30.00 FS    |
| 56  | 1   |          | *REAR WINDSCREEN SEALANT                         | Necessary      | 80.00 FS    | *40.00 FS    |
| 57  | 1   |          | *REAR WINDSCREEN INNER SEAL                      | Necessary      | 50.00 FS    | *30.00 FS    |
| 58  | 1   |          | *O/S REAR TYRE (LOCAL PURCHASE) (\$180.00) (60%) | Punctured      | 280.00 FS   | *108.00 FS   |
| 59  | 1   |          | *O/S REAR RIM                                    | Bent / Cracked | 450.00 FS   | *400.00 FS   |

F=Franchise part. S=SpcNett. L=ListItemDisc.

|                                                          |                  |                  |
|----------------------------------------------------------|------------------|------------------|
| <b>Sub Total (\$)</b>                                    | <b>24,437.80</b> | <b>11,291.52</b> |
| <b>- List Item Discount on L Items 25.00/25.00% (\$)</b> | 5,806.98         | 2,670.88         |
| <b>Total Parts (\$)</b>                                  | <b>18,630.82</b> | <b>8,620.64</b>  |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                             | Particulars                                                                                                                                      | Lab.Type | Repairer's      | Amount          |
|--------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|----------|-----------------|-----------------|
| <b>Labour Items</b>            |                                                                                                                                                  |          |                 |                 |
| 1                              | PANEL BEATING ,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION ,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME                           | New      | 2,400.00        | 1,600.00        |
| 2                              | PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION                                                                                                 | New      | 1,400.00        | 1,200.00        |
| 3                              | TO REMOVE AND REFIT REAR WINDSCREEN GLASS                                                                                                        | New      | 140.00          | 120.00          |
| 4                              | TO REMOVE AND REFIT INTERIOR FITTINGS ,TRIMMINGS ,GARNISH AND OTHER ,TO ENABLE REPAIR }                                                          | New      | 250.00          | 80.00           |
| 5                              | TO DISMANTLE AND REFIT REAR SEAT ,BACKREST ,TRIMMING ,GARNISH ROOF -LINING ,SPEAKER SHELFBOARD ,CARPETING AND OTHER TO ENABLE BODY WORK REPAIR } | New      | 120.00          | 0.00            |
| 6                              | TO DROP PETROL TANK ,HOSES TO FACILITATE BODYWORK REPAIR ,FINAL CHECKING AND TESTING                                                             | New      | 80.00           | 0.00            |
| 7                              | TO REINSTALL OF REAR BUMPER PARKING SENSOR                                                                                                       | New      | 80.00           | 50.00           |
| 8                              | TO CHECK ELECTRICAL LIGHTING CONCERNED                                                                                                           | New      | 80.00           | 20.00           |
| 9                              | TO DROP REAR AXLE AND SUSPENSION ASSY ,REMOVE AND RENEWAL OF NECESSARY PARTS ,TO CONDUCT FINAL CHECKING AND TESTING                              | New      | 300.00          | 250.00          |
| 10                             | TO TRANSFER OF O/S REAR DOOR FITTINGS AND PERFORM WATER SEEPAGE TEST                                                                             | New      | 80.00           | 0.00            |
| 11                             | TO RUST-PROOFING OF THE AFFECTED AREAS                                                                                                           | New      | 250.00          | 120.00          |
| 12                             | TO TRANSFER OF O/S REAR TYRE ,RIM AND ON WHEEL BALANCING }                                                                                       | New      | 80.00           | 60.00           |
| 13                             | TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT }                                                                                        | New      | 80.00           | 0.00            |
| <b>Gross Labour Cost (S\$)</b> |                                                                                                                                                  |          | <b>5,340.00</b> | <b>3,500.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >