



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2105742

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 16/08/2021
Reference CC6/CTI21005218/Ars3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMQ 2877E
Insured Veh. SMM 920Y
Claim No. SNM21D202412/LKKDS
Policy No. DMPCSNW00144342000
Accident Date 23/04/2021
Inspection Date 26/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC6/CTI21005218/Ars3q2	
			Date: 16/08/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMM 920Y	Veh. Inspected	SMQ 2877E	
Policy No.	DMPCSNW00144342000	Coverage (\$)	0.00	
Claim No.	SNM21D202412/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	26/04/2021	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI AVANTE	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHD841CMKU915863	Colour	WHITE	
Odometer	21251 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	NEXEN	6 mm	
L/H Front Tyre	195/65 R15	NEXEN	6 mm	
R/H Rear Tyre	195/65 R15	NEXEN	6 mm	
L/H Rear Tyre	195/65 R15	NEXEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/04/2021	Inspection Date	26/04/2021	
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMQ 2877E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	630.00	474.00
1	REAR BUMPER LOWER LID	CRACKED	420.00	385.00
2	REAR BUMPER RETAINER @\$59.60	NECESSARY	119.20	119.20
2	REAR BUMPER REFLECTOR @\$160.00	NOT NECESSARY	320.00	-
1	REAR BUMPER REINFORCEMENT	CRACKED	422.00	378.00
2	REAR BUMPER REINFORCEMENT BRACKET @\$180.60	NOT NECESSARY	361.20	-
1	SET NUMBER PLATE LAMP	NOT NECESSARY	120.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	577.30	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	180.10	-
	LESS 20% DISCOUNT		-629.96	-271.24
			2,519.84	1,084.96
<u>SPECIAL NETT ITEMS</u>				
1	REAR NUMBER PLATE (SN)	DENTED	50.00	50.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	20.00	20.00
1	REAR END PANEL INSULATION SEALANT (SN)	NOT NECESSARY	100.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	20.00	-
1	REVERSE SENSOR (SN)	DAMAGED	220.00	200.00
			410.00	270.00
<u>LABOUR</u>				
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,000.00	400.00
	TO SPRAY PAINT AFFECTED AREA.		1,000.00	400.00
	TO APPLY RUST PROOFING AND TUFF COAT.		150.00	50.00
	WIRING CHECK .		60.00	30.00
	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING .	NOT NECESSARY	120.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING .		120.00	50.00
			2,450.00	930.00
GRAND TOTAL			5,379.84	2,284.96
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,800.00

Report Ref No. CC6/CTI21005218/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 2877E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMQ 2877E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

