

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG21005246/T1UF3E2

Date: 02/06/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2070124741
Claimant Vehicle No : SMR7761S Insured Vehicle No : SKK8337M
Date of Loss: 26/04/2021 Nature of Claim: TP Claim No: 0727605263SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMR7761S**
Make & Model: HONDA SHUTTLE HYBRID, 1.5 (A) Engine No: LEB7105232
Reg. Date: 21/01/2020 (Man. Year: 2018) Chassis No: GP72004023
Colour: Black Odometer: 116251 km
Engine Capacity: 1496 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 185/60 R15 Rear Tyre Size: 185/60 R15
Front Left Side: Premio 6 mm Rear Left Side: Premio 6 mm
Front Right Side: Premio 6 mm Rear Right Side: Premio 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 28/04/2021
Date Inspected: 28/04/2021 Inspected At: Neo Automotive (HQ)
53 UBI AVE 1 #05-44 PAYA UBI INDUSTRIAL
PARK SINGAPORE
Singapore 408934
Estimated Period of Repair: 12.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: Tan Hui Zhen

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE: \$93,000.00

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Deformed	0.00 F	*- F
2	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
3	1		*FRT BUMPER SIDE RETAINER	Necessary	0.00 F	*- F
4	1		*FRT BUMPER REINFORCEMENT	Bent	0.00 F	*- F
5	1		*FRT BUMPER LOWER SPOILER	Deformed	0.00 F	*- F
6	2		*FRT HEADLAMP ASSY LH & RH	Cracked	0.00 F	*- F
7	1		*FRT LH FENDER	Repair	0.00 F	*- F
8	1		*FRT RADIATOR GRILLE	Cracked	0.00 F	*- F
9	1		*FRT GRILLE EMBLEM	Necessary	0.00 F	*- F
10	1		*FRT NUMBER PLATE	Cracked	0.00 F	*- F
11	1		*FRT BUMPER LOWER PANEL	Bent	0.00 F	*- F
12	1		*REAR NUMBER PLATE	Deformed	0.00 F	*- F
13	1		*REAR BUMPER	Deformed	0.00 F	*- F
14	1		*REAR BUMPER CLIPS	Necessary	0.00 F	*- F
15	1		*REAR BUMPER SIDE RETAINER	Deformed	0.00 F	*- F
16	1		*REAR BUMPER REFLECTOR GARNISH	Deformed	0.00 F	*- F
17	1		*REAR BUMPER REFLECTOR	Cut	0.00 F	*- F
18	1		*REAR BUMPER LOWER COVER LH	Torn	0.00 F	*- F
19	1		*REVERSE SENSOR	Not Working	0.00 F	*- F
20	1		*REAR END PANEL	Bent	0.00 F	*- F
21	1		*REAR END PANEL TOP GARNISH	Deformed	0.00 F	*- F
22	1		*REAR LH TAILLAMP	Cracked	0.00 F	*- F
23	1		*REAR LH TAILLAMP PANEL	Bent	0.00 F	*- F
24	1		*TAILGATE	Bent	0.00 F	*- F
25	1		*TAILGATE EMBLEM	Necessary	0.00 F	*- F
26	1		*TAILGATE OUTER GARNISH	Deformed	0.00 F	*- F
27	1		*TAILGATE MOULDING CHROME	Cracked	0.00 F	*- F
28	1		*TAILGATE LAMP LH	Cracked	0.00 F	*- F
29	1		*TAILGATE GLASS	Cracked	0.00 F	*- F
30	1		*TAILGATE GLASS MOULDING	Necessary	0.00 F	*- F
31	1		*TAILGATE GLASS SEALANT	Necessary	0.00 F	*- F
32	1		*TAILGATE LOCK	Bent	0.00 F	*- F
33	1		*TAILGATE RUBBER	Cut	0.00 F	*- F
34	1		*TAILGATE HINGE	* Check	0.00 F	*- F
35	1		*TAILGATE DAMPER	* Check	0.00 F	*- F
36	1		*TAILGATE INNER BOARD	Deformed	0.00 F	*- F
37	1		*SPARE TYRE BOARD	Deformed	0.00 F	*- F
38	1		*SPARE TYRE PANEL	Repair	0.00 F	*- F
39	1		*SPARE TYRE SIDE PANEL	Bent	0.00 F	*- F
40	1		*REAR LH CHASSIS MEMBER	Repair	0.00 F	*- F
41	1		*REAR LH FENDER	Bent	0.00 F	*- F
42	1		*REAR LH FENDER INNER PANEL	Repair	0.00 F	*- F
43	1		*REAR LH FENDER INNER TRIM UPPER	Deformed	0.00 F	*- F
44	1		*REAR LH FENDER INNER TRIM LOWER	Deformed	0.00 F	*- F
45	1		*REAR LH FENDER INNER SHIELD	Deformed	0.00 F	*- F
46	1		*REAR FENDER 1/4 GLASS RUBBER	Necessary	0.00 F	*- F
47	1		*REAR FENDER 1/4 GLASS SEALANT	Necessary	0.00 F	*- F
48	1		*REAR FENDER AIR GRILLE	Deformed	0.00 F	*- F
49	1		*FRT BONNET	Bent	0.00 F	*- F

F=Franchise part.

Total Parts (S\$)0.000.00

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >