



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2104951

INV Date 14/07/2021

Reference CC4/LPC21005335/Kps3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 5186D

Insured Veh. SLE 3877Z

Claim No. 20/21/21/VP05/024500

Policy No. Z19VP05024624

Accident Date 27/04/2021

Inspection Date 30/04/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21005335/Kps3q2 Date: 14/07/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SLE 3877Z	Veh. Inspected	SHC 5186D
	Policy No.	Z19VP05024624	Coverage (\$)	0.00
	Claim No.	20/21/21/VP05/024500	Excess (\$)	0.00
	Assign From	KENNY	Assign Date	30/04/2021
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS (A)	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2020
	Chassis No.	JTDKB3FU003092241	Colour	M . P. WHITE / RED
	Odometer	47757 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	9 mm
	L/H Front Tyre	195/65 R15	SAILUN	9 mm
	R/H Rear Tyre	195/65 R15	DUNLOP	8 mm
	L/H Rear Tyre	195/65 R15	DUNLOP	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	27/04/2021	Inspection Date	30/04/2021
	Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 5186D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	COVER REAR BUMPER	BENT	485.60	485.60
1	REINFORCEMENT SUB-ASSY ,REAR BUMPER	BENT	332.70	332.70
1	GUARD ,REAR BUMPER CENTER	BENT	374.50	374.50
1	COVER REAR BUMPER LOWER	DENTED	22.00	22.00
1	RETAINER ,REAR BUMPER SIDE ,LH	SERVICEABLE	132.60	-
1	RETAINER ,REAR BUMPER SIDE ,RH	SERVICEABLE	132.60	-
1	REFLECTOR ASSY ,REFLEX LH	SERVICEABLE	39.00	-
1	REFLECTOR ASSY ,REFLEX RH	SERVICEABLE	39.00	-
1	BOX DECK FLOOR LH	SERVICEABLE	313.00	-
1	BOX DECK FLOOR REAR	SERVICEABLE	105.80	-
1	BOX DECK FLOOR RH	SERVICEABLE	313.60	-
1	BOARD ,REAR FLOOR NO.1	SERVICEABLE	519.00	-
1	PANEL SUB-ASSY ,BODY LOWER BACK	TO REPAIR SEE LABOUR	651.00	-
1	COVER ,DECK TRIM ,REAR	SERVICEABLE	126.70	-
1	COVER FLOOR UNDER NO.2 (RH)	SERVICEABLE	241.90	-
1	COVER FLOOR UNDER NO.1 (LH)	SERVICEABLE	175.10	-
1	COVER REAR FLOOR (CTR)	MISSING	229.90	229.90
1	PANEL SUB-ASSY ,BACK DOOR	TO REPAIR SEE LABOUR	1,147.80	-
1	GARNISH SUB-ASSY ,BACK DOOR ,OUTSIDE	CRACKED	913.60	913.60
1	STAY ASSY ,BACK DOOR LH	SERVICEABLE	242.50	-
1	STAY ASSY ,BACK DOOR RH	SERVICEABLE	242.50	-
1	HINGE ASSY ,BACK DOOR LH	TO REPAIR SEE LABOUR	61.00	-
1	HINGE ASSY ,BACK DOOR RH	TO REPAIR SEE LABOUR	61.00	-
1	ORNAMENT SUB-ASSY ,BACK DOOR	NECESSARY	47.90	47.90
1	PLATE LUGGAGE COMPARTMENT DOOR NAME NO.2	NECESSARY	54.60	54.60
1	PLATE BACK DOOR NAME NO.1	NECESSARY	54.60	54.60
	LESS 25% DISCOUNT		-1,764.88	-628.85
			5,294.62	1,886.55

Report Ref No. CC4/LPC21005335/Kps3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	DENTED	700.00	220.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	85.00	50.00
1	BUMPER CENTRE GUARD CLIP (SN)	NOT NECESSARY	80.00	-
1	REAR BUMPER PROTECTOR (SN)	NECESSARY	180.00	30.00
1	REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	75.00	-
1	BOOT STICKER TRANSCAB (SN)	NECESSARY	100.00	30.00
1	BOOT STICKER 65553333 (SN)	NECESSARY	100.00	30.00
2	WINDSCREEN SEALANT (SN)	NECESSARY	150.00	80.00
1	WINDSCREEN MOULDING (SN)	NECESSARY	200.00	200.00
1	WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	130.00	30.00
			1,800.00	670.00
	<u>LABOUR</u>			
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS .	NOT NECESSARY	240.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.		380.00	60.00
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF PANEL SUB-ASSY ,BODY LOWER BACK ,PANEL SUB-ASSY ,BACK DOOR ,HINGE ASSY ,BACK DOOR LH AND HINGE ASSY ,BACK DOOR RH.		1,600.00	500.00
	TO TRANSFER OF REAR END PANEL FITTINGS ,ATTACHMENTS TO FACILITATE BODYWORK REPAIR .	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		1,600.00	660.00
	TO REMOVE AND REFIT REAR BIG & SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR .		300.00	180.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	50.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			4,840.00	1,470.00
	GRAND TOTAL		11,934.62	4,026.55

Report Ref No. CC4/LPC21005335/Kps3q2



RECOMMENDED COST OF REPAIRS			4,026.55
-----------------------------	--	--	----------

Report Ref No. CC4/LPC21005335/Kps3q2

A handwritten signature in black ink, appearing to be 'KSC'.

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 5186D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 5186D

RE-INSPECTION

