



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200854

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 16/02/2022
Reference CC6/CTI21005404/Ars3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMR 8847Y
Insured Veh. SMH 4565P
Claim No. SNM21D202582/C02
Policy No. DMPCSNW00017862100
Accident Date 02/05/2021
Inspection Date 04/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI21005404/Ars3q2	
			Date: 16/02/2022	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMH 4565P	Veh. Inspected	SMR 8847Y	
Policy No.	DMPCSNW00017862100	Coverage (\$)	0.00	
Claim No.	SNM21D202582/C02	Excess (\$)	0.00	
Assign From		Assign Date	04/05/2021	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. X1	c.c	1499	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	WBAJG12080EA98250	Colour	SILVER	
Odometer	33409 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/50 R18	PIRELLI	6 mm	
L/H Front Tyre	225/50 R18	PIRELLI	6 mm	
R/H Rear Tyre	225/50 R18	PIRELLI	6 mm	
L/H Rear Tyre	225/50 R18	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	02/05/2021	Inspection Date	04/05/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMR 8847Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	SIDE SKIRT RH	CUT	1,245.20	880.00
1	SIDE SKIRT OUTER GARNISH RH	TO REPAIR SEE LABOUR	685.30	-
1	SIDE SKIRT INNER SUPPORT GARNISH RH	NOT NECESSARY	171.50	-
1	FRONT DOOR EMBLEM (S-DRIVE)	NECESSARY	98.30	98.30
1	FRONT DOOR EMBLEM (18I)	NECESSARY	95.30	95.30
1	FRONT FENDER RH	DENTED	1,091.90	895.00
1	FRONT FENDER TOP RUBBER RH	NOT NECESSARY	39.50	-
1	FRONT FENDER ARCH GARNISH RH	CUT	325.60	325.60
1	FRONT FENDER INNER SHIELD RH (FRONT)	NOT NECESSARY	285.30	-
1	FRONT BUMPER	TO REPAIR SEE LABOUR	1,195.00	-
1	FRONT BUMPER SIDE RETAINERS	NOT NECESSARY	123.90	-
1	SET FRONT BUMPER CLIPS	NOT NECESSARY	50.00	-
1	FRONT BUMPER LOWER SKIRT	NOT NECESSARY	457.90	-
1	FRONT BUMPER SENSOR RH	NOT NECESSARY	245.80	-
1	FRONT BUMPER SENSOR HOLDER RH	NOT NECESSARY	39.20	-
1	HEADLAMP RH	CUT	2,987.50	2,987.50
1	HEADLAMP SIDE BRACKET RH	NOT NECESSARY	125.30	-
1	HEADLAMP BOTTOM BRACKET RH (INNER)	NOT NECESSARY	95.80	-
1	HEADLAMP BOTTOM BRACKET RH (OUTER)	NOT NECESSARY	96.30	-
1	SIDE MIRROR ASSY RH	NOT NECESSARY	985.30	-
1	FRONT ABSORBER RH	NOT NECESSARY	671.50	-
1	FRONT UPPER ARM RH	NOT NECESSARY	558.30	-
1	FRONT LOWER ARM RH	BENT	698.50	698.50
1	FRONT KNUCKLE ARM RH	NOT NECESSARY	787.70	-
1	FRONT WHEEL BEARING RH	DAMAGED	598.30	598.30
1	FRONT RIM RH	CUT	1,085.60	1,085.60
1	FRONT DOOR RH	DENTED	1,985.60	1,203.00
1	FRONT DOOR WEATHERSTRIP RH	NECESSARY	198.70	198.70
1	FRONT DOOR LOCK RH	NOT NECESSARY	345.20	-

Report Ref No. CC6/CTI21005404/Ars3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT DOOR INNER TRIM RH	NOT NECESSARY	856.30	-
1	FRONT DOOR OUTER GARNISH RH	CUT	298.50	298.50
	LESS 10% DISCOUNT		-1,852.41	-936.43
			16,671.69	8,427.87
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT SPORT RIM TYRE (SN)	NOT NECESSARY	280.00	-
1	SET FRONT BUMPER CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET SIDESKIRT CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET FRONT DOOR INNER TRIM CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET FRONT FENDER ARCH GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
			430.00	60.00
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF SIDE SKIRT OUTER GARNISH RH AND FRONT BUMPER .		1,600.00	650.00
	SPRAY PAINTING.		1,600.00	650.00
	CHECK WIRING ON HEADLAMP AND FOCUSING.		180.00	30.00
	ANTI RUST.		180.00	40.00
	REMOVE AND TRANSFER FRONT DOOR MECHANISM .		160.00	80.00
	REMOVE AND INSTALL FRONT UNDERCARRIAGE.		180.00	120.00
	TO PERFORM COMPUTERIZE WHEEL ALIGNMENT.		120.00	80.00
	TO RESET FRONT DOOR POWER WINDOW FUNCTION.	NOT NECESSARY	180.00	-
			4,200.00	1,650.00
GRAND TOTAL			21,301.69	10,137.87

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,100.00
---	--	--	-----------------

Report Ref No. CC6/CTI21005404/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 8847Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 8847Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

